

1. General Description

The DM9331A is a physical-layer, single-chip, low power transceiver for media converter application. On the media side, it provides a direct interface either to Unshielded Twisted Pair Category 5 Cable (UTP5) for 100BASE-TX Fast Ethernet, and it also provides PECL interface to connect the external fiber optical transceiver. Through the Media Converter Interface (MCI), the DM9331A connects to another DM9331A for the twisted pair to the fiber media converter, or fiber to fiber repeater.

The DM9331A uses a low-power and high-performance CMOS process. It contains the

entire physical layer functions of 100BASE-TX as defined by IEEE802.3u, including the Physical Codina Sublaver (PCS). Physical Attachment (PMA), Twisted Pair Physical Medium Dependent Sublayer (TP-PMD) and a PECL compliant interface for a fiber optical module, compliant with ANSI X3.166. The DM9331A provides a strong support for the auto-negotiation function, utilizing automatic selection of full or half-duplex mode. Furthermore, due to the built-in wave-shaping filter, the DM9331A needs no external filter to transport signals to the media on the 100base-TX Ethernet operation.

2. Block Diagram

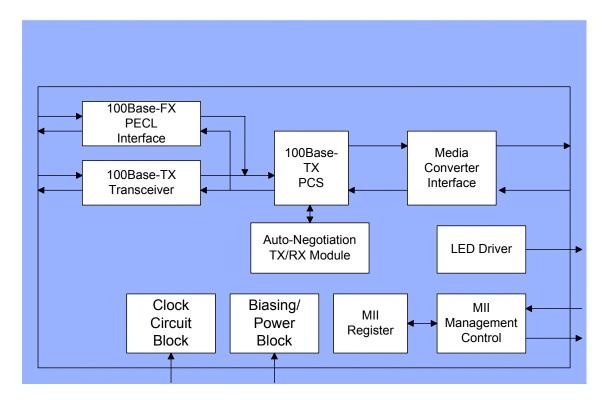








Table of Contents			
1. General Description	1	7.2.9 Remote Auto-loopback Diagnostic17	
2. Block Diagram	1	•	
3. Features	4	8. MII Register Description	19
4. Pin Configuration: DM9331A LQFP	5	8.2 Basic Mode Status Register (BMSR) - 01 2 8.3 Auto-negotiation Advertisement Register (ANAF - 04 2	₹)
5. Pin Description	6	8.4 Auto-negotiation Link Partner Ability Register	- '
5.1 Media Converter Interface, 19 pins		(ANLPAR) - 05	22
5.2 Media Interface, 5 pins		8.5 Auto-negotiation Expansion Register (ANER)	
5.3 LED Interface, 3 pins		- 06	22
5.4 Mode, 1 pin		8.6 DAVICOM Specified Configuration Register	
5.5 Bias and Clock, 3 pins	8	(DSCR)-16	2
5.6 Power, 15 pins	8	3	
5.7 Table A		8.7 DAVICOM Specified Configuration and Status	
	0	Register (DSCSR) - 17	24
6.LED Configuration	10	8.8 DAVICOM Specified Interrupt Register - 21 2	
o.eeb oomigaration		o.o B/W/OOM oposition interrupt (Voglotor 21 2	-0
7. Functional Description	11	9. DC and AC Electrical Characteristics	26
7.1 MCI interface		9.1 Absolute Maximum Ratings	
7.2 100Base-TX Operation		9.2 Operating Conditions	
7.2.1 100Base-TX Operation		9.3 DC Electrical Characteristics	
7.2.1 100Base-1X Transmit		9.4 AC Electrical Characteristics & Timing	-1
7.2.1.1 4B3B Effcodel		•	0
		Waveforms	
7.2.1.3 Parallel to Serial Converter		9.4.1 TP Interface	
7.2.1.4 NRZ to NRZI Encoder		9.4.2 Oscillator Timing	
7.2.1.5 NRZI to MLT-3		9.4.3 MDC/MDIO Timing	
7.2.1.6 MLT-3 Driver		9.4.4 MDIO Timing when OUTPUT by STA 2	
7.2.1.7 4B5B Code Group	15	9.4.5 MDIO Timing when OUTPUT by DM9331A . 2	29
7.2.2 100Base-TX Receiver		9.4.6 Auto-negotiation and Fast Link Pulse Timing	
7.2.2.1 Signal Detect	15	Parameters	29
7.2.2.2 Adaptive Equalizer	15	9.4.7 Auto-negotiation and Fast Link Pulse Timing	
7.2.2.3 MLT-3 to NRZI Decoder	15	Diagram2	29
7.2.2.4 Clock Recovery Module		9.4.8 TXD to TP or FX Transmit Latency Timing	
7.2.2.5 NRZI to NRZ	15	Diagram 3	30
7.2.2.6 Serial to Parallel	15	9.4.9 TXD to TP or FX Transmit Latency Parameter	
7.2.2.7 Descrambler			30
7.2.2.8 Code Group Alignment	15	9.4.10 TP or FX to RXD Receive Latency Timing	
7.2.2.9 4B5B Decoder	16	Diagram 3	30
7.2.3 Auto-Negotiation	16	9.4.11 TP or FX to RXD Receive Latency Parameter	ers
7.2.4 MII Serial Management			
7.2.4.1 Serial Management Interface			
7.2.4.2 Management Interface – Read Frame	_	10. Application Notes 3	31
Structure	. 16	10.1 Network Interface Signal Routing	31
7.2.4.3 Management Interface – Write Frame		10.2 100Base-TX Side Application	
Structure	17	10.3 100Base-TX Side (Power Reduction	
7.2.5 Power Reduced Mode		Application)3	32
7.2.6 Power Down Mode		10.4 100Base-FX Side Application	13
7.2.7 Reduced Transmit Power Mode		10.5 Power Decoupling Capacitors	
7.2.8 Link Fault Propagation		10.6 Ground Plane Layout	
1.4.0 Litik i ault i topayation	1/	10.0 Olouliu i laile Layout	,,,





100 Mbps Twisted Pair/Fiber Ethernet Media Converter Chip

10.7 Dower Plane Portitioning	26	10.12 Magnetics Colection Cuide	40
10.7 Power Plane Partitioning		10.13 Magnetics Selection Guide	42
10.8 Media Converter Interface	37		
10.9 Link Fault Propagation Application	38	11. Package Information	43
10.10 Auto-loopback Diagnostic	39		
10.11 Media Converter or Repeater		12. Ordering Information	44
Application40			
10.12 Link Fault Propagation LED Display	41		







3. Features

4

- 100Base-TX to 100Base-FX media converter application chip set
- 100Base-FX to 100Base-FX repeater application chip set under full duplex mode
- 100Base-TX to 100Base-TX repeater application chip set under full duplex mode
- Optional Fault propagation on no link condition.
- Fully compliant with IEEE 802.3u 100Base-TX/FX
- Compliant with ANSI X3T12 TP-PMD 1995 standard
- Supports Auto-Negotiation function to 100 Mbps full/half duplex, compliant with IEEE 802.3u
- Remote fault detection capability
- Far end fault signaling option in FX mode
- Selectable twisted-pair or fiber mode output
- Remote Auto-loopback Diagnostic in FX mode


- Selectable full-duplex or half-duplex operation
- Provides Loopback mode for easy system diagnostics
- LED status outputs indicate Link/Activity, Full/Half-duplex and Fault LED
- Single Low-Power Supply of 3.3V with 0.35µm CMOS technology
- Very Low Power consumption modes:
 - Power Reduced mode (cable detection)
 - Power Down mode
 - Selectable TX drivers for 1:1 or 1.25:1 transformers for additional power reduction
- Compatible with 3.3V and 5.0V tolerant I/Os
- 48-pin LQFP small package (1x1 cm)

Preliminary Version: DM9331A-DS-P02

Version: DM9331A-DS-P02 October 20, 2008



4. Pin Configuration

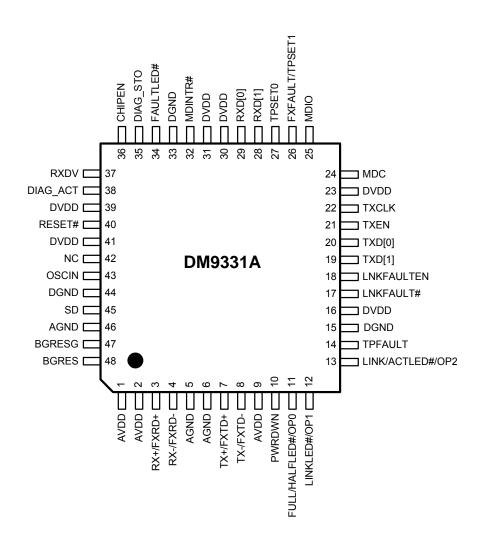







5. Pin Description

 $\label{eq:linear_power} I: Input, \quad O: Output, \quad LI: Latch input when power-up/reset, \quad Z: Tri-State output, \quad U: Pulled up \\ D: Pulled down$


6

5.1 Media Converter Interface, 18 pins

Pin No.	Pin Name	I/O	Description
14	TPFAULT	0	Twisted Pair Fault 0 = Twisted pair link fault 1 = Twisted pair normal work
17	LNKFAULT#	l	Link Fault Propagation 0 = Link fault propagation is active 1 = normal operation
18	LNKFAULTEN	I	Link Fault Propagation Enable 0 = Link fault propagation disable 1 = Link fault propagation enable
20,19	TXD [0:1]	I	Transmit Data 2-bit data inputs (synchronous to the 50MHz OSCIN)
21	TXEN	I	Transmit Enable Active high indicates the presence of valid data on the TXD [0:1] for 100Mbps mode
22	TXCLK	0	Transmit Clock 25MHz transmit clock
24	MDC	I	Management Data Clock Synchronous clock for the MDIO management data. This clock is provided by management entity, and it is up to 2.5MHz
25	MDIO	I/O	Management Data I/O Bi-directional management data that may be provided by the station management entity or the PHY
26	FXFAULT/ TPSET1	O, Z, LI (D)	Fiber Fault 0 = Fiber link fault; Fiber receive far end fault package or fiber disconnect 1 = Fiber normal work TPSET1 (reset latch input) 0 = Fiber mode; default pull low 1 = Twisted pair mode; need $10k\Omega$ resistor to pull high
27	TPSET0	Z, LI (D)	Twisted Pair set (reset latch input) $0 = \text{Fiber mode}$; default pull low $1 = \text{Twisted pair mode}$; need $10\text{k}\Omega$ resistor to pull high
29,28	RXD [0:1]	O, Z, LI (D)	Receive Data Output 2-bit data outputs (synchronous to the 50MHz OSCIN) Chip PHY-address of Management Register (reset latch input) RXD [0:1] FX Mode: TP Mode: 0,0 PHY-address = 0X00 0X0C 0,1 PHY-address = 0X01 0X0D 1,0 PHY-address = 0X02 0X0E 1,1 PHY-address = 0X03 0X0F 0 = Defaults 1 = Needs $10k\Omega$ register to pull high

Preliminary Version: DM9331A-DS-P02

October 20, 2008





100 Mbps Twisted Pair/Fiber Ethernet Media Converter Chip

32	MDINTR#	O, Z	Status Interrupt Output Asserted low whenever there is a status change (link, speed, duplex). The MDINTR# pin has a high impedance output, a $2.2K\Omega$ pulled high resistor is needed
34	FAULTLED#	O, Z	Link Fault LED Active Low In TP mode, Indicates TP Fault LED In FX mode, Indicates FX Fault LED
35	DIAG_STO	0	Diagnostic Status Output When DIAG_ACT=1 and FX mode 1 = The route of fiber connect succeeds 0 = The route of fiber connect fails
36	CHIPEN	Z, LI (D)	Chip Set Enable Need a $10k\Omega$ resistor pull high for enabling a chip set
37	RXDV	O,	Receive Data Valid Asserted high to indicate that the valid data is present on the RXD[0:1]
38	DIAG_ACT	I (L)	Diagnostic Active 1 = Active fiber diagnostic 0 = Inactive fiber diagnostic
40	RESET#	I	Reset Active low input initializes the DM9331A

5.2 Media Interface, 5 pins

Pin No.	Pin Name	I/O	Description
3,4	RX+/FXRD+	-	Differential Receive Pair/PECL Receive Pair
	RX-/FXRD-		Differential data is received from the media
			Differential Pseudo ECL signal is received from the media in fiber mode
7,8	TX+/FXTD+	0	Differential Transmit Pair/PECL Transmit Pair
	TX-/FXTD-		Differential data is transmitted to the media in TP mode
			Differential Pseudo ECL signal transmits to the media in fiber mode
45	SD	-	Fiber-optic Signal Detect
			PECL signal which indicates whether or not the fiber-optic receive pair
			is receiving valid signal levels

5.3 LED Interface, 3 pins

Pin No.	Pin Name	I/O	Description
11	FULL O,		Full-Duplex/ Half-Duplex LED
	/HALF LED#	LI	Active states indicate Full-duplex mode. Active states see LED
	/OP0	(U)	configuration
			OP0 : (power up reset latch input)
			This pin is used to control the forced or advertised operating mode of
			the DM9331A according to the Table A. The value is latched into the
			DM9331A registers at power-up/reset
12	LINK LED#	Ο,	Link LED
	/OP1	LI	Active states indicate good link. Active states see LED configuration
		(U)	OP1 : (power up reset latch input)



			This pin is used to control the forced or advertised operating mode of the DM9331A according to the Table A. The value is latched into the DM9331A registers at power-up/reset
13	LINK/ACT LED# /OP2	O, LI (U)	Link LED & Activity LED: Active states indicate good link. It is also an activity LED function when transmitting or receiving data. Active states see LED configuration OP2: (power up reset latch input) This pin is used to control the forced or advertised operating mode of the DM9331A according to the Table A. The value is latched into the DM9331A registers at power-up/reset

5.4 Mode, 1 pin

Pin No.	Pin Name	1/0	Description
10	PWRDWN	T	Power Down Control Asserted high to force DM9331A into power down mode. When in power down mode, most of the DM9331A circuit block's power is turned off, only the MII management interface (MDC, MDIO) logic is available. To leave power down mode, DM9331A need the hardware or
			software reset with the PWRDWN pin low

5.5 Bias and clock, 3 pins

Pin No.	Pin Name	I/O	Description
47	BGRESG	Р	Bandgap Ground
48	BGRES	I/O	Bandgap Voltage Reference Resistor 6.8K ohm
43	OSCIN	I	3.3V 50MHz clock input must be using 3.3v output oscillators

5.6 Power, 15 pins

Pin No.	Pin Name	I/O	Description
1,2,9	AVDD	Р	Analog Power
5,6,46	AGND	Р	Analog Ground
16,23,30,31,	DVDD	Р	Digital Power
39,41			
15,33,44	DGND	Р	Digital Ground

5.7 Table A

8

OP2	OP1	OP0	Function
0	0	0	Auto negotiation enables 100TX Full/Half capabilities





100 Mbps Twisted Pair/Fiber Ethernet Media Converter Chip


1	0	1	Manually select 100TX HDX
1	1	0	Manually select 100TX FDX
0	0	1	Manually select 100FX HDX
0	1	0	Manually select 100FX FDX



6. LED Configuration

LEDs flash once for about 500ms after power-on reset or software reset by writing PHY register. All LED pins are dual function pins, which can be configured as either active high or low by pulling

them low or high accordingly. If the pin is pulled high, the LED is active low after reset. Likewise, if the pin is pulled low, the LED is active high.

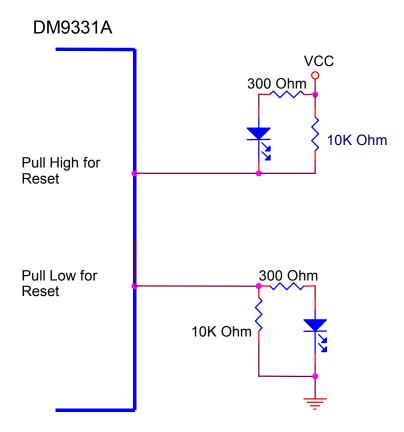

10 Preliminary

Version: DM9331A-DS-P02 October 20, 2008



7. Functional Description

The DM9331A Fast Ethernet single-chip transceiver, providing the functionality as specified in IEEE 802.3u, integrates a complete 100Base-TX module and a complete 100Base-FX module. The DM9331A provides a Media Converter Interface (MCI) as connection interface.

The DM9331A performs all PCS (Physical Coding Sublayer), PMA (Physical Media Access), TP-PMD

(Twisted Pair Physical Medium Dependent) sublayer and a PECL compliant interface for a fiber optic module. Figure 1 shows the major functional blocks implemented in the DM9331A.

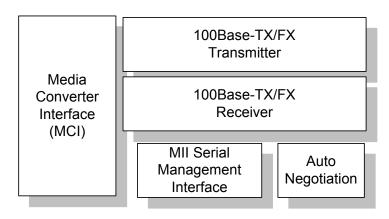


Figure 7-1

7.1 MCI Interface

The DM 9331A provides a Media Converter Interface (MCI) The purpose of the MCI interface is to provide a simple, easy to implement connection to another DM9331A.

The MCI consists of a 2-bit receive data bus, a 2-bit transmit data bus, and controls signals to facilitate data transfers between the two DM9331A chips.

- TXD (transmit data) is a 2-bit data that is driven by the reconciliation sublayer synchronously with respect to OSCIN clock. For each OSCIN clock period, which TXEN is asserted, TXD (1:0) is accepted for transmission by the PHY.
- TXEN (transmit enable) inputs from another DM9331A

RXDV signal reconciliation sublayer indicates that data is being presented on the MCI for transmission on the physical medium.

- RXD (receive data) is a 2-bit data that are sampled by the reconciliation sublayer synchronously with respect to OSCIN clock. For each OSCIN clock period, which RXDV is asserted, RXD (1:0) is transferred from the PHY to another DM9331A.
- RXDV (receive data valid) output to another DM9331A
 TXEN signal indicates that the DM9331A is data ready.



7.2 100Base-TX Operation

12

The 100Base-TX transmitter receives 2-bit data clocked in at 50MHz from the MCI, and outputs a scrambled 5-bit encoded MLT-3 signal to the media at 100Mbps. The on-chip clock circuit converts the 25MHz clock into a 125MHz clock for internal use.

These two busses include various controls and signal indications that facilitate data transfers between the DM9331A chip set.

7.2.1 100Base-TX Transmit

The 100Base-TX transmitter consists of the functional blocks shown in figure 2. The 100Base-TX transmit section converts 2-bits synchronous data provided by the MCI to a scrambled MLT-3 125 million symbols per second serial data stream.

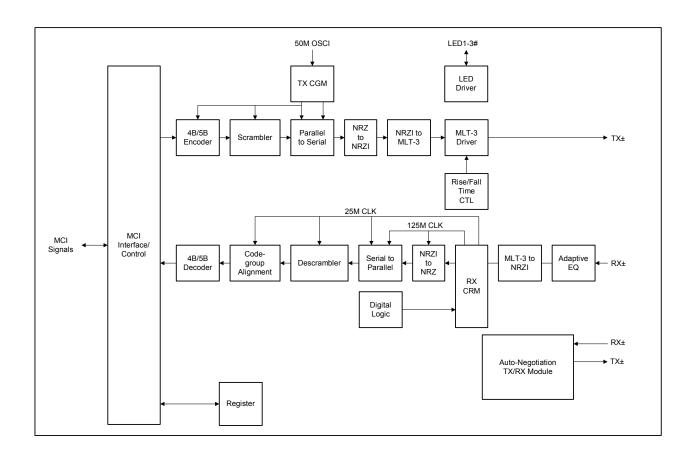


Figure 7-2

Preliminary







100Base-TX Operation

The block diagram in figure 2 provides an overview of the functional blocks contained in the transmit section.

The transmitter section contains the following functional blocks:

- 4B5B Encoder
- Scrambler
- Parallel to Serial Converter
- NRZ to NRZI Encoder
- NRZI to MLT-3
- MLT-3 Driver

7.2.1.1 4B5B Encoder

The 4B5B encoder converts 4-bit (4B) nibble data. generated by the MAC Reconciliation Layer into a 5-bit (5B) code group for transmission, refer to Table 1. This conversion is required for control and packet data to be combined in code groups. The 4B5B encoder substitutes the first 8 bits of the MAC preamble with a J/K code-group pair (11000 10001) upon transmit. The 4B5B encoder continues to replace subsequent 4B preamble and data nibbles with corresponding 5B code-groups. At the end of the transmit packet, upon the deassertion of the Transmit Enable signal from the MAC Reconciliation layer, the 4B5B encoder injects the T/R code-group pair (01101 00111) indicating end of frame. After the T/R code-group pair, the 4B5B encoder continuously injects IDLEs into the transmit data stream until Transmit Enable is asserted and the next transmit packet is detected.

The DM9331A includes a Bypass 4B5B conversion option within the 100Base-TX Transmitter for support of applications like 100 Mbps repeaters which do not require 4B5B conversion.

7.2.1.2 Scrambler

The scrambler is required to control the radiated emissions (EMI) by spreading the transmit energy across the

frequency spectrum at the media connector and on the twisted pair cable in 100Base-TX operation.

By scrambling the data, the total energy presented to the cable is randomly distributed over a wide frequency range. Without the scrambler, energy levels on the cable could peak beyond FCC limitations at frequencies related to repeated 5B sequences like continuous transmission of IDLE symbols. The scrambler output is combined with the NRZ 5B data from the code-group encoder via an XOR logic function. The result is a scrambled data stream with sufficient randomization to decrease radiated emissions at critical frequencies.

7.2.1.3 Parallel to Serial Converter

The Parallel to Serial Converter receives parallel 5B scrambled data from the scrambler and serializes it (converts it from a parallel to a serial data stream). The serialized data stream is then presented to the NRZ to NRZI Encoder block

7.2.1.4 NRZ to NRZI Encoder

After the transmit data stream has been scrambled and serialized, the data must be NRZI encoded for compatibility with the TP-PMD standard for 100Base-TX transmission over Category-5 unshielded twisted pair cable.

7.2.1.5 NRZI to MLT-3

The MLT-3 conversion is accomplished by converting the data stream output from the NRZI encoder into two binary data streams with alternately phased logic one events.

7.2.1.6 MLT-3 Driver

The two binary data streams created at the MLT-3 converter are fed to the twisted pair output driver which converts these streams to current sources and alternately drives either side of the transmit transformer primary winding resulting in a minimal current MLT-3 signal.



7.2.1.7 4B5B Code Group

Symbol	Meaning	4B code 3210	5B code 43210
0	Data 0	0000	11110
1	Data 1	0001	01001
2	Data 2	0010	10100
3	Data 3	0011	10101
4	Data 4	0100	01010
5	Data 5	0101	01011
6	Data 6	0110	01110
7	Data 7	0111	01111
8	Data 8	1000	10010
9	Data 9	1001	10011
Α	Data A	1010	10110
В	Data B	1011	10111
С	Data C	1100	11010
D	Data D	1101	11011
Е	Data E	1110	11100
F	Data F	1111	11101
I	ldle	undefined	11111
J	SFD (1)	0101	11000
K	SFD (2)	0101	10001
Т	ESD (1)	undefined	01101
R	ESD (2)	undefined	00111
Н	Error	undefined	00100
V	Invalid	undefined	00000
V	Invalid	undefined	00001
V	Invalid	undefined	00010
V	Invalid	undefined	00011
V	Invalid	undefined	00101
V	Invalid	undefined	00110
V	Invalid	undefined	01000
V	Invalid	undefined	01100
V	Invalid	undefined	10000
V	Invalid	undefined	11001

Table 7-1



7.2.2 100Base-TX Receiver

The 100Base-TX receiver contains several function blocks that convert the scrambled 125Mb/s serial data to synchronous 2-bit nibble data that is then provided to the MCI.

The receive section contains the following functional blocks:

- Signal Detect
- Digital Adaptive Equalizer
- MLT-3 to NRZI Decoder
- Clock Recovery Module
- NRZI to NRZ Decoder
- Serial to Parallel
- Descrambler
- Code Group Alignment
- 4B5B Decoder

7.2.2.1 Signal Detect

The signal detect function meets the specifications mandated by the ANSI XT12 TP-PMD 100Base-TX Standards for both voltage thresholds and timing parameters.

7.2.2.2 Adaptive Equalizer

When transmitting data at high speeds over copper twisted pair cable, attenuation based on frequency becomes a concern. In high speed twisted pair signaling, the frequency content of the transmitted signal can vary greatly during normal operation based on the randomness of the scrambled data stream. This variation in signal attenuation caused by frequency variations must be compensated for to ensure the integrity of the received data. In order to ensure quality transmission when employing MLT-3 encoding, the compensation must be able to adapt to various cable lengths and cable types depending on the installed environment. The selection of long cable lengths for a given implementation, requires significant compensation which will be over-killed in a situation that includes shorter, less attenuating cable lengths. Conversely, the selection of short or intermediate cable lengths requiring less compensation will cause serious under-compensation for longer length cables. Therefore, the compensation or equalization must be adaptive to ensure proper conditioning of the received signal independent of the cable length.

7.2.2.3 MLT-3 to NRZI Decoder

The DM9331A decodes the MLT-3 information from the Digital Adaptive Equalizer into NRZI data.

7.2.2.4 Clock Recovery Module

The Clock Recovery Module accepts NRZI data from the MLT-3 to NRZI decoder. The Clock Recovery Module locks onto the data stream and extracts the 125MHz reference clock. The extracted and synchronized clock and data are presented to the NRZI to NRZ decoder.

7.2.2.5 NRZI to NRZ

The transmit data stream is required to be NRZI encoded in for compatibility with the TP-PMD standard for 100Base-TX transmission over Category-5 unshielded twisted pair cable. This conversion process must be reversed on the receive end. The NRZI to NRZ decoder receives the NRZI data stream from the Clock Recovery Module and converts it to a NRZ data stream to be presented to the Serial to Parallel conversion block.

7.2.2.6 Serial to Parallel

The Serial to Parallel Converter receives a serial data stream from the NRZI to NRZ converter, and converts the data stream to parallel data to be presented to the descrambler.

7.2.2.7 Descrambler

Because of the scrambling process required to control the radiated emissions of transmit data streams, the receiver must descramble the receive data streams. The descrambler receives scrambled parallel data streams from the Serial to Parallel converter, descrambles the data streams, and presents the data streams to the Code Group alignment block.

7.2.2.8 Code Group Alignment

The Code Group Alignment block receives un-aligned 5B data from the descrambler and converts it into 5B code group data. Code Group Alignment occurs after the J/K is detected, and subsequent data is aligned on a fixed boundary.



7.2.2.9 4B5B Decoder

The 4B5B Decoder functions as a look-up table that translates incoming 5B code groups into 4B (Nibble) data. When receiving a frame, the first two 5-bit code groups received are the start-of-frame delimiter (J/K symbols). The J/K symbol pair is stripped and two nibbles of preamble pattern are substituted. The last two code groups are the end-of-frame delimiter (T/R symbols).

The T/R symbol pair is also stripped from the nibble presented to the Reconciliation layer.

7.2.3 Auto-Negotiation

The objective of Auto-negotiation is to provide a means to exchange information between segment linked devices and to automatically configure both devices to take maximum advantage of their abilities. It is important to note that Auto-negotiation does not test the link segment characteristics. The Auto-Negotiation function provides a

7.2.4 MII Serial Management

The MII serial management interface consists of a data interface, basic register set, and a serial management interface to the register set. Through this interface it is possible to control and configure multiple PHY devices, get status and error information, and determine the type and capabilities of the attached PHY device(s).

The DM9331A management functions correspond to MII specification for IEEE 802.3u-1995 (Clause 22) for registers 0 through 6 with vendor-specific registers 16,17, and 18.

In read/write operation, the management data frame is 64-bits long and starts with 32 contiguous logic one bits (preamble) synchronization clock cycles on MDC. The Start of Frame Delimiter (SFD) is indicated by a <01> pattern followed by the operation code

means for a device to advertise supported modes of operation to a remote link partner, acknowledge the receipt and understanding of common modes of operation, and to reject un-shared modes of operation. This allows devices on both ends of a segment to establish a link at the best common mode of operation. If more than one common mode exists between the two devices, a mechanism is provided to allow the devices to resolve to a single mode of operation using a predetermined priority resolution function.

Auto-negotiation also provides a parallel detection function for devices that do not support the Auto-negotiation feature. During Parallel detection there is no exchange of configuration information, instead, the receive signal is examined. If it is discovered that the signal matches a technology that the receiving device supports, a connection will be automatically established using that technology. This allows devices that do not support Auto-negotiation but support a common mode of operation to establish a link.

(OP):<10> indicates read operation and <01> indicates write operation. For read operation, a 2-bit turnaround (TA) filing between Register Address field and Data field is provided for MDIO to avoid contention. Following the turnaround time, 16-bit data is read from or written onto management registers.

7.2.4.1 Serial Management Interface

The serial control interface uses a simple two-wired serial interface to obtain and control the status of the physical layer through the MII interface. The serial control interface consists of MDC (Management Data Clock), and MDI/O (Management Data Input/Output) signals.

The MDIO pin is bi-directional and may be shared by up to 32 devices.

7.2.4.2 Management Interface - Read Frame Structure




Figure 7-3

7.2.4.3 Management Interface - Write Frame Structure

16






Figure 7-4

7.2.5 Power Reduced Mode

The Signal detect circuit is always turned on to monitor whether there is any signal on the media. In case of cable disconnection, DM9331A will automatically turn off the power and enter the Power Reduced mode, regardless of its operation mode being N-way auto-negotiation or forced mode. While in the Power Reduced mode, the transmit circuit will continue sending out fast link pules with minimum power consumption. If a valid signal is detected from the media, which might be N-way fast link pules, 10Base-T normal link pules, or 100Base-TX MLT3 signals, the device wakes up and resumes normal operation mode.

Automatic reduced power down mode can be disabled by writing Zero to Reg.16.4.

7.2.6 Power Down Mode

Power Down mode is entered by setting Reg.0.11 to ONE or pulling PWRDWN pin high, which disables all transmit, receive functions and MCI interface functions except the MDC/MDIO management interface.

7.2.7 Reduced Transmit Power Mode

Additional Transmit power reduction can be gained by designing with 1.25:1 turns ration magnetics on its TX side and using a 8.5K Ω resistor on BGRES and BGRESG pins, and the TX+/TX- pull-high resistors being changed from 50 Ω to 78 Ω . This configuration could reduce about 20% of transmit power.

7.2.8 Link Fault Propagation

The DM9331A will propagate link fault signals from media to another DM9331A. If link fault happens, the DM9331A will send out fault signals to another DM9331A.

In FX mode, their are two types of link failure, receive link failure or remote fault (receive far end fault). In the event of a fiber receive link failure, the DM9331A will send out an FX fault signal. The DM9331A will send out a far end fault signal to the fiber optic media, if the DM9331A receive the fault signal from the other device.

In TP mode, In the event of a TP receive link failure, the DM9331A will send out a TP fault signal. The DM9331A will stop to transmit idle signal to the CAT5 media, if the DM9331A receive the fault signal from the other device.

7.2.9 Remote Auto-loopback Diagnostic

Remote Auto-loopback Diagnostic is for detecting link fault. It enables users to operate on one side, and diagnose the status of fiber link. To achieve this function, the FX should both use DM9331A.

When the local DIAG_ACT is active, the DM9331A will auto break off the receive and transmit signals and sends detecting signals. When the remote DM9331A diagnoses a detecting signal, it will auto break off the normal receive and transmit signal, and reply a detecting signal to local at the same time.

Therefore, when DIAG_ACT is active and DIAG_STO is on, it means that the receive and transmit route of FX is normal. On the other hand, if DIAG_ACT is active and DIAG_STO is off, then it means that the receive and transmit route of FX is invalid.



8. MII Register Description

ADD	Name	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
00	CONTROL	Reset	Loop	Speed	Auto-N	Power	Isolate	Restart	Full	Coll.				Reserve	ed		
			back	select	Enable	Down		Auto-N	Duplex	Test							
01	STATUS	T4	TX FDX	TX HDX			Res	erved			Pream.	Auto-N	Remote	Auto-N	Link	Rsvd	Extd
		Cap.	Сар.	Cap.							Supr.	Compl.	Fault	Cap.	Status		Сар.
04	Auto-Neg.	Next	FLP Rcv	Remote	Rese	erved	FC	T4	TX FDX	TX HDX	Rsvd	Rsvd	Ad	dvertised	Protocol	Selector	Field
	Advertise	Page	Ack	Fault			Adv	Adv	Adv	Adv							
05	Link Part.	LP Next	LP	LP	Rese	erved	LP	LP	LP	LP	LP	LP	Lin	k Partner	Protocol	Selector	Field
	Ability	Page	Ack	RF			FC	T4	TX FDX	TX HDX	10 FDX	10 HDX					
06	Auto-Neg.						Reserved	i					Pardet	LP Next	Next Pg	New Pg	LP AutoN
	Expansion												Fault	Pg Able	Able	Rcv	Сар.
16	Aux.	BP	BP	BP	BP_A	Rsvd	TX/FX	FEF	RMCI	Force	SPDLE	Rsvd	RPDCT	Reset	Pream.	Sleep	Remote
	Config.	4B5B	SCR	ALIGN	DPOK		Select	Enable	Enable	100LNK	D_CTL		R-EN	St. Mch	Supr.	mode	LoopOut
17	Aux.	100	100	Rese	rved				Rese	rved				A	uto-N. Mo	nitor Bit	[3:0]
	Conf/Stat	FDX	HDX													•	
21	MDINTR	INTR		Reserved		FDX	Rsvd	Link	INTR	ı	Reserved	t	FDX	Rsvd	Link	Rsvd	INTR
		PEND				Mask		Mask	Mask				Change		Change		Status

Key to Default

In the register description that follows, the default column takes the form:

<Reset Value>, <Access Type> / <Attribute(s)>

Where:

<Reset Value>:

1 Bit set to logic one

0 Bit set to logic zero

Χ No default value

(PIN#) Value latched in from pin # at reset <Access Type>:

RO = Read only

RW = Read/Write

<Attribute (s)>:

SC = Self clearing

P = Value permanently set

LL = Latching low

LH = Latching high

18 Preliminary Version: DM9331A-DS-P02







8.1 Basic Mode Control Register (BMCR) - 00

Bit	Bit Name	Default	Description
0.15	Reset	0,RW/SC	Reset
		-,	1=Software reset
			0=Normal operation
			This bit sets the status and controls the PHY registers to their
			default states. This bit, which is self-clearing, will keep returning a
			value of one until the reset process is completed
0.14	Loopback	0, RW	Loopback
			Loop-back control register
			1 = Loop-back enabled
			0 = Normal operation
			When in 100Mbps operation mode, setting this bit may cause the
			descrambler to lose synchronization and produce a 720ms "dead
			time" before any valid data appears at the MCI receive outputs
0.13	Speed	1, RW	Speed Select
	Selection		1 = 100Mbps
			0 = invalid
0.12	Auto-negotiation	1, RW	Auto-negotiation Enable
	Enable		1 = Auto-negotiation is enabled, bit 8 and 13 will be in
			auto-negotiation status
0.11	Power Down	0, RW	Power Down
			While in the power-down state, the PHY should respond to
			management transactions. During the transition to power-down
			state and while in the power-down state, the PHY should not
			generate spurious signals on the MCI
			1 = Power down
2.12		0.5117	0 = Normal operation
0.10	Isolate	0,RW	Isolate
			1 = Isolates the DM9331A from the MCI with the exception of the
			serial management. (When this bit is asserted, the DM9331A does
			not respond to the TXD [0:1] and TXEN inputs, and it shall present
			a high impedance on its TXCLK, RXDV, and RXD [0:1] outputs.
			When the PHY is isolated from the MCI, it shall respond to the
			management transactions) 0 = Normal operation
0.9	Restart	0,RW/SC	Restart Auto-negotiation
0.9	Auto-negotiation	0,1307/30	1 = Restart auto-negotiation. Re-initiates the auto-negotiation
	Auto-negotiation		process. When auto-negotiation is disabled (bit 12 of this register
			cleared), this bit has no function and it should be cleared. This bit is
			self-clearing and it will keep returning a value of 1 until
			auto-negotiation is initiated by the DM9331A. The operation of the
			auto-negotiation process will not be affected by the management
			entity that clears this bit
			0 = Normal operation
0.8	Duplex Mode	1,RW	Duplex Mode
		- ,	1 = Full duplex operation. Duplex selection is allowed when
			Auto-negotiation is disabled (bit 12 of this register is cleared). With
			auto-negotiation enabled, this bit reflects the duplex capability
			selected by auto-negotiation
			0 = Normal operation



0.7	Collision Test	0,RW	Collision Test 1 = Collision test enabled. When set, this bit will cause the COL signal to be asserted in response to the assertion of TXEN 0 = Normal operation
0.6-0.0	Reserved	0,RO	Reserved Write as 0, ignore on read

8.2 Basic Mode Status Register (BMSR) - 01

1.15	Bit	Bit Name	Default	Description
1.14 100BASE-TX 1,RO/P 100BASE-TX Full Duplex Capable 1 = DM9331A is not able to perform 100BASE-TX in full duplex mode 0 = DM9331A is able to perform 100BASE-TX in full duplex mode 0 = DM9331A is not able to perform 100BASE-TX in full duplex mode 0 = DM9331A is able to perform 100BASE-TX in full duplex mode 1 = DM9331A is able to perform 100BASE-TX in half duplex mode 0 = DM9331A is able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in full duplex mode 0 = DM9331A is not able to perform 100BASE-TX in full duplex mode 0 = DM9331A is not able to perform 100BASE-TX in full duplex mode 0 = DM9331A is not able to perform 100BASE-TX in full duplex mode 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 0 = DM9331A is not	1.15	100BASE-T4	0,RO/P	
1.14				
Tell Duplex				
1.13	1.14		1,RO/P	
1.13 100BASE-TX 1,RO/P 100BASE-TX Half Duplex Capable 1 = DM9331A is able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 0 = DM9331A is not able to perform 100BASE-TX in half duplex mode 1.12 Reserved 0,RO/P Reserved 1.11 Reserved 0,RO/P Reserved 1.10-1.7 Reserved 0,RO/P Reserved		Full Duplex		
1.13				
Half Duplex				
1.12 Reserved 0,RO/P Reserved 1.11 Reserved 0,RO/P	1.13		1,RO/P	
1.12 Reserved 0,RO/P Reserved		Hait Duplex		
1.12 Reserved 0,RO/P Reserved				
1.11 Reserved 0,RO/P Reserved 1.10-1.7 Reserved 0,RO Reserved Write as 0, ignore on read Write as 0, ignore on read or write intended Write as 0, ignore on read or write intended Write as 0, ignore on read or write intended Write as 0, ignore on read or write intended Write as 0, ignore on read or write intended Write as 0, ignore on read or write intended Write as 0, ignore on read or write intended Write as 0, ignore on read or write present Write as 0, ignore on read or write present Write as	1 12	Doggrad	0 DO/D	
1.10-1.7 Reserved 0,RO Reserved Write as 0, ignore on read				
Write as 0, ignore on read				
1.6	1.10-1.7	Reserved	U,RO	
Suppression 1 = PHY will accept management frames with preamble suppressed 0 = PHY will not accept management frames with preamble suppressed	1.6	ME Proamble	0 PO	
1.5 Auto-negotiation Complete 1.6 Auto-negotiation Complete 1.7 Auto-negotiation Complete 1.8 Auto-negotiation Process completed 1.9 Auto-negotiation Process not completed 1.4 Remote Fault 1.5 Remote Fault 1.6 Remote Fault 1.7 Remote Fault 1.8 Remote Fault 1.9 Remote Fault 1.0 Remote Fault 1.1 Remote Fault 1.2 Remote Fault 1.3 Auto-negotiation Ability 1.4 Auto-negotiation Ability 1.5 Auto-negotiation Ability 1.6 Auto Configuration Ability 1.7 Auto Configuration Ability 1.8 Auto-negotiation Deprisor Auto Configuration Ability 1.9 Auto-negotiation Deprisor Auto-negotiation 1.1 Auto-negotiation Deprisor Auto-negotiation 1.2 Link Status 1.3 Auto-negotiation Deprisor Auto-negotiation 1.4 Auto-negotiation Ability 1.5 Auto-negotiation Deprisor Auto-negotiation 1.6 Auto-negotiation Deprisor Auto-negotiation 1.7 Auto-negotiation Deprisor Auto-negotiation 1.8 Status 1.9 Valid link is established (for 100Mbps operation) 1.9 Link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface	1.0		U,RO	
Suppressed 1.5		Suppression		
1.5 Auto-negotiation Complete 1.4 Remote Fault 1.5 Remote Fault 1.6 Remote Fault 1.7 Remote Fault 1.8 Remote Fault 1.9 Remote Fault 1.0 Remote Fault 1.10 Remote Fault 1.10 Remote Fault 1.10 Remote Fault 1.10 Remote Fault 1.11 Remote fault condition detected (cleared on read or by a chip reset). Fault criteria and detection method is DM9331A implementation specific. This bit will set after the RF bit in the ANLPAR (bit 13, register address 05) is set 1.10 0 Remote Fault 1.11 Remote Fault 1.12 Remote Fault 1.12 Remote Fault 1.13 Auto-negotiation 1.14 Auto-negotiation 1.15 Auto-negotiation 1.16 Auto Configuration Ability 1 Remote Fault 2 Remote Fault 1 Remote Fault 2 Remote Fault 3 Remote Fault 3 Remote Fault 4 Remote Fault 2 Remote Fault 3 Remote Fault 4 Remote Fault 4 Remote Fault 5 Remote Fault 6 Remot				
Complete 1 = Auto-negotiation process completed 0 = Auto-negotiation process not completed 1.4 Remote Fault 0, RO/LH 1 = Remote fault condition detected (cleared on read or by a chip reset). Fault criteria and detection method is DM9331A implementation specific. This bit will set after the RF bit in the ANLPAR (bit 13, register address 05) is set 0 = No remote fault condition detected 1.3 Auto-negotiation Ability 1 = DM9331A is able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 1.2 Link Status 1 = Valid link is established (for 100Mbps operation) 0 = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface	1.5	Auto-negotiation	0.RO	
1.4 Remote Fault O, RO/LH Remote Fault 1 = Remote fault condition detected (cleared on read or by a chip reset). Fault criteria and detection method is DM9331A implementation specific. This bit will set after the RF bit in the ANLPAR (bit 13, register address 05) is set O = No remote fault condition detected 1.3 Auto-negotiation Ability 1,RO/P Ability Ability 1 = DM9331A is able to perform auto-negotiation O = DM9331A is not able to perform auto-negotiation 1.2 Link Status 1 = Valid link is established (for 100Mbps operation) O = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface			0,	
1.4 Remote Fault Ro/LH				
RO/LH 1 = Remote fault condition detected (cleared on read or by a chip reset). Fault criteria and detection method is DM9331A implementation specific. This bit will set after the RF bit in the ANLPAR (bit 13, register address 05) is set 0 = No remote fault condition detected 1.3 Auto-negotiation Ability 1,RO/P Auto Configuration Ability 1 = DM9331A is able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 1.2 Link Status 1 = Valid link is established (for 100Mbps operation) 0 = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface	1.4	Remote Fault	0,	
reset). Fault criteria and detection method is DM9331A implementation specific. This bit will set after the RF bit in the ANLPAR (bit 13, register address 05) is set 0 = No remote fault condition detected 1.3 Auto-negotiation Ability 1,RO/P Ability 1 = DM9331A is able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 1.2 Link Status 1 = Valid link is established (for 100Mbps operation) 0 = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface				1 = Remote fault condition detected (cleared on read or by a chip
ANLPAR (bit 13, register address 05) is set 0 = No remote fault condition detected 1.3 Auto-negotiation Ability 1 = DM9331A is able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 1.2 Link Status 1 = Valid link is established (for 100Mbps operation) 0 = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface				
1.3 Auto-negotiation Ability 1 = DM9331A is able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 1.2 Link Status 1 = Valid link is established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface				implementation specific. This bit will set after the RF bit in the
1.3 Auto-negotiation Ability 1 = DM9331A is able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 1.2 Link Status 0,RO/LL Link Status 1 = Valid link is established (for 100Mbps operation) 0 = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface				
Ability 1 = DM9331A is able to perform auto-negotiation 0 = DM9331A is not able to perform auto-negotiation 1.2 Link Status 0,RO/LL Link Status 1 = Valid link is established (for 100Mbps operation) 0 = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface				
1.2 Link Status O,RO/LL Link Status 1 = Valid link is established (for 100Mbps operation) O = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface	1.3		1,RO/P	
1.2 Link Status 0,RO/LL Link Status 1 = Valid link is established (for 100Mbps operation) 0 = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface		Ability		
1 = Valid link is established (for 100Mbps operation) 0 = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface				
0 = Link is not established The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface	1.2	Link Status	0,RO/LL	
The link status bit is implemented with a latching function, so that the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface				
the occurrence of a link failure condition causes the link status bit to be cleared and remain cleared until it is read via the management interface				
be cleared and remain cleared until it is read via the management interface				
interface				
	1.1	Reserved	0,RO/LH	





100 Mbps Twisted Pair/Fiber Ethernet Media Converter Chip

1.0	Extended	1,RO/P	Extended Capability	
	Capability		1 = Extended register capable.	0 = Basic register capable only

8.3 Auto-negotiation Advertisement Register (ANAR) - 04

This register contains the advertised abilities of this DM9331A device as they will be transmitted to its link partner during Auto-negotiation.

Bit	Bit Name	Default	Description
4.15	NP	0,RO/P	Next Page Indication
			0 = No next page available
			1 = Next page available
			The DM9331A has no next page, so this bit is permanently set to 0
4.14	ACK	0,RO	Acknowledge
			1 = Link partner ability data reception acknowledged
			0 = Not acknowledged
			The DM9331A's auto-negotiation state machine will automatically
			control this bit in the outgoing FLP bursts and set it at the
			appropriate time during the auto-negotiation process. Software
			should not attempt to write to this bit
4.13	RF	0, RW	Remote Fault
			1 = Local device senses a fault condition
			0 = No fault detected
4.12-4.11	Reserved	0, RW	Reserved
			Write as 0, ignore on read
4.10	FCS	1, RW	Flow Control Support
			1 = Controller chip supports flow control ability
			0 = Controller chip doesn't support flow control ability
4.9	T4	0, RO/P	100BASE-T4 Support
			1 = 100BASE-T4 is supported by the local device
			0 = 100BASE-T4 is not supported
			The DM9331A does not support 100BASE-T4 so this bit is
			permanently set to 0
4.8	TX_FDX	1, RW	100BASE-TX Full Duplex Support
			1 = 100BASE-TX full duplex is supported by the local device
			0 = 100BASE-TX full duplex is not supported
4.7	TX_HDX	1, RW	100BASE-TX Support
			1 = 100BASE-TX is supported by the local device
			0 = 100BASE-TX is not supported
4.6	Reserved	0, RW	Reserved
4.5	Reserved	0, RW	Reserved
4.4-4.0	Selector	<00001>, RW	Protocol Selection Bits
			These bits contain the binary encoded protocol selector supported
			by this node
			<00001>indicates that this device supports IEEE 802.3 CSMA/CD

8.4 Auto-negotiation Link Partner Ability Register (ANLPAR) – 05

This register contains the advertised abilities of the link partner when received during Auto-negotiation.

Bit	Bit Name	Default	Description
5.15	NP	0, RO	Next Page Indication
			0 = Link partner, no next page available
			1 = Link partner, next page available
5.14	ACK	0, RO	Acknowledge

21



1 = Link partner ability data reception acknowledged 0 = Not acknowledged The DM9331A's auto-negotiation state machine will automatically control this bit from the incoming FLP bursts. Software should not attempt to write to this bit 5.13 RF 0, RO Remote Fault 1 = Remote fault indicated by link partner 0 = No remote fault indicated by link partner 5.12-5.11 Reserved X, RO Reserved Write as 0, ignore on read 5.10 FCS 0, RW Flow Control Support 1 = Controller chip supports flow control ability by link partner 0 = Controller chip doesn't support flow control ability by link partner 0 = Controller chip doesn't support flow control ability by link partner 1 = 100BASE-T4 is supported by the link partner 0 = 100BASE-T4 is not supported by the link partner 1 = 100BASE-T4 is not supported by the link partner 0 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 0 = 100BASE-T full duplex is supported by the link partner 0 = 100BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner				
The DM9331A's auto-negotiation state machine will automatically control this bit from the incoming FLP bursts. Software should not attempt to write to this bit 5.13 RF 0, RO Remote Fault 1 = Remote Fault indicated by link partner 0 = No remote fault indicated by link partner 5.12-5.11 Reserved X, RO Reserved Write as 0, ignore on read 5.10 FCS 0, RW Flow Control Support 1 = Controller chip supports flow control ability by link partner 0 = Controller chip doesn't support flow control ability by link partner 5.9 T4 0, RO 100BASE-T4 Support 1 = 100BASE-T4 is not supported by the link partner 0 = 100BASE-TX full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 5.7 TX_HDX 0, RO 100BASE-TX full duplex is not supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 1 = 100BASE-TX half duplex is not supported by the link partner 0 = 100BASE-T full Duplex Support 1 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 1 = 10BASE-T full duplex is supported by the link partner 1 = 10BASE-T full duplex is supported by the link partner 1 = 10BASE-T half duplex is not supported by the link partner 1 = 10BASE-T half duplex is not supported by the link partner 1 = 10BASE-T half duplex is not supported by the link partner 1 = 10BASE-T half duplex is not supported by the link partner 2 = 10BASE-T half duplex is not supported by the link partner				1 = Link partner ability data reception acknowledged
control this bit from the incoming FLP bursts. Software should not attempt to write to this bit 5.13 RF 0, RO Remote Fault 1 = Remote fault indicated by link partner 0 = No remote fault indicated by link partner 5.12-5.11 Reserved X, RO Reserved Write as 0, ignore on read 5.10 FCS 0, RW Flow Control Support 1 = Controller chip supports flow control ability by link partner 0 = Controller chip doesn't support flow control ability by link partner 1 = 100BASE-14 since supported by the link partner 0 = 100BASE-14 is supported by the link partner 0 = 100BASE-17 full Duplex Support 1 = 100BASE-17 full duplex is supported by the link partner 0 = 100BASE-17 full duplex is not supported by the link partner 0 = 100BASE-17 full duplex is not supported by the link partner 0 = 100BASE-17 half duplex is not supported by the link partner 0 = 100BASE-17 half duplex is not supported by the link partner 0 = 100BASE-17 full duplex is not supported by the link partner 0 = 100BASE-17 half duplex is not supported by the link partner 0 = 10BASE-17 full duplex is not supported by the link partner 0 = 10BASE-17 full duplex is not supported by the link partner 0 = 10BASE-17 half duplex is not supported by the link partner 0 = 10BASE-17 half duplex is not supported by the link partner 0 = 10BASE-17 half duplex is not supported by the link partner				0 = Not acknowledged
control this bit from the incoming FLP bursts. Software should not attempt to write to this bit 5.13 RF 0, RO Remote Fault 1 = Remote fault indicated by link partner 0 = No remote fault indicated by link partner 5.12-5.11 Reserved X, RO Reserved Write as 0, ignore on read 5.10 FCS 0, RW Flow Control Support 1 = Controller chip supports flow control ability by link partner 0 = Controller chip doesn't support flow control ability by link partner 1 = 100BASE-14 since supported by the link partner 0 = 100BASE-14 is supported by the link partner 0 = 100BASE-17 full Duplex Support 1 = 100BASE-17 full duplex is supported by the link partner 0 = 100BASE-17 full duplex is not supported by the link partner 0 = 100BASE-17 full duplex is not supported by the link partner 0 = 100BASE-17 half duplex is not supported by the link partner 0 = 100BASE-17 half duplex is not supported by the link partner 0 = 100BASE-17 full duplex is not supported by the link partner 0 = 100BASE-17 half duplex is not supported by the link partner 0 = 10BASE-17 full duplex is not supported by the link partner 0 = 10BASE-17 full duplex is not supported by the link partner 0 = 10BASE-17 half duplex is not supported by the link partner 0 = 10BASE-17 half duplex is not supported by the link partner 0 = 10BASE-17 half duplex is not supported by the link partner				The DM9331A's auto-negotiation state machine will automatically
attempt to write to this bit				
S.13				
1 = Remote fault indicated by link partner 0 = No remote fault indicated by link partner 5.12-5.11 Reserved X, RO Reserved Write as 0, ignore on read 5.10 FCS 0, RW Flow Control Support 1 = Controller chip supports flow control ability by link partner 0 = Controller chip doesn't support flow control ability by link partner 1 = 100BASE-T4 support 1 = 100BASE-T4 is supported by the link partner 0 = 100BASE-T4 is not supported by the link partner 1 = 100BASE-TX full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 1 = 100BASE-TX full duplex is not supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 1 = 100BASE-TX half duplex is not supported by the link partner 1 = 100BASE-T half duplex is not supported by the link partner 1 = 100BASE-T full duplex is not supported by the link partner 1 = 100BASE-T full duplex is not supported by the link partner 1 = 100BASE-T full duplex is not supported by the link partner 1 = 100BASE-T full duplex is not supported by the link partner 1 = 100BASE-T full duplex is not supported by the link partner 1 = 100BASE-T half duplex is not supported by the link partner 1 = 100BASE-T half duplex is not supported by the link partner	5 13	RF	0 RO	·
0 = No remote fault indicated by link partner	0.10		0,110	1 10111010 1 010111
5.12-5.11 Reserved X, RO Reserved Write as 0, ignore on read 5.10 FCS 0, RW Flow Control Support 1 = Controller chip supports flow control ability by link partner 0 = Controller chip doesn't support flow control ability by link partner 1 = 100BASE-T4 Support 1 = 100BASE-T4 is supported by the link partner 0 = 100BASE-T4 is not supported by the link partner 0 = 100BASE-TX full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 0 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 0 = 100BASE-T full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 0 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 1 = 10BASE-T half duplex is not supported by the link partner 1 = 10BASE-T half duplex is not supported by the link partner 1 = 10BASE-T half duplex is not supported by the link pa				
Write as 0, ignore on read	5 12-5 11	Reserved	X RO	
5.10 FCS 0, RW Flow Control Support 1 = Controller chip supports flow control ability by link partner 0 = Controller chip doesn't support flow control ability by link partner 5.9 T4 0, RO 100BASE-T4 Support 1 = 100BASE-T4 is supported by the link partner 0 = 100BASE-T4 is not supported by the link partner 5.8 TX_FDX 0, RO 100BASE-TX full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 5.7 TX_HDX 0, RO 100BASE-TX Support 1 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 5.6 10_FDX 0, RO 10BASE-T full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 1 = 10BASE-T full duplex is not supported by the link partner 1 = 10BASE-T half duplex is supported by the link partner 1 = 10BASE-T half duplex is supported by the link partner 1 = 10BASE-T half duplex is not supported by the link partner 1 = 10BASE-T half duplex is not supported by the link partner 1 = 10BASE-T half duplex is not supported by the link partner	J. 12-J. 11	reserved	λ, πο	1 10001100
1 = Controller chip supports flow control ability by link partner 0 = Controller chip doesn't support flow control ability by link partner 5.9 T4 0, RO 100BASE-T4 Support 1 = 100BASE-T4 is supported by the link partner 0 = 100BASE-T4 is not supported by the link partner 5.8 TX_FDX 0, RO 100BASE-TX Full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 5.7 TX_HDX 0, RO 100BASE-TX full duplex is not supported by the link partner 0 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 0 = 100BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 1 = 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner	5.10	ECS	0 DW	
0 = Controller chip doesn't support flow control ability by link partner 5.9 T4 0, RO 100BASE-T4 Support 1 = 100BASE-T4 is supported by the link partner 0 = 100BASE-T4 is not supported by the link partner 5.8 TX_FDX 0, RO 100BASE-TX Full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 5.7 TX_HDX 0, RO 100BASE-TX Support 1 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 5.6 10_FDX 0, RO 10BASE-T full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner	3.10	103	0, 1777	
5.9 T4 0, RO 100BASE-T4 Support 1 = 100BASE-T4 is supported by the link partner 0 = 100BASE-T4 is not supported by the link partner 5.8 TX_FDX 0, RO 100BASE-TX Full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 5.7 TX_HDX 0, RO 100BASE-TX Support 1 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 5.6 10_FDX 0, RO 10BASE-T full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner				
5.9 T4 0, RO 100BASE-T4 support 1 = 100BASE-T4 is supported by the link partner 0 = 100BASE-T4 is not supported by the link partner 5.8 TX_FDX 0, RO 100BASE-TX full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 1 = 100BASE-TX full duplex is not supported by the link partner 1 = 100BASE-TX Support 1 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 1 = 10BASE-T full duplex is supported by the link partner 1 = 10BASE-T full duplex is not supported by the link partner 1 = 10BASE-T Support 1 = 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner				
1 = 100BASE-T4 is supported by the link partner 0 = 100BASE-T4 is not supported by the link partner 5.8 TX_FDX	5 0	T 4	0.00	l ·
5.8 TX_FDX 0, RO 100BASE-TX Full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 5.7 TX_HDX 0, RO 100BASE-TX Support 1 = 100BASE-TX Support 1 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 5.6 10_FDX 0, RO 10BASE-T Full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner	5.9	14	U, RO	
5.8 TX_FDX 0, RO 100BASE-TX Full Duplex Support 1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 5.7 TX_HDX 0, RO 100BASE-TX Support 1 = 100BASE-TX Support 1 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 5.6 10_FDX 0, RO 10BASE-T full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner				
1 = 100BASE-TX full duplex is supported by the link partner 0 = 100BASE-TX full duplex is not supported by the link partner 5.7 TX_HDX	—			
5.7 TX_HDX 0, RO 100BASE-TX Support 1 = 100BASE-TX Support 1 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 5.6 10_FDX 0, RO 10BASE-T Full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner	5.8	TX_FDX	0, RO	
5.7 TX_HDX 0, RO 100BASE-TX Support 1 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 5.6 10_FDX 0, RO 10BASE-T Full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner				
1 = 100BASE-TX half duplex is supported by the link partner 0 = 100BASE-TX half duplex is not supported by the link partner 5.6 10_FDX 0, RO 10BASE-T Full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner				
5.6 10_FDX 0, RO 10BASE-T Full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner	5.7	TX_HDX	0, RO	
5.6 10_FDX 0, RO 10BASE-T Full Duplex Support 1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner				1 = 100BASE-TX half duplex is supported by the link partner
1 = 10BASE-T full duplex is supported by the link partner 0 = 10BASE-T full duplex is not supported by the link partner 5.5				
0 = 10BASE-T full duplex is not supported by the link partner 5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner	5.6	10_FDX	0, RO	
5.5 10_HDX 0, RO 10BASE-T Support 1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner				
1 = 10BASE-T half duplex is supported by the link partner 0 = 10BASE-T half duplex is not supported by the link partner				
0 = 10BASE-T half duplex is not supported by the link partner	5.5	10_HDX	0, RO	
5.4-5.0 Selector <00000>, RO Protocol Selection Bits				0 = 10BASE-T half duplex is not supported by the link partner
	5.4-5.0	Selector	<00000>, RO	Protocol Selection Bits
Link partner's binary encoded protocol selector				Link partner's binary encoded protocol selector

8.5 Auto-negotiation Expansion Register (ANER)- 06

0.45.0.5	D	V D0	In
6.15-6.5	Reserved	X, RO	Reserved
			Write as 0, ignore on read
6.4	PDF	0, RO/LH	Local Device Parallel Detection Fault
			PDF = 1 : A fault detected via parallel detection function
			PDF = 0 : No fault detected via parallel detection function
6.3	LP_NP_ABLE	0, RO	Link Partner Next Page Able
			LP_NP_ABLE = 1 : Link partner, next page available
			LP_NP_ABLE = 0 : Link partner, no next page
6.2	NP_ABLE	0,RO/P	Local Device Next Page Able
	_		NP_ABLE = 1 : DM9331A, next page available
			NP_ABLE = 0 : DM9331A, no next page
			DM9331A does not support this function, so this bit is always 0
6.1	PAGE_RX	0, RO/LH	New Page Received
			A new link code word page received. This bit will be automatically
			cleared when the register (register 6) is read by management
6.0	LP_AN_ABLE	0, RO	Link Partner Auto-negotiation Able





100 Mbps Twisted Pair/Fiber Ethernet Media Converter Chip

	A "1" in this bit indicates that the link partner supports
	Auto-negotiation

8.6 DAVICOM Specified Configuration Register (DSCR) - 16

Bit	Bit Name	Default	Description
16.15	BP_4B5B	0, RW	Bypass 4B5B Encoding and 5B4B Decoding
			1 = 4B5B encoder and 5B4B decoder function bypassed
			0 = Normal 4B5B and 5B4B operation
16.14	BP_SCR	0, RW	Bypass Scrambler/Descrambler Function
			1 = Scrambler and descrambler function bypassed
12.12			0 = Normal scrambler and descrambler operation
16.13	BP_ALIGN	0, RW	Bypass Symbol Alignment Function
			1 = Receive functions (descrambler, symbol alignment and
			symbol decoding functions) bypassed. Transmit functions (symbol encoder and scrambler) bypassed
			0 = Normal operation
16.12	BP ADPOK	0, RW	Bypass ADPOK
10.12	DI _ADI OR	0, 100	Force signal detector (SD) active. This register is for debug only,
			not release to customer
			1 = Force SD is OK
			0 = Normal operation
16.11	Reserved	0,RW	Reserved
16.10	TX	1, RW	100BASE-TX or FX Mode Control
			1 = 100BASE-TX operation
			0 = 100BASE-FX operation
16.9	FEF	0, RW	Far End Fault Enable
			Control the Far End Fault mechanism associated with
			100Base-FX operation 1 = Enable
			0 = Disable
16.8	Reserved	1, RW	Reserved
10.0	110001100	1,100	Write as 1
16.7	F LINK 100	0, RW	Force Good Link in 100Mbps
		•	0 = Normal 100Mbps operation
			1 = Force 100Mbps good link status
			This bit is useful for diagnostic purposes
16.6	Reserved	0, RW	Reserved
			Write as 0
16.5	Reserved	0, RO	Reserved
			Write as 0, ignore on read
16.4	RPDCTR-EN	1, RW	Reduced Power Down Control Enable
			This bit is used to enable automatic reduced power down
			0: Disable automatic reduced power down
46.5	0145.55		1: Enable automatic reduced power down
16.3	SMRST	0, RW	Reset State Machine
			When writes 1 to this bit, all state machines of PHY will be reset.
40.0	MEDOO	0. DW	This bit is self-clear after reset is completed.
16.2	MFPSC	0, RW	MF Preamble Suppression Control
			MCI frame preamble suppression control bit 1 = MF preamble suppression bit on
			i – ivii preamble suppression bit on

23



			0 = MF preamble suppression bit off
16.1	SLEEP	0, RW	Sleep Mode Writing a 1 to this bit will cause PHY entering the Sleep mode and power down all circuit except oscillator and clock generator circuit. When waking up from Sleep mode (write this bit to 0), the configuration will go back to the state before sleep; but the state machine will be reset
16.0	RLOUT	0, RW	Remote Loopout Control When this bit is set to 1, the received data will loop out to the transmit channel. This is useful for bit error rate testing

8.7 DAVICOM Specified Configuration and Status Register (DSCSR) - 17

Bit	Bit Name	Default	Description
17.15	100FDX	1, RO	100M Full Duplex Operation Mode After auto-negotiation is completed, results will be written to this bit. If this bit is 1, it means the operation 1 mode is a 100M full duplex mode. The software can read bit [15:12] to see which mode is selected after auto-negotiation. This bit is invalid when it is not in the auto-negotiation mode
17.14	100HDX	1, RO	100M Half Duplex Operation Mode After auto-negotiation is completed, results will be written to this bit. If this bit is 1, it means the operation 1 mode is a 100M half-duplex mode. The software can read bit[15:12] to see which mode is selected after auto-negotiation. This bit is invalid when it is not in the auto-negotiation mode
17.13	Reserved	0, RO	Reserved
17.12	Reserved	0, RO	Reserved
17.11-17.	Reserved	0, RO	Reserved
9			Read as 0, ignore on write
17.8-17.4	Reserved	0, RW	Reserved

17.3-17.0	ANMB [3:0]	0, RO	Auto-negotiation Monitor Bits These bits are for debug only. The auto-negotiation status will be written to these bits							
			В3	B2	b1	b0				
			0	0	0	0	In IDLE state			
			0	0	0	1	Ability match			
			0	0	1	0	Acknowledge match			
			0	0	1	1	Acknowledge match fail			
			0	1	0	0	Consistency match			
			0	1	0	1	Consistency match fail			
			0	1	1	0	Parallel detects signal_link_ready			
			0 1 1 1 Parallel detects signal_link_ready fail							
			1	0	0	0	Auto-negotiation completed successfully			

24 Preliminary







8.8 DAVICOM Specified Interrupt Register - 21

Bit	Bit Name	Default	Description
21.15	INTR PEND	0, RO	Interrupt Pending Indicates that the interrupt is pending and is cleared by the current read. This bit shows the same result as bit 0. (INTR Status)
21.14-21. 12	Reserved	0, RO	Reserved
21.11	FDX Mask	1, RW	Full-duplex Interrupt Mask When this bit is set, the Duplex status change will not generate the interrupt
21.10	Reserved	1, RW	Reserved
21.9	LINK Mask	1, RW	Link Interrupt Mask When this bit is set, the link status change will not generate the interrupt
21.8	INTR Mask	1, RW	Master Interrupt Mask When this bit is set, no interrupts will be generated under any condition
21.7-21.5	Reserved	0, RO	Reserved
21.4	FDX Change	0,RO/LH	Duplex Status Change Interrupt "1" indicates a change of duplex since last register read. A read of this register will clear this bit
21.3	Reserved	0, RO/LH	Reserved
21.2	LINK Change	0, RO/LH	Link Status Change Interrupt "1" indicates a change of link since last register read. A read of this register will clear this bit
21.1	Reserved	0, RO	Reserved
21.0	INTR Status	0, RO/LH	Interrupt Status The status of MDINTR#. "1" indicates that the interrupt mask is off that one or more of the change bits are set. A read of this register will clear this bit



9. DC and AC Electrical Characteristics

9.1 Absolute Maximum Ratings (25°C)

Symbol	Parameter		Max.	Unit	Conditions
Dvcc, Avcc	Supply Voltage	-0.3	3.6	V	
VIN	DC Input Voltage (VIN)	-0.5	5.5	V	
Vout	DC Output Voltage (Vo∪T)	-0.3	3.6	٧	
Tstg	Storage Temperature Rang (Tstg)	-65	+150	°C	
LT	Lead Temp. (TL, Soldering, 10 sec.)		260	°C	Pb-Free

9.2 Operating Conditions

Symbol	Parameter	Min.	Тур.	Max.	Unit	Conditions
Dvcc, Avcc	Supply Voltage	3.135		3.465	V	
TA	Operating Ambient Temperature	0		70	°C	
PD	100BASE-TX	1	88		mA	3.3V
(Power Dissipation)	100BASE-FX	1	25		MΑ	3.3V
	Auto-negotiation	I	45		MΑ	3.3V
	Power Reduced Mode (without cable)		18		MΑ	3.3V
	Power Down Mode	-	3		MΑ	3.3V

Comments

Stresses above those listed under "Absolute Maximum Ratings" may cause permanent damage to the device. These are stress ratings only. Functional operation of this device at these or any other conditions above those indicated in the

operational sections of this specification is not Exposure to absolute maximum rating implied. conditions for extended periods may affect device reliability.

26 Preliminary







9.3 DC Electrical Characteristics (VCC = 3.3V, TA = $0 \sim 70$ °C)

Symbol	Parameter	Min.	Тур.	Max.	Unit	Conditions
TTL Input	S					
	D1, TXEN, LNKFAULTPROG, LNKFAUL	TEN, MDC,	MDIO,CI	HIPEN, OPM	IODE0-	2, TPSET0, TPSET1,
DISFEF,S	CRAMEN, RESET#)					
VIL	Input Low Voltage		_	0.8	V	
VIH	Input High Voltage	2.0	-		>	
⊒	Input Low Leakage Current	-	-	10	uA	VIN = 0.4V
lιΗ	Input High Leakage Current	-10	-		uA	VIN = 2.7V
MCI TTL C						
(RXD0, R	XD1, RXDV, RXER, TPFAULT, FXFAULT	MDIO)				
Vol	Output Low Voltage			0.4	V	IOL = 4mA
Voh	Output High Voltage	2.4	-		V	IOH = -4mA
	ITL Outputs					
(LINKLED:	#, ACTIVELED#, FULL/HALFLED#, FAUL	TLED#, MD	INTR#)			
Vol	Output Low Voltage		-	0.4	V	IOL = 2mA
Voh	Output High Voltage	2.4			V	IOH = -2mA
Receiver						
VICM	RX+/RX- Common mode Input Voltage	-	1.2	_	٧	100 Ω Termination Across
Transmitt	er			•		
VTD100	100TX+/- Differential Output Voltage	1.9	2.0	2.1	V	Peak to Peak
ITD100	100TX+/- Differential Output Current	19	20	21	MΑ	
Voh	PECL Output Voltage – High	Vcc-1.05		Vcc-0.88	V	
Vol	PECL Output Voltage – Low	Vcc-1.81		Vcc-1.62	V	
VIH	PECL Input Voltage – High	Vcc-1.16		Vcc-0.88	V	
VIL	PECL Input Voltage – Low	Vcc-1.81		Vcc-1.48	V	
IFD100	100FX+/- Differential Output Current	17	18	19	mA	



9.4 AC Electrical Characteristics & Timing Waveforms

9.4.1 TP Interface

Symbol	Parameter	Min.	Тур.	Max.	Unit	Conditions
ttr/F	100TX+/- Differential Rise/Fall Time	3.0		5.0	ns	
tтм	100TX+/- Differential Rise/Fall Time Mismatch	0		0.5	ns	
ttdc	100TX+/- Differential Output Duty Cycle	0		0.5	ns	
	Distortion					
t T/T	100TX+/- Differential Output Peak-to-Peak Jitter	0		1.4	ns	
Xost	100TX+/- Differential Voltage Overshoot	0		5	%	

9.4.2 Oscillator Timing

Symbol	Parameter	Min.	Тур.	Max.	Unit	Conditions
tckc	OSC Cycle Time	19.998	20	20.002	ns	50ppm
t PWH	OSC Pulse Width High	8	10	12	ns	
tPWL	OSC Pulse Width Low	8	10	12	ns	

9.4.3 MDC/MDIO Timing

Symbol	Parameter	Min.	Тур.	Max.	Unit	Conditions
To	MDC Cycle Time	80			ns	
T1	MDIO Setup Before MDC	10			ns	When OUTPUT By STA
T2	MDIO Hold After MDC	10			ns	When OUTPUT By STA
Тз	MDC To MDIO Output Delay	0		300	ns	When OUTPUT By DM9331A

9.4.4 MDIO Timing When OUTPUT by STA

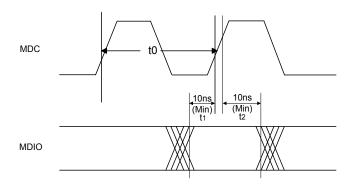


Figure 9-1



9.4.5 MDIO Timing When OUTPUT by DM9331A

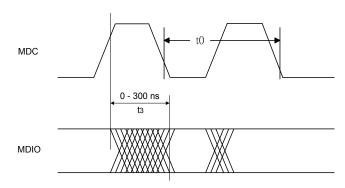


Figure 9-2

9.4.6 Auto-negotiation and Fast Link Pulse Timing Parameters

Symbol	Parameter	Min.	Тур.	Max.	Unit	Conditions
T1	Clock/Data Pulse Width		100	-	ns	
T2	Clock Pulse To Data Pulse Period	55.5	62.5	69.5	us	DATA = 1
Т3	Clock Pulse To Clock Pulse Period	111	125	139	us	
T4	FLP Burst Width	-	2	ı	ms	
T5	FLP Burst To FLP Burst Period	8		24	ms	
-	Clock/Data Pulses in a Burst	17		33	pulse	

9.4.7 Auto-negotiation and Fast Link Pulse Timing Diagram

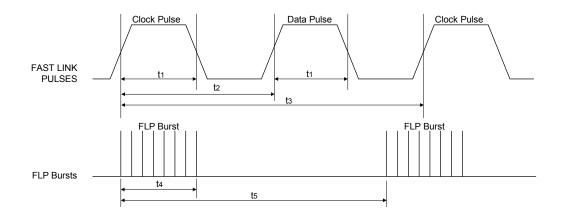


Figure 9-3

9.4.8 TXD to TP or FX Transmit Latency Timing Diagram






Figure 9-4

9.4.9 TXD to TP or FX Transmit Latency Parameters

Symbol	Parameter	Min.	Тур.	Max.	Unit	Conditions
td	TXD[1:0] to TX± or FXTD± (TX Latency)	-	1	165	ns	

9.4.10 TP or FX to RXD Receive Latency Timing Diagram




Figure 9-5

9.4.11 TP or FX to RXD Receive Latency Parameters

Symbol	Parameter	Min.	Тур.	Max.	Unit	Conditions
Td	RX± or FXRD± to RXD[1:0] (RX Latency)	-	-	205	ns	



10. Application Notes

10.1 Network Interface Signal Routing

Place the transformer as close as possible to the RJ-45 connector. Place all the 50 Ω resistors as close as possible to the DM9331A RX \pm and TX \pm pins. Traces routed from RX \pm and TX \pm to the transformer should run in close pairs directly to the transformer. The designer should be careful not to place the transmit pair across the receive pair. As always, vias should be avoided as much as possible. The network interface should be void of any signals other than the TX \pm and RX \pm pairs between the RJ-45 to the transformer and the transformer to the

DM9331A. There should be no power or ground planes in the area under the network side of the transformer to include the area under the RJ-45 connector. (Refer to Figure 5 and 6.) Keep chassis ground away from all active signals. The RJ-45 connector and any unused pin should be tied to chassis ground through a resistor divider network and a 2KV bypass capacitor.

The Band Gap resistor should be placed as physically close to pins 47 and 48 as possible. (Refer to Figure 1, 2, 3-1, and 3-2). The designer should not run any high-speed signal near the Band Gap resistor placement.

10.2 100Base-TX Side Application

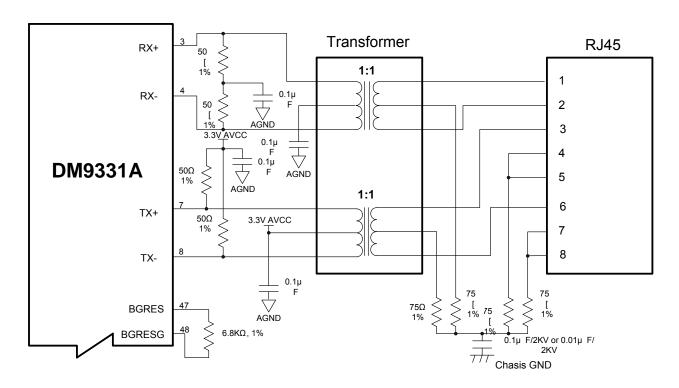


Figure 10-1



32

10.3 100Base-TX Side (Power Reduction Application)



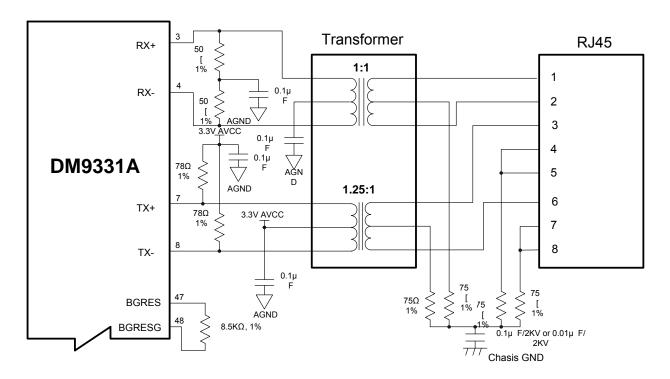


Figure 10-2



10.4 100Base-FX Side Application

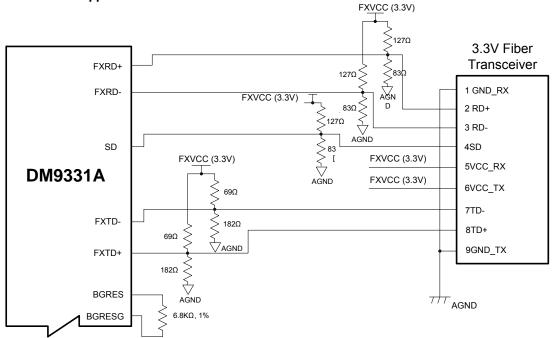

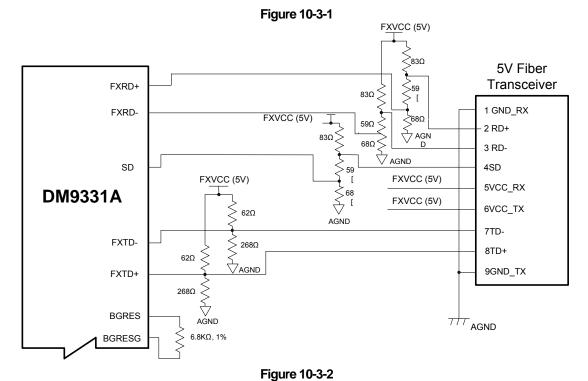



10.5 Power Decoupling Capacitors

Davicom Semiconductor recommends all the decoupling capacitors for all power supply pins are placed as close as possible to the power pads of the DM9331A (The best placed distance is < 3mm from the above mentioned pins). The recommended decoupling capacitance is 0.1µF or 0.01µF, as required by the design layout.

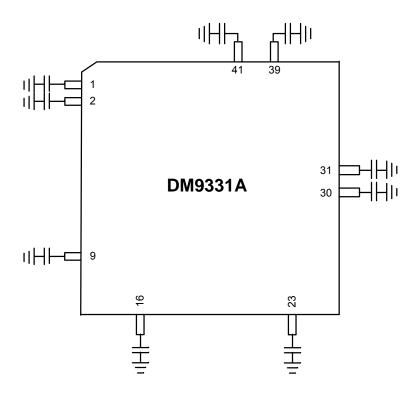


Figure 10-4

34 Preliminary



10.6 Ground Plane Layout

A single ground plane approach is recommended to minimize EMI. Bad ground plane partitioning can cause more EMI emissions that could make the network interface card not compliant with specific FCC regulations (part 15). Figure 5 shows a recommended ground layout scheme.

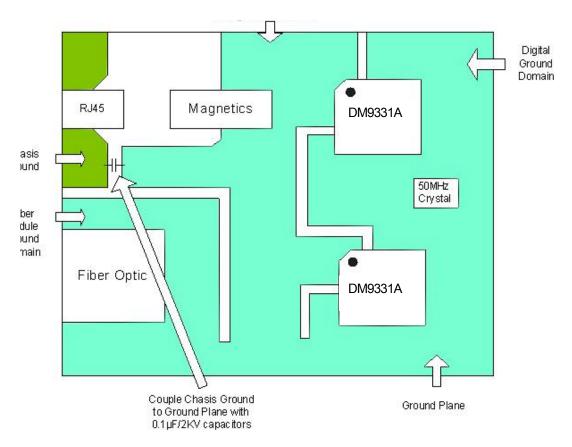


Figure 10-5



10.7 Power Plane Partitioning

36

The power planes are approximately illustrated in Figure 6. The ferrite bead used should have an impedance at least 75 Ω at 100MHz. A suitable bead is the Panasonic surface mound bead, part number EXCCL4532U or an

equivalent. A 10µF electrolytic bypass capacitors should be connected between VCC and Ground at each side of the ferrite bead.

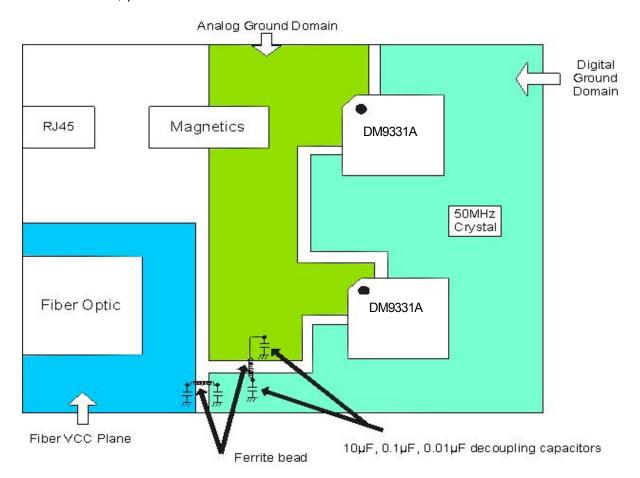


Figure 10-6

Preliminary



10.8 Media Converter Interface

Through the Media Converter Interface (MCI), the DM9331A connects to another DM9331A for the FX to TP media converter or FX to FX, TP to TP repeater application.

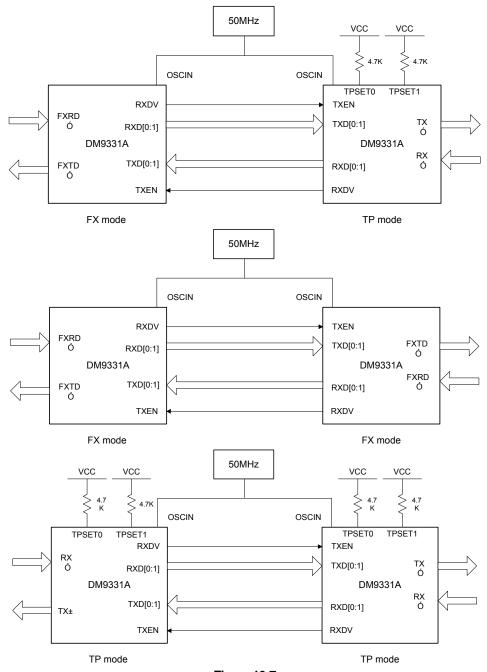


Figure 10-7




10.9 Link Fault propagation Application

The DM9331A will propagate link fault signals from media to another DM9331A. If link fault happens, the DM9331A will send out fault signal to another DM9331A.

In FX mode, there are two types of link failures, receive link failure or remote fault (receive far end fault). In the event of a fiber receive link failure, the DM9331A will send out an FX fault signal. The

DM9331A will send out a far end fault signal to the fiber optic media, if the DM9331A receive the fault signal from the other device.

In TP mode, in the event of a TP receive link failure, the DM9331A will send out a TP fault signal. The DM9331A will stop to transmit idle signal to the CAT5 media, if the DM9331A receive the fault signal from the other device.

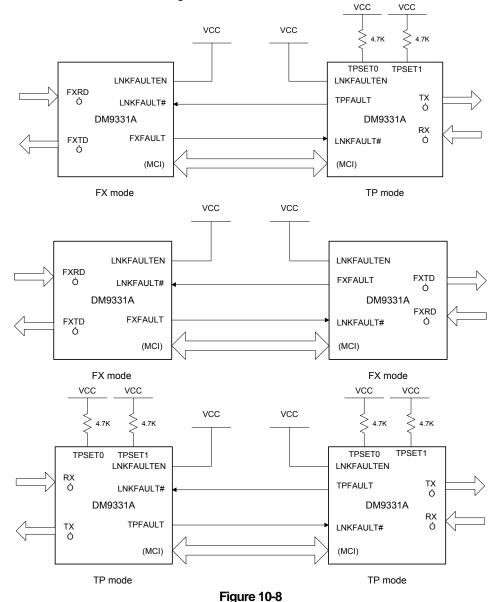

10.10 Auto-loopback Diagostic

Preliminary Version: DM9331A-DS-P02 October 20, 2008

38



The DM9331A can be easily Diagnostic FX route with remote DM9331A. This function can implement at single and Cascade mode.

Single:

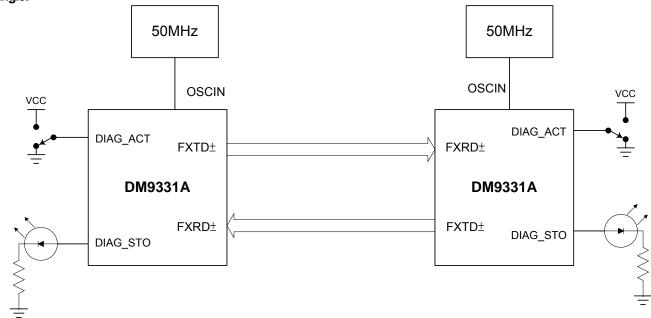


Figure 10-9

Cascade:

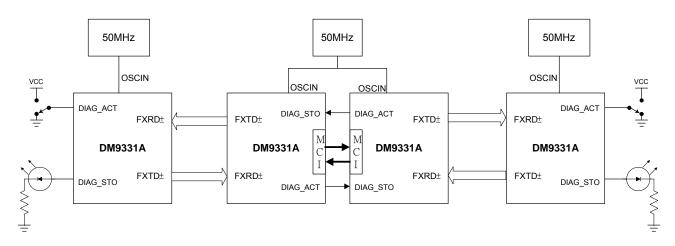


Figure 10-10


10.11 Media Converter or Repeater Application







The DM9331A chip set can easily use media converters or repeaters for long distance device connection. You can use two media converters to connect two devices whose distance is 2.2km. See Figure 9-1. If the distance is more than 2.2km, you can add an FX repeater to extend distance. See Figure 9-2. In the last miles, if the distance of the user device is more than 100m, you can add TP repeaters to extend the distance to 400m. See figure 9-3.






Figure 10-12




Figure 10-13

40 Preliminary Version: DM9331A-DS-P02

October 20, 2008



10.12 Link Fault Propagation LED Display

Since the media converter is a "dummy" device, the link fault propagation becomes very important. The devices at both ends need to know whether the link is OK or Non-OK on the whole path.

Figure 10 shows the DM9331A to the DM9331A connection. The whole path is separated into local device

(LD), local converter (LC), remote converter (RC) and remote device (RD), and three segments of transmit and receive connection. Table 10 lists the LED status of all devices. It shows the current link status of all the devices when they are at auto-negotiation modes.




Figure 10-14

Condition	Local device	Local Converter				Remote Converter				Remote device
(Auto-	Link	TP side		FX side		FX side		TP side		Link
negotiation)	LED	Link LED	Fault LED	Link LED	Fault LED	Link LED	Fault LED	Link LED	Fault LED	LED
LT disconnect	off	off	on	on	off	on	on	off	off	off
LR disconnect	off	off	off	on	off	on	off	on	off	on
LT & LR	off	off	on	on	off	on	on	off	off	off
disconnect										
FT disconnect	off	off	off	on	on	off	on	off	off	off
FR disconnect	off	off	off	off	on	on	on	off	off	off
FT & FR	off	off	off	off	on	off	on	off	off	off
disconnect										
RT disconnect	on	on	off	on	off	on	off	off	off	off
RR disconnect	off	off	off	on	on	on	off	off	on	off
RT & RR	off	off	off	on	on	on	off	off	on	off
disconnect										

Table 10



10.13 Magnetics Selection Guide

Refer to Table 2 for transformer requirements. Transformers meeting these requirements are available from a variety of magnetic manufacturers. Designers should test and qualify all magnetics before using them in an application. The transformers listed in Table 2 are electrical equivalents, but may not be pin-to-pin equivalents.

Manufacturer	Part Number
Pulse Engineering	PE-68515, H1078, H1012
	H1102
Delta	LF8200, LF8221x
YCL	20PMT04, 20PMT05
Halo	TG22-3506ND, TD22-3506G1, TG22-S010ND
	TG22-S012ND
Nano Pulse Inc.	NPI 6181-37, NPI 6120-30, NPI 6120-37
	NPI 6170-30
Fil-Mag	PT41715
Bel Fuse	S558-5999-01
Valor	ST6114, ST6118
Macronics	HS2123, HS2213

Table 2

42 Preliminary Version: DM9331A-DS-P02


October 20, 2008





11. Package Information


LQFP 48L (F.P. 2mm) Outline Dimensions



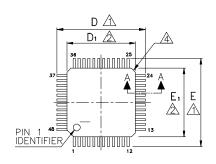

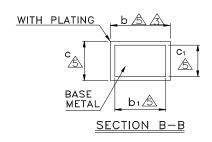



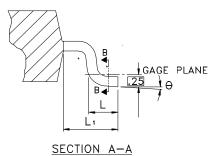

Symbol	Dimensions in inches			Dimensions in mm			
	Min.	Nom.	Max.	Min.	Nom.	Max.	
Α	ı	-	0.063	-	-	1.6	
A1	0.002	-	0.006	0.05	-	0.15	
A 2	0.053	0.055	0.057	1.35	1.40	1.45	
b	0.007	0.009	0.011	0.17	0.22	0.27	
b1	0.007	0.008	0.009	0.17	0.20	0.23	
С	0.004	-	0.008	0.09	-	0.20	
C1	0.004	-	0.006	0.09	-	0.16	
D	0.354BSC			9.00BSC			
D1	0.276BSC			7.00BSC			
Е	0.354BSC			9.00BSC			
E1	0.276BSC			7.00BSC			
е	0.020BSC			0.50BSC			
L	0.018	0.024	0.030	0.45	0.60	0.75	
L1	0.039REF			1.00REF			
у	0.004MAX			0.1MAX			
θ	0°	-	12°	0°	-	12°	

Notes:

- 1. To be determined at seating plane.
- Dimensions D1 and E 1do not include mold protrusion.D1 and E1 are maximum plastic body size dimensions including mold mismatch.
- Dimensions b do not include dambar protrusion. Total in excess of the b dimension at maximum material condition. Dambar cannot be located on the lower radius of the foot.
- 4. Exact shape of each corner is optional.
- 5. These dimensions apply to the flat section of the lead between 0.10mm and 0.25mm from the lead tip.
- 6. A1 is defined as the distance from the seating plane to the lowest point of the package body.
- 7. Controlling dimension: millimeter.
- 8. Reference documents: JEDEC MS-026, BBC.



12. Ordering Information

Part Number	Pin Count	Package
DM9331AE	48	LQFP
DM9331AEP	48	LQFP
		Pb-Free

Disclaimer

The information appearing in this publication is believed to be accurate. Integrated circuits sold by DAVICOM Semiconductor are covered by the warranty and patent indemnification provisions stipulated in the terms of sale only. DAVICOM makes no warranty, express, statutory, implied or by description regarding the information in this publication or regarding the freedom of the described chip(s) from patent infringement. FURTHER, DAVICOM MAKES NO WARRANTY OF MERCHANTABILITY OR FITNESS FOR ANY PURPOSE. DAVICOM deserves the right to halt production or alter the specifications and prices at any time without notice. Accordingly, the reader is cautioned to verify that the data sheets and other information in this publication are current before placing orders. Products described herein are intended for use in normal commercial applications. Applications involving unusual environmental or reliability requirements, e.g. military equipment or medical life support equipment, are specifically not recommended without additional processing by DAVICOM for such applications. Please note that application circuits illustrated in this document are for reference purposes only.

DAVICOM's terms and conditions printed on the order acknowledgment govern all sales by DAVICOM. DAVICOM will not be bound by any terms inconsistent with these unless DAVICOM agrees otherwise in writing. Acceptance of the buyer's orders shall be based on these terms.

Company Overview

DAVICOM Semiconductor, Inc. develops and manufactures integrated circuits for integration into data communication products. Our mission is to design and produce IC products that are the industry's best value for Data, Audio, Video, and Internet/Intranet applications. To achieve this goal, we have built an organization that is able to develop chipsets in response to the evolving technology requirements of our customers while still delivering products that meet their cost requirements.

Products

We offer only products that satisfy high performance requirements and which are compatible with major hardware and software standards. Our currently available and soon to be released products are based on our proprietary designs and deliver high quality, high chipsets that performance comply with modem communication standards and Ethernet networking standards.

Contact Windows

For additional information about DAVICOM products, contact the sales department at:

Headquarters

Hsin-chu Office:

No.6 Li-Hsin Rd. VI.

Science-based Industrial Park, Hsin-chu City, Taiwan, R.O.C.

TEL: +886-3-5798797 FAX: +886-3-5646929

MAIL: sales@davicom.com.tw HTTP: http://www.davicom.com.tw

WARNING

44

Conditions beyond those listed for the absolute maximum may destroy or damage the products. In addition, conditions for sustained periods at near the limits of the operating ranges will stress and may temporarily (and permanently) affect and damage structure, performance and/or function.