

ICX239AKC

Diagonal 3mm (Type 1/6) CCD Image Sensor for PAL Color Video Cameras

Description

The ICX239AKC is an interline CCD solid-state image sensor suitable for PAL small color video cameras. High resolution is achieved hrough the use of Ye, Cy, Mg, and G complementary color mosaic filters.

This chip features a field period readout system and an electronic shutter with variable charge-storage time.

The package is the smallest 12-pin SON (LCC).

Features

- High sensitivity and low smear
- Horizontal register: 3.3 to 5.0V drive
- Reset gate: 3.3 to 5.0V drive
- No voltage adjustment (Reset gate and substrate bias are not adjusted.)
- Low dark current and excellent antiblooming characteristics
- · Continuous variable-speed shutter
- Recommended range of exit pupil distance: −10mm to -∞
- Ye, Cy, Mg, and G complementary color mosaic filters on chip
- 12-pin MID SON (LCC) package

Device Structure

• Interline CCD image sensor




- Number of effective pixels: 752 (H) × 582 (V) approx. 440K pixels
- Total number of pixels: 795 (H) × 596 (V) approx. 470K pixels


Horizontal 22

Silicon

Vertical (V) direction:

- Chip size: 3.30mm (H) × 2.95mm (V)
- Unit cell size: 3.275µm (H) × 3.150µm (V)
- Optical black:
- Number of dummy bits:
- Vertical 1 (even fields only)
- Substrate material:

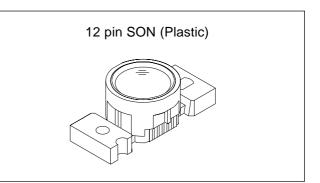

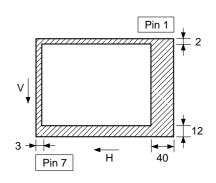

Optical black position (Top View)


Sony reserves the right to change products and specifications without prior notice. This information does not convey any license by any implication or otherwise under any patents or other right. Application circuits shown, if any, are typical examples illustrating the operation of the devices. Sony cannot assume responsibility for any problems arising out of the use of these circuits.

Horizontal (H) direction: Front 3 pixels, rear 40 pixels

Front 12 pixels, rear 2 pixels

Block Diagram and Pin Configuration

(Top View)

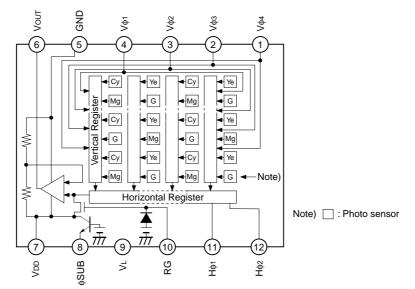

Pin Description

Pin No.	Symbol	Description	Pin No.	Symbol	Description
1	Vφ4	Vertical register transfer clock	7	Vdd	Supply voltage
2	Vφз	Vertical register transfer clock	8	φSUB	Substrate clock
3	Vø2	Vertical register transfer clock	9	VL	Protective transistor bias
4	Vφ1	Vertical register transfer clock	10	RG	Reset gate clock
5	GND	GND	11	Hφ1	Horizontal register transfer clock
6	Vout	Signal output	12	Hø2	Horizontal register transfer clock

Absolute Maximum Ratings

	Item	Ratings	Unit	Remarks
	Vdd, Vout, RG – ¢SUB	-40 to +8	V	
	$V\phi_1, V\phi_3 - \phi SUB$	-50 to +15	V	
Against	$V\phi_2, V\phi_4, VL - \phi SUB$	-50 to +0.3	V	
	Hφ1, Hφ2, GND – φSUB	-40 to +0.3	V	
	Vdd, Vout, RG – GND	-0.3 to +20	V	
Against GND	Vφ1, Vφ2, Vφ3, Vφ4 – GND	-10 to +18	V	
	Ηφ1, Ηφ2 – GND	-10 to +6	V	
Againat \/	$V\phi_1, V\phi_3 - VL$	-0.3 to +28	V	
Against V∟	Vφ2, Vφ4, Hφ1, Hφ2, GND – VL	–0.3 to +15	V	
	Voltage difference between vertical clock input pins	to +15	V	*1
Between input clock pins	Ηφ1 — Ηφ2	-6 to +6	V	
	Ηφ1, Ηφ2 – Vφ4	-14 to +14	V	
Storage temperature	-30 to +80	°C		
Operating temperatur	e	-10 to +60	°C	

*1 +24V (Max.) when clock width < 10 μ s, clock duty factor < 0.1%.

Bias Conditions

Item	Symbol	Min.	Тур.	Max.	Unit	Remarks
Supply voltage	Vdd	14.55	15.0	15.45	V	
Protective transistor bias	VL		*1			
Substrate clock	φSUB		*2			
Reset gate clock	φRG		*2			

*1 VL setting is the VvL voltage of the vertical transfer clock waveform, or the same power supply as the VL power supply for the V driver should be used.

*2 Do not apply a DC bias to the substrate clock and reset gate clock pins, because a DC bias is generated within the CCD.

DC Characteristics


Item	Symbol	Min.	Тур.	Max.	Unit	Remarks
Supply current	Idd		3.5	5.5	mA	


Clock Voltage Conditions

Item	Symbol	Min.	Тур.	Max.	Unit	Waveform diagram	Remarks
Readout clock voltage	Vvт	14.55	15.0	15.45	V	1	
	Vvh1, Vvh2	-0.05	0	0.05	V	2	Vvн = (Vvн1 + Vvн2)/2
	Vvнз, Vvн4	-0.2	0	0.05	V	2	
	Vvl1, Vvl2, Vvl3, Vvl4	-8.0	-7.5	-7.0	V	2	$V_{VL} = (V_{VL3} + V_{VL4})/2$
	V¢v	6.8	7.5	8.05	V	2	$V\phi = V + n - V + n (n = 1 \text{ to } 4)$
Vertical transfer clock	V∨нз – V∨н	-0.25		0.1	V	2	
voltage	V∨н4 — V∨н	-0.25		0.1	V	2	
	V∨нн			0.3	V	2	High-level coupling
	Vvhl			0.3	V	2	High-level coupling
	Vvlh			0.3	V	2	Low-level coupling
	Vvll			0.3	V	2	Low-level coupling
Horizontal transfer	Vфн	3.0	3.3	5.25	V	3	
clock voltage	Vhl	-0.05	0	0.05	V	3	
Depart meter also de	Vørg	3.0	3.3	5.5	V	4	Input through 0.1µF capacitance
Reset gate clock voltage	Vrglh – Vrgll			0.4	V	4	Low-level coupling
	Vrgl – Vrglm			0.5	V	4	Low-level coupling
Substrate clock voltage	Vфsuв	21.5	22.5	23.5	V	5	


Clock Equivalent Circuit Constant

Item	Symbol	Min.	Тур.	Max.	Unit	Remarks
Capacitance between vertical transfer clock	Cφν1, Cφν3		680		pF	
and GND	Cφν2, Cφν4		220		pF	
	Сфv12, Сфv34		91		pF	
Capacitance between vertical transfer clocks	Сфv23, Сфv41		75		pF	
	Сфv13, Сфv24		30		pF	
Capacitance between horizontal transfer clock and GND	Сфн1, Сфн2		13		pF	
Capacitance between horizontal transfer clocks	Сфнн		34		pF	
Capacitance between reset gate clock and GND	Cørg		5		pF	
Capacitance between substrate clock and GND	Сфѕив		180		pF	
Vertical transfer clock series resistor	R1, R2, R3, R4		120		Ω	
Vertical transfer clock ground resistor	Rgnd		15		Ω	
Horizontal transfer clock series resistor	Rфн		15		Ω	
Reset gate clock series resistor	Rørg		51		Ω	

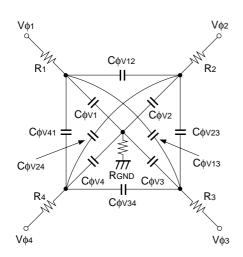

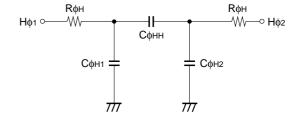

Vertical transfer clock equivalent circuit

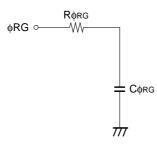


Reset gate clock equivalent circuit


Horizontal transfer clock equivalent circuit

Drive Clock Waveform Conditions


(1) Readout clock waveform

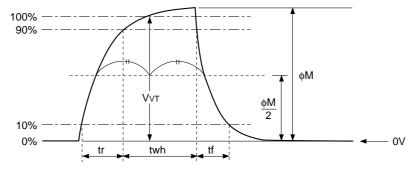


(2) Vertical transfer clock waveform

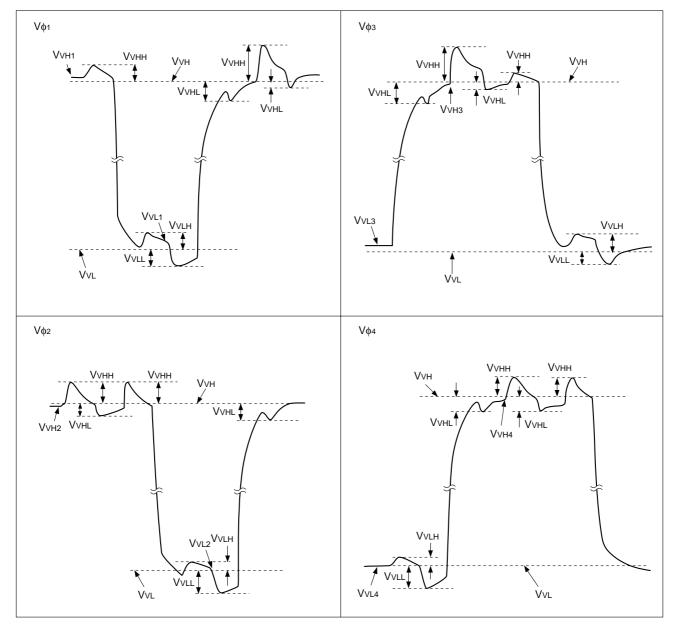

(3) Horizontal transfer clock waveform

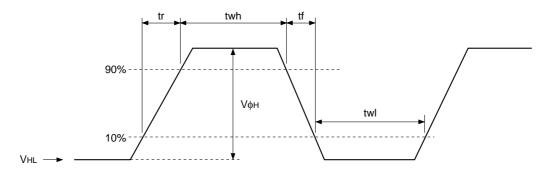

(4) Reset gate clock waveform

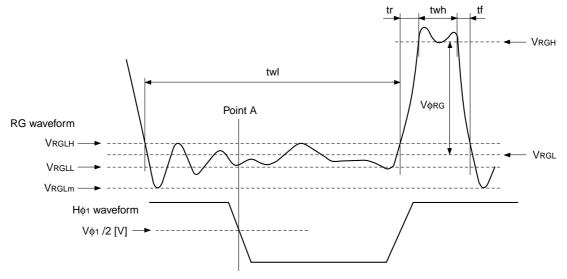

VRGLH is the maximum value and VRGLL is the minimum value of the coupling waveform during the period from Point A in the above diagram until the rising edge of RG. In addition, VRGL is the average value of VRGLH and VRGLL.


 $V_{RGL} = (V_{RGLH} + V_{RGLL})/2$

Assuming VRGH is the minimum value during the interval twh, then:

 $V\phi RG = VRGH - VRGL$

Negative overshoot level during the falling edge of RG is VRGLm.

(5) Substrate clock waveform

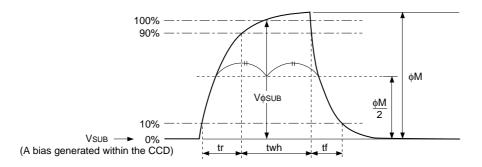

Clock Switching Characteristics

	ltom			twh			twl			tr			tf		1.1	Domorko
	Item	Symbol	Min.	Тур.	Max.	Unit	Remarks									
Rea	dout clock	Vт	2.3	2.5						0.5			0.5		μs	During readout
Vert cloc	ical transfer k	Vφ1, Vφ2, Vφ3, Vφ4										15		250	ns	*1
ک	풍 During	Ηφ1	26	28.5		26	28.5			6.5	9.5		6.5	9.5	ns	*2
, clo	imaging	Нф2	26	28.5		26	28.5			6.5	9.5		6.5	9.5	113	
Horizontal transfer clock	During parallel-serial	Hφ1		5.38						0.01			0.01		μs	
tral H0	conversion	Нф2					5.38			0.01			0.01		μο	
Res	et gate clock	φRG	11	13		76	51			3			3		ns	
Sub	strate clock	φSUB	1.5	1.8							0.5			0.5	μs	During drain charge

*1 When vertical transfer clock driver CXD1267AN is used.

*2 When V ϕ H = 3.0V. tf \geq tr – 2ns, and the cross-point voltage (VCR) for the H ϕ 1 rising side of the H ϕ 1 and H ϕ 2 waveforms must be at least V ϕ H/2 [V].

Itom	Symbol		two		Linit	Domorko	
ltem	Symbol	Min.	Тур.	Max.	Unit	Remarks	
Horizontal transfer clock	Ηφ1, Ηφ2	22	26		ns	*3	


 *3 The overlap period of twh and twl of horizontal transfer clocks H $_{\phi 1}$ and H $_{\phi 2}$ is two.

Image Sensor Characteristics


(Ta = 25°C)

							,
ltem	Symbol	Min.	Тур.	Max.	Unit	Measurement method	Remarks
Sensitivity	S	240	300		mV	1	
Constituitu rotio	RмgG	0.93		1.35		2	
Sensitivity ratio	RYeCy	1.15		1.48		2	
Saturation signal	Ysat	540			mV	3	Ta = 60°C
Smear	Sm		0.009	0.015	%	4	
				20	%	5	Zone 0 and I
Video signal shading	SHy			25	%	5	Zone 0 to II'
Uniformity between video	∆Sr			10	%	6	
signal channels	ΔSb			10	%	6	
Dark signal	Ydt			2	mV	7	Ta = 60°C
Flicker Y	Fy			2	%	8	
Flicker R-Y	Fcr			5	%	8	
Flicker B-Y	Fcb			5	%	8	
Line crawl R	Lcr			3	%	9	
Line crawl G	Lcg			3	%	9	
Line crawl B	Lcb			3	%	9	
Line crawl W	Lcw			3	%	9	

Zone Definition of Video Signal Shading

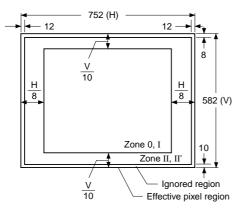

Measurement System

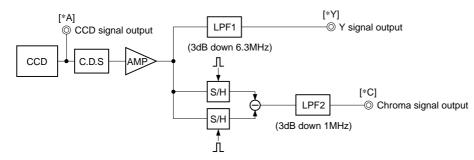


Note) Adjust the amplifier gain so that the gain between [*A] and [*Y], and between [*A] and [*C] equals 1.

Image Sensor Characteristics Measurement Method

O Measurement conditions

- 1) In the following measurements, the device drive conditions are at the typical values of the bias and clock voltage conditions.
- 2) In the following measurements, spot blemishes are excluded and, unless otherwise specified, the optical black level (OB) is used as the reference for the signal output, which is taken as the value of Y signal output or chroma signal output of the measurement system.

O Color coding of this image sensor & Composition of luminance (Y) and chroma (color difference) signals

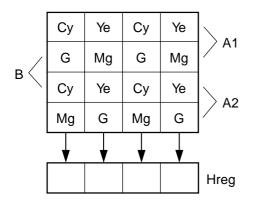

As shown in the left figure, fields are read out. The charge is mixed by pairs such as A1 and A2 in the A field. (pairs such as B in the B field)

As a result, the sequence of charges output as signals from the horizontal shift register (Hreg) is, for line A1, (G + Cy), (Mg + Ye), (G + Cy), and (Mg + Ye).

Color Coding Diagram

These signals are processed to form the Y signal and chroma (color difference) signal. The Y signal is formed by adding adjacent signals, and the chroma signal is formed by subtracting adjacent signals. In other words, the approximation:

$$Y = \{(G + Cy) + (Mg + Ye)\} \times 1/2$$

= 1/2 {2B + 3G + 2R}

is used for the Y signal, and the approximation:

$$R - Y = \{(Mg + Ye) - (G + Cy)\}$$

Y

is used for the chroma (color difference) signal. For line A2, the signals output from Hreg in sequence are (Mg + Cy), (G + Ye), (Mg + Cy), (G + Ye).

The Y signal is formed from these signals as follows:

= {(G + Ye) + (Mg + Cy)}
$$\times$$
 1/2
= 1/2 {2B + 3G + 2R}

This is balanced since it is formed in the same way as for line A1.

In a like manner, the chroma (color difference) signal is approximated as follows:

$$-(B - Y) = {(G + Ye) - (Mg + Cy)}$$

$$= - \{2B - G\}$$

In other words, the chroma signal can be retrieved according to the sequence of lines from R - Y and -(B - Y) in alternation. This is also true for the B field.

O Definition of standard imaging conditions

1) Standard imaging condition I:

Use a pattern box (luminance 706cd/m², color temperature of 3200K halogen source) as a subject. (Pattern for evaluation is not applicable.) Use a testing standard lens with CM500S (t = 1.0mm) as an IR cut filter and image at F5.6. The luminous intensity to the sensor receiving surface at this point is defined as the standard sensitivity testing luminous intensity.

2) Standard imaging condition II:

Image a light source (color temperature of 3200K) with a uniformity of brightness within 2% at all angles. Use a testing standard lens with CM500S (t = 1.0mm) as an IR cut filter. The luminous intensity is adjusted to the value indicated in each testing item by the lens diaphragm.

3) Standard imaging condition III:

Image a light source (color temperature of 3200K) with a uniformity of brightness within 2% at all angles. Use a testing standard lens (exit pupil distance -33mm) with CM500S (t = 1.0mm) as an IR cut filter. The luminous intensity is adjusted to the value indicated in each testing item by the lens diaphragm.

1. Sensitivity

Set to standard imaging condition I. After selecting the electronic shutter mode with a shutter speed of 1/250s, measure the Y signal (Ys) at the center of the screen and substitute the value into the following formula.

$$S = Ys \times \frac{250}{50} [mV]$$

2. Sensitivity ratio

Set to standard imaging condition II. Adjust the luminous intensity so that the average value of the Y signal output is 200mV, and then measure the Mg signal output (S_{Mg} [mV]) and G signal output (S_G [mV]), and Ye signal output (S_{Ye} [mV]) and Cy signal output (S_{Cy} [mV]) at the center of the screen with frame readout method. Substitute the values into the following formula.

- $R_{MgG} = S_{Mg}/s_{G}$ $R_{YeCy} = S_{Ye}/S_{Cy}$
- 3. Saturation signal

Set to standard imaging condition II. After adjusting the luminous intensity to 10 times the intensity with average value of the Y signal output, 200mV, measure the minimum value of the Y signal.

4. Smear

Set to standard imaging condition II. With the lens diaphragm at F5.6 to F8, adjust the luminous intensity to 500 times the intensity with average value of the Y signal output, 200mV. When the readout clock is stopped and the charge drain is executed by the electronic shutter at the respective H blankings, measure the maximum value (YSm [mV]) of the Y signal output and substitute the value into the following formula.

 $Sm = \frac{YSm}{200} \times \frac{1}{500} \times \frac{1}{10} \times 100$ [%] (1/10V method conversion value)

5. Video signal shading

Set to standard imaging condition III. With the lens diaphragm at F5.6 to F8, adjust the luminous intensity so that the average value of the Y signal output is 200mV. Then measure the maximum (Ymax [mV]) and minimum (Ymin [mV]) values of the Y signal and substitute the values into the following formula.

SHy = $(Ymax - Ymin)/200 \times 100$ [%]

6. Uniformity between video signal channels

Set to standard imaging condition II. Adjust the luminous intensity so that the average value of the Y signal output is 200mV, and then measure the maximum (Crmax, Cbmax [mV]) and minimum (Crmin, Cbmin [mV]) values of the R – Y and B – Y channels of the chroma signal and substitute the values into the following formula.

 Δ Sr = | (Crmax - Crmin)/200 | × 100 [%] Δ Sb = | (Cbmax - Cbmin)/200 | × 100 [%]

7. Dark signal

Measure the average value of the Y signal output (Ydt [mV]) with the device ambient temperature 60°C and the device in the light-obstructed state, using the horizontal idle transfer level as a reference.

8. Flicker

1) Fy

Set to standard imaging condition II. Adjust the luminous intensity so that the average value of the Y signal output is 200mV, and then measure the difference in the signal level between fields (Δ Yf [mV]). Then substitute the value into the following formula.

 $Fy = (\Delta Yf/200) \times 100 [\%]$

2) Fcr, Fcb

Set to standard imaging condition II. Adjust the luminous intensity so that the average value of the Y signal output is 200mV, insert an R or B filter, and then measure both the difference in the signal level between fields of the chroma signal (Δ Cr, Δ Cb) as well as the average value of the chroma signal output (CAr, CAb). Substitute the values into the following formula.


 $Fci = (\Delta Ci/CAi) \times 100 [\%] (i = r, b)$

9. Line crawls

Set to standard imaging condition II. Adjust the luminous intensity so that the average value of the Y signal output is 200mV, and then insert a white subject and R, G, and B filters and measure the difference between Y signal lines for the same field (Δ YIw, Δ YIr, Δ YIg, Δ YIb [mV]). Substitute the values into the following formula.


Lci = $(\Delta Y li/200) \times 100$ [%] (i = w, r, g, b)

Drive Circuit

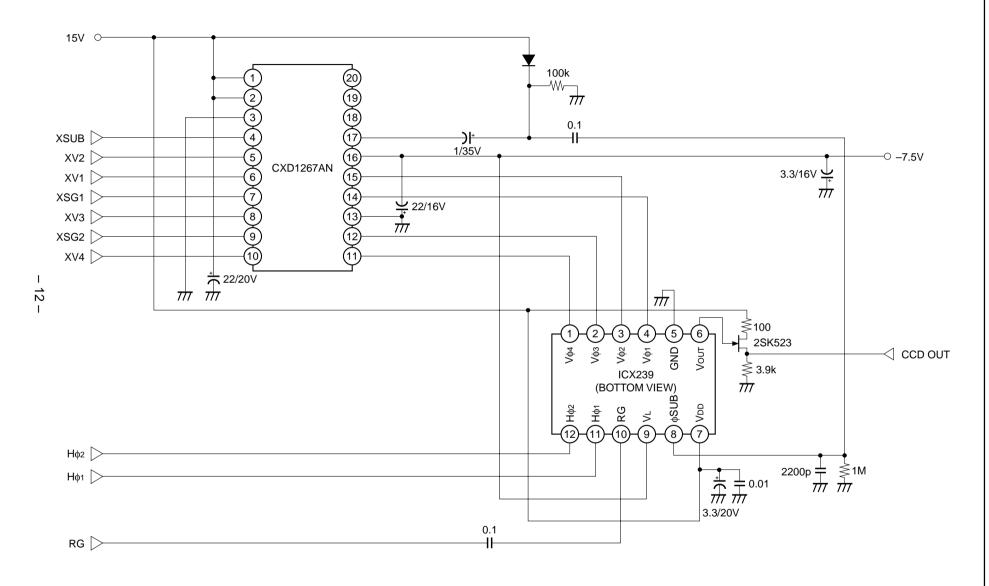


SONA


Spectral Sensitivity Characteristics (excludes both lens characteristics and light source characteristics)

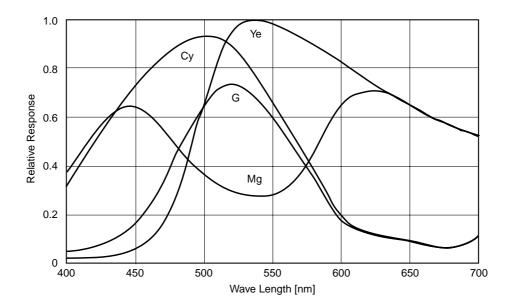


Sensor Readout Clock Timing Chart

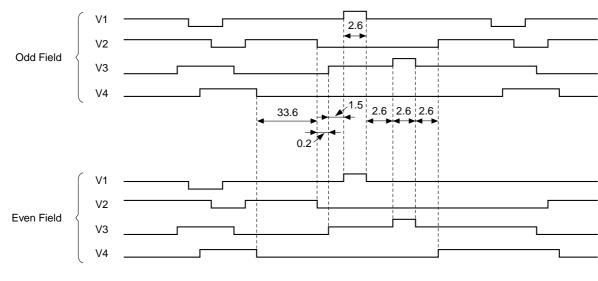

Unit : µs

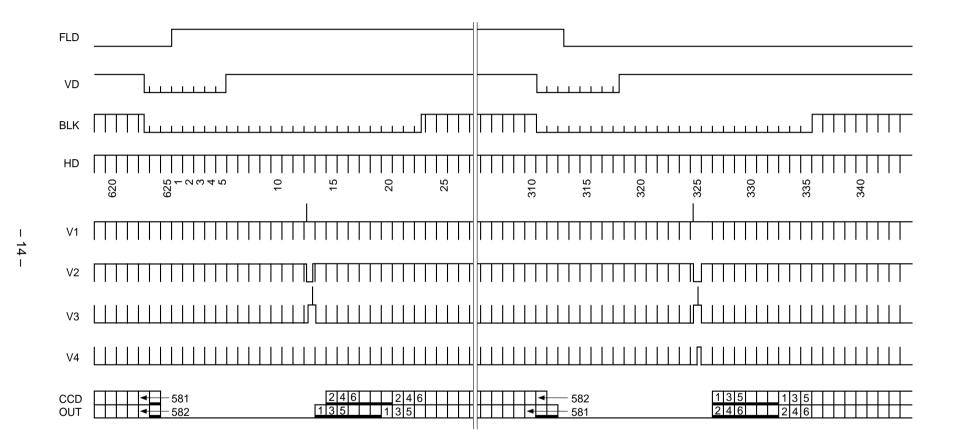

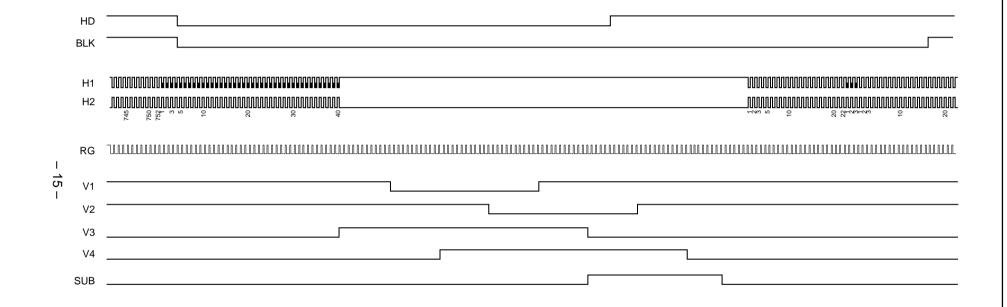

Notes on Handling

1) Moisture resistance

As the moisture resistance of this CCD is not guaranteed, be sure to consider the moisture resistance at the set built in this CCD.

2) Static charge prevention

CCD image sensors are easily damaged by static discharge. Before handling be sure to take the following protective measures.

- a) Either handle bare handed or use non-chargeable gloves, clothes or material. Also use conductive shoes.
- b) When handling directly, use an earth band.
- c) Install a conductive mat on the floor or working table to prevent the generation of static electricity.
- d) Ionized air is recommended for discharge when handling CCD image sensor.
- e) For the shipment of mounted substrates, use boxes treated for the prevention of static charges.
- 3) Soldering
 - a) Make sure that the temperature of the cap on the ceramic package doesnot exceed 80°C.
 - b) Solder dipping in a mounting furnace causes damage to the glass and other defects. Use a 30W soldering iron with a ground wire and solder each pin in less than 2 seconds. For repairs and remount, cool sufficiently.
 - c) To dismount an image sensor, do not use a solder suction equipment. When using an electric desoldering tool, use a thermal controller of the zero cross On/Off type and connect it to ground.
- 4) Dust and dirt protection

Image sensors are packed and delivered by taking care of protecting its glass plates from harmful dust and dirt. Clean glass plates with the following operation as required, and use them.


- a) Perform all assembly operations in a clean room (class 1000 or less).
- b) Do not either touch glass plates by hand or have any object come in contact with glass surfaces. Should dirt stick to a glass surface, blow it off with an air blower. (For dirt stuck through static electricity, ionized air is recommended.)
- c) Clean with a cotton bud and ethyl alcohol if the grease stained. Be careful not to scratch the glass.
- d) Keep in a case to protect from dust and dirt. To prevent dew condensation, preheat or precool when moving to a room with great temperature differences.


5) Installing (attaching)

- a) If a load is applied to the entire surface by a hard component, bending stress may be generated and the package may fracture, etc., depending on the flatness of the bottom of the package. Therefore, for installation, use either an elastic load, such as a spring plate, or an adhesive.
- b) If the metal, etc., clash or rub against the package, the dust may be generated by the fragments of package.
- c) Acrylate anaerobic adhesives are generally used to attach CCD image sensors. In addition, cyano-acrylate instantaneous adhesives are sometimes used jointly with acrylate anaerobic adhesives. (reference)

- 6) Others
 - a) Do not expose to strong light (sun rays) for long periods, color filters will be discolored. When high luminance objects are imaged with the exposure level control by electronic-iris, the luminance of the image-plane may become excessive and discolor of the color filter will possibly be accelerated. In such a case, it is advisable that taking-lens with the automatic-iris and closing of the shutter during the poweroff mode should be properly arranged. For continuous using under cruel condition exceeding the normal using condition, consult our company.
 - b) Exposure to high temperature or humidity will affect the characteristics. Accordingly avoid storage or usage in such conditions.
 - c) The cap is put on the package with light pressure but not sticked by adhesive. Be careful not to add shock to the chip. The cap of this CCD should not be removed. If the cap is removed, the characteristics of the CCD is not guaranteed.
 - d) The center point and the rotation angle of the effective image area after taking off the location hole and the long hole, are not guaranteed. If necessary, we recommend to carry out the acceptance inspection.
 - e) The marking is not indicated on the surface of this CCD. Special care should be taken for the management of the stored CCD. If necessary, we recommend to carry out the acceptance inspection.

NON

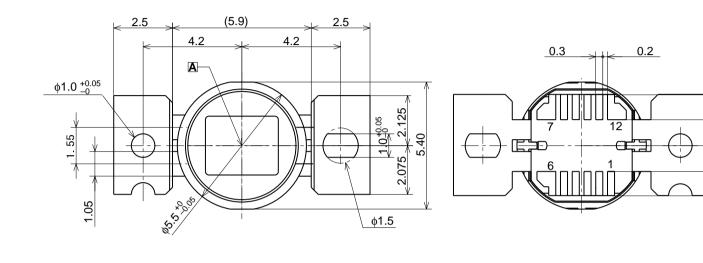

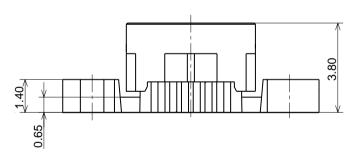

PACKAGE MATERIAL	Plastic
LEAD TREATMENT	GOLD PLATING
LEAD MATERIAL	
PACKAGE MASS	0.2g
DRAWING NUMBER	AS-F14(E)

- 1. "A" is the center of the effective image area.
- 2. The height from the bottom of the package to the effective image area is 2.0mm.
- 3. The center of the effective image area relative to the center point that is at an equal distance from each center of the location hole and the long hole is \pm 0.15mm.

2.125

2.075

N

- 4. The rotation angle of the effective mage area relative to the reference line connecting both center of the location hole and the long hole is $\pm 1^{\circ}$.
- The cap is put on the package with light pressure but not sticked by adhesive. Be careful not to add shock to the chip. If the cap is removed, the characteristics of the CCD is not guaranteed.
- 6. As the moisture resistance of this CCD is not guaranteed, be sure to consider the moisture resistance at the set built in this CCD.