
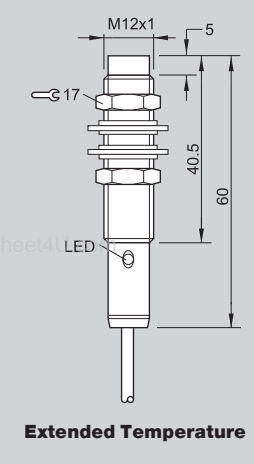
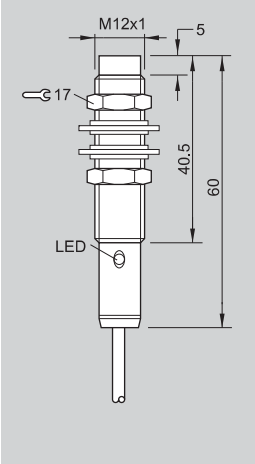
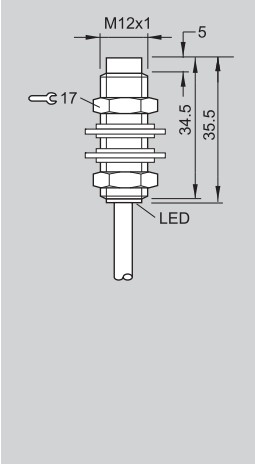
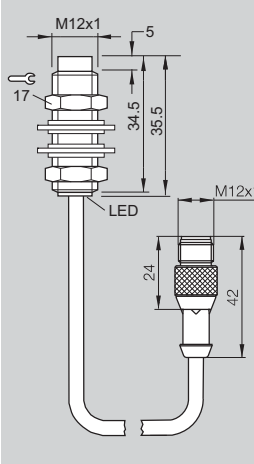


# DC 3-/4-Wire

## Inductive Sensors

DC 3-/4-Wire  
M12  
S<sub>n</sub> 4 mm

M12x1 non-flush 4 mm 0...3.2 mm	M12x1 non-flush 4 mm 0...3.2 mm	M12x1 non-flush 4 mm 0...3.2 mm	M12x1 non-flush 4 mm 0...3.2 mm	M12x1 non-flush 4 mm 0...3.2 mm
				
<b>Extended Temperature</b>				
BES 516-356-B0-C-05 BES 516-3019-B0-C-05	BES 516-131-B0-C-05	BES 516-356-E4-C-05 BES 516-3019-E4-C-PU-05	BES 516-356-E4-C-S4-00,3	BES 516-356-E4-C-S49-00,1
BES 516-357-B0-C-05 BES 516-3030-B0-C-03	BES 516-122-B0-C-05	BES 516-357-E4-C-05		
24 Vdc 10...30 Vdc ≤ 1.5 V 250 Vac 200 mA ≤ 8 mA/≤ 1 mA ≤ 10 µA yes yes ≤ 0.5 µF	24 Vdc 10...30 Vdc ≤ 2.5 V 250 Vac 200 mA ≤ 32 mA/≤ 20 mA ≤ 80 µA yes yes ≤ 1.0 µF	24 Vdc 10...30 Vdc ≤ 2.0 V 250 Vac 200 mA ≤ 10 mA/≤ 4 mA ≤ 30 µA yes yes ≤ 0.5 µF	24 Vdc 10...30 Vdc ≤ 2.0 V 250 Vac 200 mA ≤ 10 mA/≤ 4 mA ≤ 30 µA yes yes ≤ 0.5 µF	24 Vdc 10...30 Vdc ≤ 2.0 V 250 Vac 200 mA ≤ 10 mA/≤ 4 mA ≤ 30 µA yes yes ≤ 0.5 µF
≤ 5 % -40...+85 °C 1500 Hz yes IP 68 stainless steel PA 12 cable 3 x 22 AWG cULus	≤ 5 % -25...+70 °C 400 Hz yes IP 68 stainless steel PA 12 cable 4 x 24 AWG cULus	≤ 5 % -25...+70 °C 2000 Hz yes IP 68 nickel plated brass PBT cable 3 x 22 AWG cULus	≤ 5 % -25...+70 °C 2000 Hz yes IP 68 nickel plated brass PBT cable with connector cULus C04 AEL-00-VY-050M	≤ 5 % -25...+70 °C 2000 Hz yes IP 68 nickel plated brass PBT cable with connector cULus C49 ANE-00-VY-050M

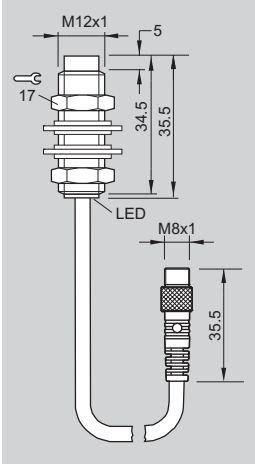

- For mounting brackets & accessories see section 7.  
- For mating connectors see section 6.