## Universal Active Light Sensor Interface

#### **Features & Benefits**

Two independent simultaneously operating
active light measurement channels

- ☐ Integrated DC light cancellation circuitry for active light channel DC light suppression
- ☐ Two logarithmic ambient light channels
- ☐ High input capacitance tolerant input current terminals
- Extremely high degree of adaptability for different optical systems

- Stand-by and sleep modes
- Integrated 16Bit ADC
- □ Integrated temperature sensor
- Easy digital communication interface via SPI
- Integrated watchdog timer
- ☐ High safety design by comprehensive diagnostic and monitoring functions
- ☐ Minimum amount of external components
- ☐ Small-size SMD package QFN24 4x4 mm

#### **Ordering Information**

 Part No.
 Temperature Code

 MLX75030
 R (-40°C to 105°C)

 MLX75030
 C (0°C to 70°C)


Package Code LQ (QFN24 4x4) LQ (QFN24 4x4) Option code

B B

## **Application Examples**

- Optical proximity sensing & display dimming
- Touch-less gesture recognition, Driver/passenger discrimination

## Pin Description - Top View

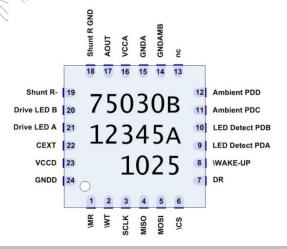

## **General Description**

The MLX75030 Universal Active Light Sensor Interface was designed to allow easy and robust dual-channel optical reflection and dual channel ambient light measurement. Therefore it is ideally suited for the design of responsive human-machine interfaces (HMI) that require proximity or gesture detection in environments subject to wide background light level variations, possibly in combination with display dimming.

The MLX75030 IC consists of two optical sensor interface parts. Part one is optimized for active light measurements and is designed to control up to 2 external LEDs and to sense modulated light current from up to 2 external photodiodes on independent channels A and B. The active light detection is virtually independent from background light by means of integrated hardware-level ambient light suppression. Part two consists of two logarithmic current sensors C and D, which can measure the photocurrent of externally connected photodiodes. Simple and programmable operation is ensured by internal control logic, configurable user registers and SPI communication.



## Functional Block Diagram

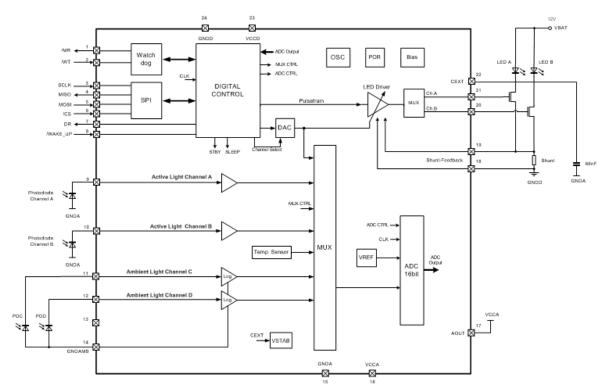


Figure 1: MLX75030 Functional Block Diagram



### Universal Active Light Sensor Interface

## 1 General Description

The Universal Active Light Sensor Interface can control two active light channels independently. Each channel is defined by a control output to drive 1 LED and a sense input to connect a photodiode. A wide range of LEDs and photodiodes are supported directly. The device will control the LED current and measure any photodiode current, whichwill be converted by the onboard ADC. This information can be transferred to a basic microcontroller via SPI. The optical light intensity of both active light channels can be used to detect proximity of an object close to the detectors, independent from the background light level. This information can be used by software algorithms to distinguish human gestures like e.g. swiping from left to right or up to down and vice versa. Smart placement of the LEDs / photodiodes can extend the number of gestures that can be detected.

The MLX75030 is able to measure up to two ambient light levels and can provide this data to various other systems. For this application a wide range of different detectors can be connected to the ambient sensor terminals of the device.

The IC provides various auxiliary circuit functions to support the main mission of the Active Light Sensor Interface, for example, a watchdog function, bias and reference sources and clock generators to control and drive the various on-chip functions. In addition, an SPI Interface is included to support data exchange between the IC and the microcontroller.



## **Application Diagram**

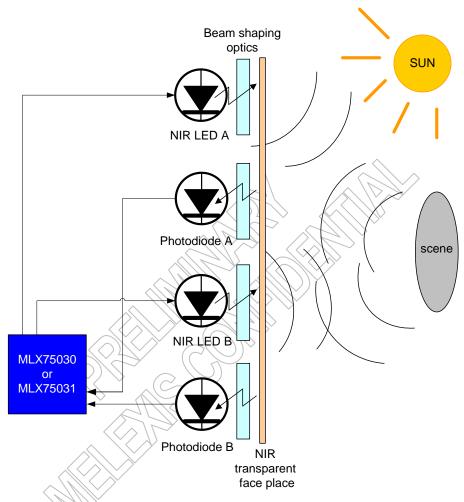


Figure 2 : Application diagram of a dual channel active reflection detector with 2 photodiodes and 2 LEDs.

The measured signal is virtually independent of background light from the sun or other sources.





## **Table of Contents**

runctional Block Diagram	4
1 General Description	3
2 Glossary of Terms	6
3 Absolute Maximum Ratings	7
4 Pin Definitions & Descriptions	7
4 Pin Definitions & Descriptions	10
6 Sensor Specific Specifications	11
7 Detailed General Description	11
7.4 holos Coner Functions	۰۰۰۰۰ ۱۰۰۰۰
7.1 Analog Sensor Functions	15
7.1.1 Active Light Sensor	15
7.1.1.1 Active Light Channel DC Light Measurement	15
7.1.2 Ambient Light Sensor	15
7.1.2.1 Normal Operation	15
7.1.2.2 Diagnostics Mode Operation	16
7.1.3 Temperature Sensor	16
7.1.4 DAC	16
7.1.5 LED Driver	17
7.2 SPI	17
7.1.2.1 Normal Operation 7.1.2.2 Diagnostics Mode Operation 7.1.3 Temperature Sensor 7.1.4 DAC 7.1.5 LED Driver 7.2 SPI 7.2.1 General Description of SPI Interface 7.2.2 Detailed Explanation of SPI Instruction Words 7.2.2.1 NOP – Idle Command 7.2.2.2 CR – Chip Reset Command 7.2.2.3 RSLP/CSLP – Request Sleep/Confirm Sleep. 7.2.2.4 RSTBY/CSTBY - Request Standby/Confirm Standby 7.2.2.5 NRM – Normal Running Mode 7.2.2.6 SM – Start Measurement 7.2.2.7 RO – Start Read-Out 7.2.2.8 SM+RO - Start Measurement combined with Read-Out	17
7.2.2 Detailed Explanation of SPI Instruction Words	21
7 2 2 1 NOP – Idla Command	21
7.2.2.2 CP. Chip Pocot Command	21
7.2.2.2 CN - Clip Reset Collinial III.	∠ ۱
7.2.2.5 NOLF/OOLF - Request Sieep/Collinin Sieep.	ا کے
7.2.2.4 KSTBYCSTBY - Request StandbyConfirm Standby	22
7.2.25 NRM – Normal Running Mode	22
7.2.2.6 SM – Start Measurement	22
7.2.2.7 RO – Start Read-Out	24
7.2.2.8 SM+RO - Start Measurement combined with Read-Out	27
7.2.2.9 WR/RR – Write/Read Register	28
7.2.2.10 SD – Start Diagnostics	29
7.3 Internal Status Flags	31
7.2.2.8 SM+RO - Start Measurement combined with Read-Out. 7.2.2.9 WR/RR - Write/Read Register. 7.2.2.10 SD - Start Diagnostics. 7.3 Internal Status Flags 7.4 User Registers Overview. 7.4.1 SetAna register. 7.4.2 SetAH register. 7.4.3 SetAL register. 7.4.4 SetBH register. 7.4.5 SetBL register. 7.4.5 SetBL register. 7.4.6 SetPF register. 7.4.7 Err register. 7.4.8 Rst register. 7.4.9 GainBuf register 7.4.10 Calib1/Calib2 register. 7.4.11 EnChan register. 7.4.11 EnChan register. 7.4.12 Tamb register.	33
7.4.1 SetAna register	34
7.4.2 SetAH register.	35
7.4.3 SetAL register	35
7 4 4 SetBH register	36
7.4.5 SatBI register	36
7.4.6 CatDE register	oc
7.4.7 Ser register	3 <i>1</i>
7.4.7 EII register	30
7.4.8 RSt register	38
7.4.9 Gainbur register	40
7.4.10 Calib1/Calib2 register	41
7.4.11 EnChan register	45
7.4.12 Tamb register	46
7.5 Window Watchdog Timer	47
7.6 Reset Behaviour	49
7.7 Wake-up from Sleep or Standby	
7.8 CRC Calculation	51
7.9 Global Timing Diagrams	52
8 Performance Graphs	
8.1 LED Channel DC Measurement	
8.2 Temperature Sensor Characteristics	
8.3 Ambient Light Channel C	
8.4 Ambient Light Channel D	
9 Application Information	
9.1 Application circuit for typ. active light channel and two ambient channels	
10 Application Comments	55
11 Standard information regarding manufacturability of Melexis products with different soldering processes	
12 ESD Precautions	
13 Package Information	-
14 Disclaimer	58



Datasheet

### Universal Active Light Sensor Interface

### 2 Glossary of Terms

ADC Analog-Digital converter

CR Chip Reset

CRC Cyclic Redundancy Check

CS Chip Select
CSLP Confirm Sleep
CSTBY Confirm Standby
CTRL Control Signal

DAC Digital to Analog Converter

DC Direct Current DR Device Ready

EMC Electromagnetic Compatibility

GNDA Ground for analog Blocks of MLX7530 GNDD Ground for digital Blocks of MLX75030

IR Infrared

**LED** Light emitting diode Low-pass filter **LPF** LSB Least Significant Bit MISO Master In Slave Out MOSI Master Out Slave In MR Master Reset MSB Most Significant Bit MUX Multiplexer NOP No Operation Number of Pulses NΡ Normal Running Mode NRM

OSC Oscillator

**SCLK** 

OTP One time programmable Optical transfer ratio **OTR** Photodiode PD**POR** Power on reset **RCO RC-Oscillator** RO Read-Out RR Read Register **RSLP** Request Sleep **RSTBY** Request Standby S&H Sample and Hold

SC-LPF Switched Capacitor biquad Low-pass filter

SPI Shift Clock

SM Start Measurement
SNR Signal-to-Noise Ratio
SPI Serial Peripheral Interface
TIA Transimpedance Amplifier

VBATT\_30 VBATT which is supplied from connection 30 of the car

VCCA Supply Voltage for the analog blocks VCCD Supply Voltage for the digital blocks

VDD\_30 VDD which is supplied from connection 30 of the car

VSENSE Voltage across the shunt resistor

WDT Watchdog Timer
WR Write Register
WT Watchdog Trigger
uC Microcontroller



## 3 Absolute Maximum Ratings

Parameter	Symbol	Condition	Min	Max	Units
Supply voltage range	$V_{DD}$		-0.3	5.0	V
Terminal current	I <sub>terminal</sub>	per bondpad	-20	+20	mA
Torminal voltage	V <sub>terminal</sub>	Pins 1-8, 14-24	-0.3	V <sub>DD</sub> +0.3	V
Terminal voltage		Pins 9-13 <sup>1</sup>	-0.3	V <sub>DD</sub> +0.3	V
Storage temperature	T <sub>stg</sub>		-40	+150	°C
Junction temperature	Tj			+150	°C
Power dissipation <sup>2</sup>	P <sub>tot</sub>	For max ambient temperature of 100°C and Teta_ja ≘ 154K/W		320	mW
ESD capability of any pin	ESD <sub>HBM</sub>	Human body model, acc. to AEC-Q100-002	-2	2	kV
(Human Body Model)		Pins 9-13	-1	1	kV
ESD capability of any pin (Charge device model)	ESD <sub>CDM</sub>	Charge device model acc. to AEC- Q100-011	-750	+750	V
Maximum latch-up free current at any pin	LATCH (	JEDEC- Standard EIA / JESD78	-100	+100	mA

Table 1 : Absolute Maximum Ratings

Exceeding the absolute maximum ratings may cause permanent damage.

Exposure to absolute-maximum-rated conditions for extended periods may affect device reliability.

## 4 Pin Definitions & Descriptions

Pin №	Name	Functional Schematic	Туре	Function
1	\MR		Digital Output	Master Reset
2	\WT	₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩ ₩	Digital Input	Watchdog Trigger
3	SCLK	₽	Digital Input	SPI Shift Clock

<sup>&</sup>lt;sup>1</sup> Pins 9-13 require special care with regard to the used ESD protection devices, since these nodes of the design are very sensitive to substrate noise and/or leakage currents.

 $<sup>^2</sup>$  The Power dissipation is valid for  $heta_{
m JA}$  values for the 24 Pin QFN 4x4 package according to Table 24.



# Universal Active Light Sensor Interface

	Г			
4	MISO	EN PAD	Digital Output	SPI Data Output
5	MOSI	**************************************	Digital Input	SPI Data Input
6	\cs	PA	Digital Input	Chip Select
7	DR	PAD	Digital Output	Device Ready
8	\WAKE-UP		Digital Input	Normal Mode
9	Active light Detect PDA	in the second se	Analog Input	IR Photo Diode A
10	Active light Detect PDB		Analog Input	IR Photo Diode B
11	Ambient PDC	1	Analog Input	Ambient Light Photo Diode C
12	Ambient PDD	(E) # #   #	Analog Input	Ambient Light Photo Diode D
13	nc		Not connected	
14	GNDAMB	PAD	Analog I/O	Ground Ambient Light Channels
15	GNDA		Ground	Ground
16	VCCA		Supply	Regulated Power Supply
17	AOUT		Analog I/O	Analog Test Output, connect to VCCA



# Universal Active Light Sensor Interface

18	Shunt R GND	700 #	Analog Input	Shunt resistor feedback to Ground
19	Shunt R-	700 <b>*</b>	Analog Input	Shunt resistor feedback
20	Drive LED B	PAD PAD	Analog Output	IR LED Emitter B
21	Drive LED A	PAID	Analog Output	IR LED Emitter A
22	CEXT	P10 \$	Analog Input	External blocking Cap, connected to GNDA
23	VCCD		Supply	Regulated external power supply
24	GNDD		Ground	Ground

Table 2 : Pin definitions and descriptions

## Universal Active Light Sensor Interface

# 5 General Electrical Specifications

DC Operating Parameters  $T_A$  = -40°C to 105°C (R version),  $T_A$  = 0°C to 70°C (C version),  $V_{DD}$  = 3.0V to 3.6V (unless otherwise specified)

Parameter	Symbol	Test Conditions	Min	Тур	Max	Units
Supply Voltage range	$V_{DD}$		3.0	3.3	3.6	V
Supply Current (active Mode)	I <sub>DD</sub>	without photodiode dc			6	mA
Standby Current	I <sub>SBY</sub>	@ Vcc=3.6V, T=30°C			500	uA
Sleep Current	I <sub>Sleep</sub>	@ Vcc=3.6V, T=30°C			50	uA
Operation Temperature Range	T <sub>A</sub>		-40 <		105	°C
Pull-up resistor	Rpu	for SCLK and \CS		50k		Ohm
Pull-down resistor	Rpd	for MOSI		50k		Ohm
Start-up time after power-on	t <sub>startup</sub>		-5%	50	+5%	ms
Start-up time after power-on for	t <sub>startup_SPI</sub>				10	μs
Start-up time after wake-up from sleep	t <sub>wakeup_slp</sub>		-5%	50	+5%	ms
Start-up time after wake-up from standby	t <sub>wakeup_stby</sub>		-5%	50	+5%	ms
High-level Input Voltage	ViH		0.7 V <sub>DD</sub>		$V_{DD}$	V
Low-level Input Voltage	-VIL		0		0.3 V <sub>DD</sub>	V
Hysteresis on Digital Inputs	VHYST			0.28		V
High Output Voltage (not on pin	Vон	CL=30pF	0.8 V <sub>DD</sub>		$V_{DD}$	V
Low Output Voltage (not on pin	V <sub>OL</sub>	CL=30pF	0		0.2 V <sub>DD</sub>	V
Input leakage	I <sub>LK</sub>		-10		10	μA
Tri-state Output Leakage Current	loz >	,	-10		10	μΑ
Input Capacitance, per Pin	CIN			10		pF
Output voltage Low, Pin MR	VoutL	I <sub>ODC</sub> =2mA			0.1	V

Table 3: Electrical specifications



## 6 Sensor Specific Specifications

DC Operating Parameters  $T_A = -40$ °C to 105°C,  $T_A = 0$ °C to 70°C (C version),  $V_{DD} = 3.0$ V to 3.6V (unless otherwise specified)

Active Light Channels (Detectors A & B)									
Parameter	Symbol	Test Conditions	Min	Тур	Max	Units			
Active light signal optical transfer ratio	$OTR = \frac{I_{LED}}{I_{PDAB}}$		30		80000				
dc sunlight signal	I <sub>Sun</sub>	1	140	$\rightarrow$	900	uA			
fast full scale transition at I <sub>sunmax</sub>	t <sub>sunrise</sub>		3.5			ms			
min. relative active light modulation (referred to received IR signal)	$\frac{\Delta I_{PDAB\_{min}}}{I_{PDAB}}$	- 400Hz BW, - max LED current of 1000mA - 25°C - dc sun constant - Active light response per channel 2.5ms			0.3	%			

Error condition Err6

Critical error detected on TIA output, is TIA output outside 1.1V+/- (0.65 ... 0.75V)

Note: Critical error may occur if the referring active light Channel is disabled and the according diagnostic function is enabled (see EnChan register).

Critical error may occur after enabling of the referring active light Channel due to analog settling time.

Table 4: Active light sensor channels specifications



Input capacity on ambient PDD

Ambient light response time

# MLX75030

рF

ms

100

3

## Universal Active Light Sensor Interface

Ambient Light Channels (Detectors C & D)									
Parameter	Symbol	Test Conditions	Min	Тур	Max	Units			
Input current range for detectors C	I <sub>ambc</sub>		0.01		1040	uA			
Input current range for detectors D	I <sub>ambd</sub>		0.0005		20	uA			
input current threshold level C	I <sub>ambc_detect</sub>		333			nA			
input current threshold level D	I <sub>ambd_detect</sub>		5.5			nA			
Input capacity on ambient PDC	C <sub>ambc</sub>	at 1V			1	nF			

**Error condition Err3** 

Note: Err3 is set if output voltage OUTN or OUTP of the ambient channel SC filter is out of range (meaning: <40% of VCCA or >60% of

at 1V

Table 5: Ambient light channel specifications

 $C_{ambd}$ 

# Universal Active Light Sensor Interface

Temperature Sensor								
Parameter	Symbol	Test Conditions	Min	Тур	Max	Units		
Temp. sensor range	9		-40		105	°C		
Temp. sensor error	θ <sub>error@85°C</sub>	@ VDD=3,3V			±3	°C		
Temp. response time	t <sub>resp_9</sub>				1	S		
Temp. sensor word length				16		bits		
Temp. sensor resolution		for averaging of 16 measurements		13		bits		

Table 6: Temperature sensor specifications

			$\wedge \wedge \wedge \wedge$					
LED Driver								
Parameter	Symbol	Test Conditions	Min	Тур	Max	Units		
LED current	`	Shunt ≠ 1 Ω	1.05		993	mA		
Shunt resistor values			1		10	Ohm		
Shunt voltage			1.05		993	mV		
	Ext	ernal important transistor parame	eter					
Max gate source voltage	V <sub>GS</sub>	VDD=3V			2	V		
Max Gate/Basis current	I <sub>G/B</sub>	VDD=3V			400	uA		
	Error condition Err5							
Err5	difference betw	een Vdac and Vsense. Detection	n level lar	ger 100n	nV			

Table 7: LED driver specifications



# Universal Active Light Sensor Interface

SPI								
Parameter	Symbol	Test Conditions	Min	Тур	Max	Units		
SPI word length					8	bit		
SPI Clock Frequency	$f_{SCLK} = 1/t_{SCLK}$		0.5	1	5	MHz		
Frequency of Internal RC Oscillator	$f_{RCO} = 1/T_{RCO}$		-5%	2.5	+5%	MHz		
CS low prior to first SCLK edge	t <sub>cs_sclk</sub>		50			ns		
CS high after last SCLK edge	t <sub>sclk_cs</sub>		50			ns		
CS high time between transmissions	t <sub>cs_inter</sub>		50			ns		
Time between CS high and DR low	t <sub>cs_dr</sub>		0		21.84 (232us) <sup>3</sup>	μs		
Min low time on WAKE_UP pin	t <sub>wu_l</sub>		100			μs		
Min low time on WT pin	t <sub>wt_l</sub>		10			μs		
WDT initial active window time	t <sub>wdt_init</sub>	After POR, Watchdog Reset and Wake-Up	-5%	140	+5%	ms		
WDT open window time	t <sub>wdt_open</sub>		-5%	70	+5%	ms		
WDT closed window time	t <sub>wdt_closed</sub>		-5%	70	+5%	ms		
MR low time during reset	t <sub>MR</sub>	After Watchdog Reset	-5%	2	+5%	ms		
Error condition Err2								
RCO stuck at High or Low								
Error condition Err4								
Internal voltage regulator : err4 is	set if the regulato	or does not start (detect	ion threst	nold in the	range [1V;	2V]		

Table 8 : Serial peripheral interface specifications

\_\_\_\_75030 Rev 003 Page 14 of 58 Dec/12

<sup>&</sup>lt;sup>3</sup> with random measurement start, the max time can be up to 232us, if an autozeroing phase of the IC is executed.



### Universal Active Light Sensor Interface

## 7 Detailed General Description

#### 7.1 Analog Sensor Functions

#### 7.1.1 Active Light Sensor

The MLX75030 works with two separate transmit- and receive-channels A and B. In order to perform an active light measurement, carrier modulated light signal bursts are transmitted by the LED(s) and received by the active light channel detectors connected to the pins 9 and 10. Both receive-channels can work separate or in parallel.

#### 7.1.1.1 Active Light Channel DC Light Measurement

The input DC current compensation circuitry of the transimpedance amplifier is able to supply and measure the dc current supplied to the photodetector. Both active light channels are identical in structure.

Characteristics will saturate for currents above the I<sub>DC</sub> current range, however the compensation circuit is nevertheless able to supply the specified current levels up to 900uA to the detector. The given ADC word length for the active light channel dc light data is 16Bit.

#### 7.1.2 Ambient Light Sensor

#### 7.1.2.1 Normal Operation

The ambient light detection system of the MLX75030 consists of two independent channels C and D and an on-chip controllable dedicated ground pin GNDAMB. GNDAMB is internally set to GNDA in normal operation. An external photodiode is connected in between each channel and GNDAMB.

The ambient light signal is low pass filtered on chip.

The signal of a 1ms switched-capacitor filters is sampled by the ADC (on request by an SPI command, each 2.5ms), where it is converted into a 16bit digital word.

The total input stage, this means from the external diode up to the 1ms filter, has a cut-off frequency at ~160Hz. Sampling this output every 2.5ms, commanded by SPI, would make a sample rate of 400Hz, which well above the Nyquist frequency of the present frequency content of 160Hz.

Within the specified input current range the ambient input stages bias the external photodiodes with > 0V in normal operation.



#### 7.1.2.2 Diagnostics Mode Operation

In diagnostics mode, the status of the external photodiodes is checked.

#### 7.1.3 Temperature Sensor

The on-chip temperature sensor measures the IC temperature. The output voltage of the sensor is converted by the 16-bit ADC. The sensor will be trimmed for the best result during the production.

#### 7.1.4 DAC

For active light sensor applications, the MLX75030 DAC has been designed to have the following features: To generate a pulse voltage signal from 1mV to 1V, so that LED current driven by LED driver can be 1mA to 1A if a  $1\Omega$  shunt resistor is used between pins 18 and 19.

DAC piece (2MSBs B[7:6])	Steps each piece (6LSBs B[5:0])	step size for 1 bit (V)	Range covered (V)	Range start (V)	Range end (V)
00	64	1.00E-04	6.40E-03	1.05E-03	7.35E-03
01	64	5.00E-04	3.20E-02	7.65E-03	3.92E-02
10	64	2.50E-03	1.60E-01	4.07E-02	1.98E-01
11	64	1.25E-02	8.00E-01	2.06E-01	9.93E-01

Table 9: The DAC voltage values based DAC codes (B[7:6]) can refer to the following table

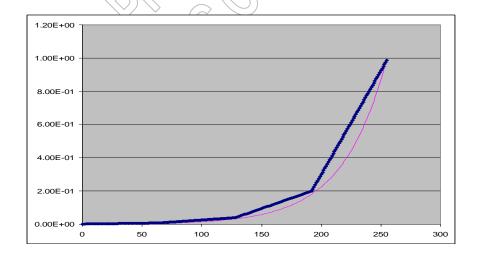


Figure 3: Piece Wise Linear DAC voltage VS DAC codes



#### 7.1.5 LED Driver

LED driver will set the DAC voltage on external shunt resistor by a closed regulation loop.

#### 7.2 SPI

#### 7.2.1 General Description of SPI Interface

After power-on, the sensor enters a reset state (invoked by the internal power-on-reset circuit). A start-up time t<sub>startup</sub> after power-on, the internal reference voltages have become stable and a first measurement cycle can start. To indicate that the start-up phase is complete, the *DR* pin will go high (*DR* is low during the start-up phase).

The control of this sensor is completely SPI driven. For each task to be executed, the proper command must be uploaded via the SPI. The SPI uses a four-wire communication protocol. The following pins are used:

- **CS**: when CS pin is low, transmission and reception are enabled and the *MISO* pin is driven. When the CS pin goes high, the *MISO* pin is no longer driven and becomes a floating output. This makes it possible that one micro-processor takes control over multiple sensors by setting the CS pin of the appropriate sensor low while sending commands. The idle state of the chip select is high.
- **SCLK**: clock input for the sensor. The clock input must be running only during the upload of a new command or during a read-out cycle. The idle state of the clock input is high.
- MOSI: data input for uploading the different commands and the data that needs to be written into some registers. The idle state of the data input is low.
- MISO: data output of the sensor.

A SPI timing diagram is given in Figure 4. This is the general format for sending a command. First the *CS* pin must be set low so that the sensor can accept data. The low level on the *CS* pin in combination with the first rising clock edge is used to start an internal synchronization counter that counts the incoming bits. Data on the *MOSI* pin is clocked in at the rising clock edge. Data on the *MISO* pin is shifted out during the falling clock edge. Note that the tri-state of the *MISO* pin is controlled by the state of *CS*.

After uploading a command, the CS pin must be set high for a minimum time of  $t_{cs\_inter}$  in order to reset the internal synchronization counter and to allow new commands to be interpreted.

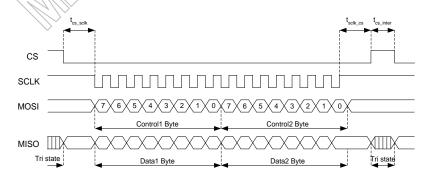


Figure 4: SPI Timing Diagram for 2 byte instructions

The basic structure of a command consists of 2 bytes: the Control1 Byte and the Control2 Byte that are uploaded to the device and the Data1 Byte and the Data2 Byte that are downloaded to the micro-controller. Exceptions are the commands needed to read and write the user registers (WR/RR). These commands need 3 bytes. The timing diagram is given in Figure 5.

### Universal Active Light Sensor Interface

All data transfer happens with MSB first, LSB last. Referring to Figure 4 and Figure 5: within a byte, bit 7 is always defined as the MSB, bit 0 is the LSB. This applies to all data transfers from master to slave and vice versa.

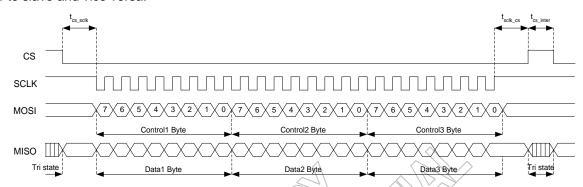


Figure 5 : SPI Timing Diagram for 3 byte instructions

The MSB of the Control1 Byte (bit 7) is a command token: setting this bit to 1 means that the Control1 Byte will be interpreted as a new command. If the MSB is 0, the next bits are ignored and no command will be accepted. The idle command has a Control1 Byte of 0x00.

The command type (chip reset, power mode change, start measurements, start read-out, read/write register) is selected with the next bits 6..0 of the Control 1 Byte.

The Control2 Byte consists of 0x00, to allow clocking out the Data2 Byte. The Data2 Byte contains always the Ctrl1 Byte that was uploaded. Thus the micro-controller can check that the Data2 Byte is an exact replica of the Ctrl1 Byte, to verify that the right command is uploaded to the device.

The Data1 Byte contains some internal status flags to allow checking the internal state of the device. The internal status flags are defined in the table below.

See section 7.3 for more information concerning the operation of the status flags.

Status flag	Status when bit is set	Status when bit is clear			
Bit 7 (MSB)	Previous Command was invalid	Previous Command was valid			
Bit 65	Power State: 11 = (reserved) 10 = Normal Running Mode 01 = Stand-by State 00 = Sleep State				
Bit 4	Sleep Request was sent	No Sleep Request available			
Bit 3	Standby Request was sent	No Standby Request available			
Bit 2	Device is in TestMode	Device is not in TestMode			
Bit 1	Internal Oscillator is enabled (Standby Mode or Normal Running Mode)	Internal Oscillator is shut down (Sleep Mode)			
Bit 0 (LSB)	Critical Error occurred	No Error is detected			

Table 10: Internal Status Flags as given in the Data1 Byte

Table 11: Instruction set of the Active light sensor summarizes the instruction set of the sensor. A detailed explanation of these different commands is given in Section 7.2.2.



## Universal Active Light Sensor Interface

Symbol	Command Description	Control1 Byte	Control2 Byte	Control3 Byte
NOP	Idle Command	0000 0000	0000 0000	N/A
CR	Chip Reset	1111 0000	0000 0000	N/A
RSLP	Request Sleep	1110 0001	0000 0000	N/A
CSLP	Confirm Sleep	1010 0011	0000 0000	N/A
RSTBY	Request Standby	1110 0010	0000 0000	N/A
CSTBY	Confirm Standby	1010 0110	0000 0000	N/A
NRM	Normal Running Mode	1110 0100	0000 0000	N/A
SM	Start Measurement	1101 R <sub>2</sub> R <sub>1</sub> R <sub>0</sub> T	$M_6M_3 M_2 M_1 M_0 P$	N/A
SD	Start Diagnostics	1011 0000	$M_6M_3 M_2 M_1 M_0 P$	N/A
RO	Start Read-Out	1100 0011	0000 0000	N/A
WR	Write Register	1000 0111	D <sub>7</sub> D <sub>0</sub>	A <sub>3</sub> A <sub>0</sub> P <sub>1</sub> P <sub>0</sub> 00
RR	Read Register	1000 1110	A <sub>3</sub> A <sub>0</sub> 0000	0000 0000

Table 11: Instruction set of the Active light sensor


Besides the above instruction set, there are some test commands available for production test purposes. To prevent unintentional access into these test modes, it requires multiple commands before the actual test mode is entered.



## Universal Active Light Sensor Interface

An overview of modes in which the device can operate is shown in Figure 6 : State Diagram of the MLX75030below.

It also indicates which commands are available in the different operation modes.

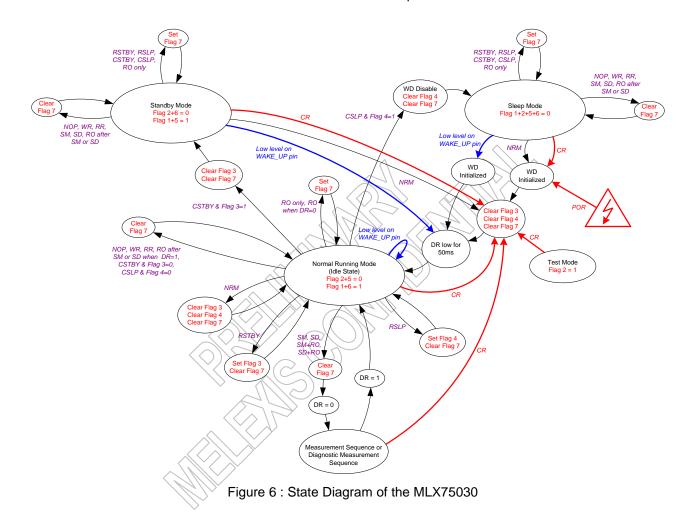



### Universal Active Light Sensor Interface

#### 7.2.2 Detailed Explanation of SPI Instruction Words

#### 7.2.2.1 NOP - Idle Command

The Idle Command can be used to read back the internal status flags that appear in the Data1 Byte. The state of the device is not changed after the NOP command is uploaded.

#### 7.2.2.2 CR – Chip Reset Command

After upload of a Chip Reset command, the sensor returns to a state as it is after power-up (Normal Running Mode) except for the watchdog counter, the state of the *MR* line and the contents of the 'Rst' register. The watchdog counter, the 'Rst' register and the state of the *MR* line will not be influenced by a CR command.

The CR command can be uploaded at any time, even during a measurement or a read-out cycle, provided that the internal synchronization counter is reset. This is done by setting the CS pin high for at least a time  $t_{cs\_inter}$ .

When a CR command is uploaded during sleep mode resp. standby mode, the device goes automatically into normal running mode. Note that this requires a time t<sub>wakeup\_slp</sub> resp. t<sub>wakeup\_stby</sub> before the internal analog circuitry is fully set up again.

Right after upload of a CR command, the *DR* pin will go low during a time t<sub>startup</sub>. Once the wake-up/reset phase is complete, the *DR* pin will go high.

#### 7.2.2.3 RSLP/CSLP - Request Sleep/Confirm Sleep

To avoid that the slave device goes unintentionally into sleep mode, the master has to upload two commands. First a RSLP (Request Sleep) shall be uploaded, then the slave sets bit 4 of the internal status flag byte high. The master has to confirm the sleep request by uploading a CSLP (Confirm Sleep). Afterwards the slave will go into Sleep Mode, hereby reducing the current consumption.

The status flag can be cleared by uploading a CR command or a NRM command. Note that uploading a Chip Reset makes the device switching into normal running mode.

When the device is operating in Sleep Mode, the *WAKE\_UP* pin will be monitored. A falling edge on *WAKE\_UP* will wake up the device and will switch it into Normal Running Mode.

When the device is operating in Sleep Mode, the WT pin will be monitored. If a falling edge is detected, the Critical Error flag in the Internal Status Flag Byte will be set high and the corresponding bit in the 'Err' register will be set high (refer also to Sections 7.3 and 7.4.7).

Note that no pull-up or pull-down resistor is foreseen on the  $WAKE\_UP$  pin. To avoid that parasitic spikes can wake up the device, the  $WAKE\_UP$  input is debounced (typical debounce time is in the range of 2µs). The low time on the  $WAKE\_UP$  pin should be at least a time  $t_{wu}$ .

The state of the DR pin will not be changed when going into Sleep Mode. However, after a wake-up event the DR pin is set low during a time t<sub>wakeup\_slp</sub>.



## Universal Active Light Sensor Interface

### 7.2.2.4 RSTBY/CSTBY - Request Standby/Confirm Standby

To put the device in Standby Mode, a similar system is used: the master shall send the RSTBY command, requesting the slave to go into Standby Mode. The slave device sets bit 3 of the internal status flag byte high, indicating that it wants to go into standby. The master has to confirm this by sending the CSTBY byte.

The status flag can be cleared by uploading a CR command or a NRM command. Uploading a Chip Reset makes the device switching into normal running mode.

When the device is operating in Standby Mode, the *WAKE\_UP* pin will be monitored. A falling edge on *WAKE\_UP* will wake up the device and will switch it into Normal Running Mode.

Note that no pull-up or pull-down resistor is foreseen on the *WAKE\_UP* pin. To avoid that parasitic spikes can wake up the device, the *WAKE\_UP* input is debounced (typical debounce time is in the range of 2µs). The low time on the *WAKE\_UP* pin should be at least a time two.

The state of the DR pin will not be changed when going into Standby Mode. However, after a wake-up event the DR pin is set low during a time t<sub>wakeup\_stby</sub>.

#### 7.2.2.5 NRM - Normal Running Mode

The NRM command shall be used to wake up the device from Sleep Mode, or to go from Standby into Normal Running Mode. This requires a time twakeup\_slp resp. twakeup\_stby before the internal analog circuitry is fully set up again. The NRM will also clear the Sleep Request or Standby Request flag.

When the NRM command is uploaded during normal running mode, the state of the device will not be influenced, except when the Sleep Request or Standby Request flag was set high due to a RSLP or RSTBY command. In this case, the Sleep Request or Standby Request flag will be cleared; the state of the DR pin will not change.

#### 7.2.2.6 SM - Start Measurement

The SM command is used to start up measurement cycles. Several types of measurements can be selected with the measurement selection bits M<sub>6</sub>..M<sub>0</sub> in the Control2 Byte:

- M<sub>6</sub>: setting this bit high enables the temperature measurement
- M<sub>5</sub>: setting this bit high enables the read-out of the two ambient light channels
- M<sub>4</sub>: setting this bit high enables the DC light measurement in the active light channel(s)
- M<sub>3</sub>: setting this bit high fires LED A
- M<sub>2</sub>: setting this bit high fires LED B
- M<sub>1</sub>: setting this bit high enables the active light measurement in channel A
- M<sub>0</sub>: setting this bit high enables the active light measurement in channel B

A typical timing diagram is given in Figure 7. After uploading the SM command, the measurement cycle is started as soon as the *CS* pin is set high. The ADC starts converting all the needed analog voltages and stores the digital values in registers.

A time  $t_{cs\_dr}$  after CS is set high, the state of the DR pin goes low. A time  $t_{dr}$  after DR was set low, the state of the DR pin becomes high, indicating that all measurements are completed and that the resulted data is available for read-out (read-back of the stored data in the registers). This time can be up to 231.84us, if an internal autozeroing process is under execution and needs to be finished.

Table 12 : Basic Measurement Execution Times tdr gives an overview of some execution times  $t_{dr}$  for the basic types of measurements.

Microelectronic Integrated Sustems

# MLX75030

## Universal Active Light Sensor Interface

Measurement Type	Min. t <sub>dr</sub> (μs)	Max. t <sub>dr</sub> (μs)
Temperature measurement	269	298
Ambient light measurements on all channels C and D	388	430
Active light measurements on channels A & B, with 32 pulses, pulse frequency of 48.1kHz, Tdem=6us, Tdc_pulse=400us	1513	1673
DC + Active light measurements on channels A & B, with 32 pulses, pulse frequency of 48.1kHz, Tdem=6us, Tdc_pulse=400us	1811	2002
Temperature measurement + Ambient light measurements on all channels C & D + DC + Active light measurements on channels A & B, with 32 pulses, pulse frequency of 48.1kHz, Tdem=6us, Tdc_pulse=400us	2079	2299

Table 12: Basic Measurement Execution Times t<sub>dr</sub>

<u>Note</u> that the DR pin can be used as an interrupt for the master device as it indicates when a read-out cycle can be started.

<u>Note</u> that measurement execution of Active light measurement only is not allowed. Active light measurements must always be done with Ambient Light measurements.

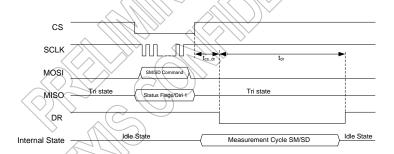


Figure 7: Timing Diagram of a Measurement Cycle

The SM command contains 3 option bits  $R_2R_1R_0$ . These bits set the polarity of the anti-aliasing filters, the switched capacitors low pass filters and the ADC input buffer in active light channels A & B:

- R2: this bit inverts the op-amp in the anti-aliasing filter. The output will change from (Signal + Offset\_opamp\_aa) to (Signal offset\_opamp\_aa). In this way, by processing 2 measurements with inverted R2 bits, the offset of the AA filter can be cancelled.
- R1: Inversion of the offset of active light\_sclp\_filter. The output will change from (Signal +
  Offset\_opamp\_sclp) to (Signal offset\_opamp\_sclp). In this way, by processing 2 measurements
  with inverted R1 bits, the offset of the SCLP filter can be cancelled.
- R0: Inversion of the offset of the ADC\_buffer. The output will change from (Signal + Offset\_opamp\_buf) to (Signal offset\_opamp\_buf). In this way, by processing 2 measurements with inverted R0 bits, the offset of the SCLP filter can be cancelled.
- T: this bit replaces the light pulses by internal current pulses during the active light measurements.



The SM command contains an option bit T. If this bit is set to 0, normal active light measurements are performed (i.e. the external LEDs are fired and the active light channels A and/or B are measured). If this bit is set to 1, no LEDs are fired, but internal test pulses are applied to channels A and/or B. The internal testpulses can be influenced in amplitude by the bits DACA7 and DACA6. Limits for ADC outputs of the TIA testpulses are shown in Table 13: Current levels for active light test mode.

DACA7	DACA6	I_Testpulse [uA]
0	0	5
0	1	13
1	0	21
1	1	29

Table 13: Current levels for active light test mode

In the Control2 byte an even parity bit P is foreseen. The parity bits calculation is based on the measurement selection bits  $M_6..M_0$ . If the number of ones in the given data set  $[M_6..M_0]$  is odd, the even parity bit P shall be set to 1, making the total number of ones in the set  $[M_6..M_0]$  P] even.

The SPI invalid flag will be set when the parity bit does not correspond to the calculated parity bit.

After upload of a SM/SD command, no other commands will be accepted till *DR* is high. This is done to avoid too much disturbances in the analog part. Once *DR* is high, the next command will be accepted. An exception however is the Chip Reset command. This will always be accepted.

Note that none of the SM/SD commands are available in Standby Mode.

#### 7.2.2.7 RO - Start Read-Out

When the state of the *DR* pin changed into a high state, the measurement data is available for read-out. The RO command shall be uploaded to start a read-out cycle and to start reading out the data that was stored in the internal registers.

To make sure that no memory effects can occur, all data registers are cleared at the end of each read-out cycle.

A typical timing diagram is given in Figure 8 below:

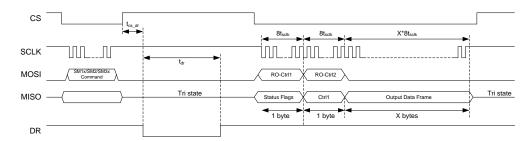


Figure 8: Timing diagram for Read-Out

The data that appears on the *MISO* pin depends on the type of measurement that was done (i.e. it depends on the command that was uploaded: SM/SD and the selected measurement bits M<sub>6</sub>..M<sub>0</sub>).

## Universal Active Light Sensor Interface

The table below shows the Output Data Frame when all measurements are selected :

Data Byte Number	Output Data Frame Contents	Comments		
Byte 3	Temperature (8 MSB)	Depends on M <sub>6</sub>		
Byte 4	Temperature (8 LSB)	Depends on M <sub>6</sub>		
Byte 5	Ambient light channel C measurement (8 MSB)	Depends on M₅		
Буте 5	Ambient light channel o measurement (o MSB)	+ on EN_CH_C		
Purto 6	Ambient light channel C measurement (9 L SD)	Depends on M <sub>5</sub>		
Byte 6	Ambient light channel C measurement (8 LSB)	+ on EN_CH_C		
Byte 7	Ambient light channel D measurement (8 MSB)	Depends on M <sub>5</sub>		
byte /	Ambient light channel of measurement (o MSb)	+ on EN_CH_D		
Byte 8	Ambient light channel D measurement (8 LSB)	Depends on M <sub>5</sub>		
Буге о	Ambient light channel o measurement (6 LSb)	+ on EN_CH_D		
Byte 9	not used			
Byte 10	not used			
Byte 11	DC measurement of IR channel A, before the active light burst measurement	Depends on M₄		
Бушетт	(8 MSB)	Depends on M4		
Byte 12	DC measurement of IR channel A, before the active light burst measurement	Depends on M <sub>4</sub>		
byte 12	(8 LSB)	Depends on M4		
Byte 13	DC measurement of IR channel B, before the active light burst measurement	Depends on M <sub>4</sub>		
byte 13	(8 MSB)	Depends on M4		
Byte 14	DC measurement of IR channel B, before the active light burst measurement	Depends on M <sub>4</sub>		
Dyte 14	(8LSB)			
		Depends on M₁		
Byte 15	Active light burst measurement of IR channel A (8 MSB)	+ LED selection		
		depends on M <sub>3</sub> /M <sub>2</sub>		
		Depends on M₁		
Byte 16	Active light burst measurement of IR channel A (8 LSB)	+ LED selection		
		depends on M <sub>3</sub> /M <sub>2</sub>		
		Depends on M <sub>0</sub>		
Byte 17	Active light burst measurement of IR channel B (8 MSB)	+ LED selection		
		depends on M <sub>3</sub> /M <sub>2</sub>		
_		Depends on M <sub>0</sub>		
Byte 18	Active light burst measurement of IR channel B (8 LSB)	+ LED selection		
		depends on M <sub>3</sub> /M <sub>2</sub>		
Byte 19	DC measurement of IR channel A, after the active light burst measurement (8	Depends on M <sub>4</sub>		
	MSB)  DC measurement of IR channel A, after the active light burst measurement (8			
Byte 20	, ,	Depends on M <sub>4</sub>		
	LSB)  DC measurement of IR channel B, after the active light burst measurement (8			
Byte 21	MSB)	Depends on M <sub>4</sub>		
	DC measurement of IR channel B, after the active light burst measurement (8			
Byte 22	LSB)	Depends on M <sub>4</sub>		
Byte 23	CRC (8 bit)	Output always		
Dyle 23	CICO (O DIL)	Output always		

Table 14: SM Output Data Frame

When certain measurements are disabled, the corresponding data bytes are omitted from the Output Data Frame.



## Universal Active Light Sensor Interface

#### **Cyclic Redundancy Check Calculation**

In all Output Data Frames, a CRC byte is included as last byte. This byte provides a way to detect transmission errors between slave and master. An easy method to check if there were no transmission errors is to calculate the CRC of the whole read-out frame as defined in previous tables. When the calculated CRC results in 0x00, the transmission was error free. If the resulting CRC is not equal to zero, then an error occurred in the transmission and all the data should be ignored.

For more information regarding the CRC calculation, please refer to section 7.8.





#### 7.2.2.8 SM+RO - Start Measurement combined with Read-Out

If after upload of the SM command, extra clocks are given (without putting CS high!), the data stored in the internal registers will appear on the MISO pin. At the end of the read-out phase the internal registers will be cleared to avoid memory effects in the next read-outs.

The newly uploaded SM command will be executed after the read-out, when the CS pin goes high.

The two figures below show the difference between the two modes of operation :

- Figure 9: Separated SM RO (X value is defined in Figure 6)shows the operation with separate SM and RO commands. After upload of a SM command, the measurement cycle will start and the internal registers will be filled. Once the *DR* pin is high, the RO command can be uploaded to start the read-out cycle. All data of the internal registers will be transferred and at the end of the read-out the registers(will be cleared.
- Figure 10: Combined SM RO (X value is defined in Figure 6) shows the operation with the combined SM and RO. First one has to upload a SM command to start a measurement. The data is available for read-out when the *DR* pin goes high. Instead of uploading a RO command, a SM command can be uploaded again to combine read-out and the start of the next measurement cycle. If extra clocks are given after upload of the SM command, the data of the internal registers becomes available on the *MISO* pin. Note that the *CS* pin shall not be set high until the read-out is finished. Once *CS* pin goes high, the *DR* pin is set low and a new measurement cycle will be started. A time t<sub>dr</sub> later the *DR* pin goes high to indicate that the data is available.

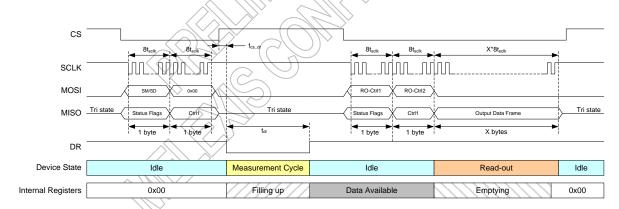


Figure 9 : Separated SM - RO (X value is defined in Figure 6)

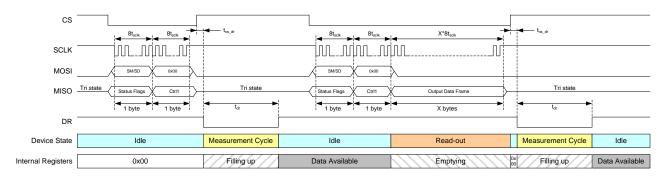


Figure 10: Combined SM - RO (X value is defined in Figure 6)

## Universal Active Light Sensor Interface

#### 7.2.2.9 WR/RR - Write/Read Register

The slave contains several user registers that can be read and written by the master. The WR and RR commands are used for that.

The WR command writes the contents of an 8-bit register addressed by bits  $A_{3..0}$  with data  $D_{7..0}$ . Data is sent to the device over the *MOSI* pin. Control2 Byte contains the 8 bit data that shall be written into the target register. Control3 Byte contains the address of the target register.

The WR command is defined in the table below:

Control1 Byte	Control2 Byte	Control3 Byte		
1000 0111	D <sub>7</sub> D <sub>6</sub> D <sub>5</sub> D <sub>4</sub> D <sub>3</sub> D <sub>2</sub> D <sub>1</sub> D <sub>0</sub> A <sub>3</sub> A <sub>2</sub> A <sub>1</sub> A <sub>0</sub> P <sub>1</sub> P <sub>0</sub> 00			
$D_7D_6D_5D_4\ D_3D_2D_1D_0\ A_3A_2A_1A_0\ P_1P_0$	Data contents of register to be written Address of target register Parity bits (P <sub>1</sub> = odd parity bit, P <sub>0</sub> = even parity bit)			
Data1 Byte	Data2 Byte	Data3 Byte		
Status Flag Byte	1000 0111	0000 0000		

Table 15: Write Register command

In order to detect some transmission errors while writing data towards the slave device, the micro-controller has to compute an odd and an even parity bit of the Control2 and the 4 MSB's of the Control3 byte and send these parity bits to the slave. The slave will check if the parity bits are valid. The data will only be written into the registers if the parity bits are correct. If the parity bits are not correct, bit 7 of the internal Status Flag Byte will be set high, indicating that the command was invalid. This can be seen when uploading a NOP command (when one is only interested in reading back the internal status flags) or during upload of the next command. In case the parity bits were not correct, the data of the registers will not be changed.

The parity bits calculation is based on the data  $D_7...D_0$  and  $A_3...A_0$ . If the number of ones in the given data set  $[D_7...D_0, A_3...A_0]$  is odd, the even parity bit  $P_0$  shall be set to 1, making the total number of ones in the set  $[D_7...D_0, A_3...A_0, P_0]$  even.

Similar: if the number of ones in the given data set  $[D_7..D_0, A_3..A_0]$  is even, the odd parity bit  $P_1$  shall be set to 1, making the total number of ones in the set  $[D_7..D_0, A_3..A_0, P_1]$  odd.

Note that the parity bits can be generated with XOR instructions:  $P_1 = XNOR(D_7..D_0, A_3..A_0)$  and  $P_0 = XOR(D_7..D_0, A_3..A_0)$ . The odd parity bit  $P_1$  should always be the inverse of the even parity bit  $P_0$ .

The RR command returns the contents of an 8-bit register addressed by bits  $A_{3..0}$ . Data is read back over the *MISO* pin. The Data1 Byte contains the Internal Status Flag byte. Data2 Byte contains the copy of the Control1 Byte. Data3 Byte contains the 8 bits of the target register.

The RR command is defined in the table below:

## Universal Active Light Sensor Interface

Control1 Byte	Control2 Byte Control3 Byte			
1000 1110	A <sub>3</sub> A <sub>2</sub> A <sub>1</sub> A <sub>0</sub> 0000 0000			
A <sub>3</sub> A <sub>2</sub> A <sub>1</sub> A <sub>0</sub>	Address of target register			
Data1 Byte	Data2 Byte Data3 Byte			
Status Flag Byte	1000 1110	D <sub>7</sub> D <sub>6</sub> D <sub>5</sub> D <sub>4</sub> D <sub>3</sub> D <sub>2</sub> D <sub>1</sub> D <sub>0</sub>		
D <sub>7</sub> <sub>0</sub>	Data contents of register read			

Table 16: Read Register command

Note that the WR and RR commands are commands that require 3 bytes instead of 2 bytes.

An overview of the user registers that can be accessed with WR/RR commands and more general information concerning the user registers can be found in section 7.4

#### 7.2.2.10 SD - Start Diagnostics

The SD command will start a measurement cycle in which internal signals will be measured and converted. With this command it is possible to test some circuits in the chip and check if they are functioning as expected.

The SD command behaves in much the same way as the SM commands: instead of uploading a SM command, a SD command can be uploaded. This starts the measurement cycle and conversion of some internal signals. The pin *DR* goes high when the cycle is completed, indicating that a read-out can be started. With the RO command it is possible to read out the data and check if all the data values are within certain ranges.

After upload of a SD command, no other commands will be accepted till *DR* is high. This is done to avoid too much disturbances in the analog part. Once *DR* is high, the next command will be accepted. An exception however is the Chip Reset command. This will always be accepted. The SD command is not available in Standby Mode.

Similar to the SM command, the SD command has some measurement selection bits M<sub>6</sub>..M<sub>0</sub> in the Control2 Byte. Different measurements can be selected with these bits:

- M<sub>6</sub>: setting this bit high enables the ADC diagnostics
- M<sub>5</sub>: setting this bit high enables the DAC-ADC diagnostics
- M<sub>4</sub>: setting this bit high enables the Ambient Diode checks
- M<sub>3</sub>..M<sub>0</sub>: (reserved)

Table 17 gives an overview of some execution times t<sub>dr</sub> for the basic types of measurements.

Measurement Type	Min. t <sub>dr</sub> (µs)	Max. t <sub>dr</sub> (μs)
ADC Diagnostics	224	249
DAC-ADC Diagnostics	91	102
Ambient Diode checks	370	410
ADC + DAC-ADC + Ambient Diode Diagnostics	680	752

Table 17: Basic Measurement Execution Times t<sub>dr</sub>

### Universal Active Light Sensor Interface

If all possible measurements are selected, the Output Data Frame is defined in the table below:

Data Byte Number	Data Byte Contents after SD command	Comments
Byte 3	ADCtest0 (8 MSB)	Depends on M <sub>6</sub>
Byte 4	ADCtest0 (8 LSB)	Depends on M <sub>6</sub>
Byte 5	ADCtest1 (8 MSB)	Depends on M <sub>6</sub>
Byte 6	ADCtest1 (8 LSB)	Depends on M <sub>6</sub>
Byte 7	ADCtest2 (8 MSB)	Depends on M <sub>6</sub>
Byte 8	ADCtest2 (8 LSB)	Depends on M <sub>6</sub>
Byte 9	ADCtest3 (8 MSB)	Depends on M <sub>6</sub>
Byte 10	ADCtest3 (8 LSB)	Depends on M <sub>6</sub>
Byte 11	ADCtest4 (8 MSB)	Depends on M <sub>6</sub>
Byte 12	ADCtest4 (8 LSB)	Depends on M <sub>6</sub>
Byte 13	DAC-ADC Test (8 MSB)	Depends on M <sub>5</sub>
Byte 14	DAC-ADC Test (8 LSB)	Depends on M <sub>5</sub>
Byte 15	00000 + CD Ambient Diodes Detection (3 bit)	Depends on M <sub>4</sub>
Byte 16	CRC (8 bit)	Output always

Table 18: SD Output Data Frame

When certain measurements are disabled, the corresponding data bytes are omitted from the Output Data Frame.

#### ADCtest0/1/2/3/4

These measurements are AD conversions of some internal reference voltages:

- ADCtest0 is typically at 1/16 of the ADC range: ADCtest0 = 0x0E00 .. 0x1200.
- ADCtest1 is typically at 1/4=4/16 of the ADC range: ADCtest1 = 0x3E00 .. 0x4200.
- ADCtest2 is typically at 3/4=12/16 of the ADC range: ADCtest2 = 0xBE00 .. 0xC200.
- ADCtest3 is typically at 15/16 of the ADC range: ADCtest3 = 0xEE00 .. 0xF200.

ADCtest4 is similar to ADCtest0/1/2/3: an AD conversion of an internal reference voltage is made. However, an independent voltage reference is used as input for the ADC in case of ADCtest4. In the case of ADCtest0/1/2/3, the reference voltages are generated from the references used for the ADC. The typical output for ADCtest4 will be at half of the ADC range: ADCtest4 = 0x7888 ... 0x89D0. These values are valid for VDD=3,3V +/-2%.

#### **DAC-ADC** test

A DAC-ADC test measurement is performed in the following way: the DAC output is connected to the ADC input. The DAC input will be DACA<7:0> from register 'SetAH'. This DAC-input will be converted to an analog output voltage that will be converted again by the ADC to give a digital value. This digital value is given in the bytes DAC-ADC Test.

#### **Ambient Diodes Detection**

During the Diagnostics measurement, the status of the external photo diodes connected to the ambient light channel inputs is checked.

Three bits CDx are output: when the bit C is set high, an error on the photo diode channel C is present. In a similar way, bit D indicate if errors on ambient light channels D is present or not.



#### 7.3 Internal Status Flags

#### Bit 7: Previous Command invalid/valid

When an uploaded command is considered invalid, bit 7 will be set high. This bit can be read out when the next command will be uploaded. If the next command is valid, bit 7 will be cleared again.

A command is considered invalid in case:

- a command is unknown (i.e. all commands that are not mentioned in Table 11)
- the parity bit in the SM or SD command is not correct
- the parity bits in a WR command are not correct
- when a command (except the CR command) was sent during a measurement cycle (i.e. after uploading a SM/SD command, when *DR* is still low)
- when a RO command was sent when *DR* is low (at any time, i.e. not only after uploading a SM/SD command)
- if a '1' is written into one of the bits of the 'Err' register
- if an ambient measurement is requested in case all bits EN\_CH\_C/EN\_CH\_D/EN\_CH\_E are zero

#### Bit 6..5: Power State, Bit 4: Sleep request, Bit 3: Standby request

The behaviour of the power state and the sleep request bits is explained in Figure 11 : Power State and Sleep Request bits.

First a RSLP command is uploaded to the sensor. As a result of that, the sensor will put the status flag bit 4 (sleep request flag) high. The master can read out that flag by uploading a NOP command, or when uploading other commands.

The master can confirm to go into sleep mode by uploading a CSLP command. The request flag will be reset and the sensor will switch into sleep state. The status flag bits 6 and 5 will be set accordingly.

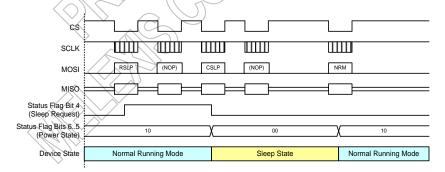


Figure 11: Power State and Sleep Request bits

To go into standby mode, the same procedure shall be applied: uploading a RSTBY command makes the request standby flag going high. Uploading a CSTBY will make the device going into standby mode, whereby the request standby flag will be cleared and the power state bits will be set accordingly.

#### Bit 2: Device in TestMode/Normal Mode

To make the sensor efficiently testable in production, several test modes are foreseen to get easy access to different blocks. The status flag bit 2 indicates if the device is operating in Test Mode or Normal Mode. If the device enters test mode by accident, the application will still work like normal. However, the status flag bit 2 will be set high. The master can take actions to get out of test mode by uploading a CR command.

#### Bit 1: Internal Oscillator is enabled/disabled

This bit is high when the internal oscillator is enabled. Once the RCO is shut down the bit will be set low.

#### Bit 0: Critical Error is detected/not detected

During each measurement cycle there is a monitoring of the voltage on critical nodes along the analog paths. When the voltage of one of these controlled nodes goes out of its normal operating range, the Critical Error Flag will be set high.



### Universal Active Light Sensor Interface

The Critical Error Flag will also be set high when a falling edge on the *WT* pin will be detected while the device is in Sleep Mode.

Following nodes are monitored:

- TIA output: when the output is clipped (either high or low), the Critical Error Flag will be set high
- Difference between DAC output and shunt-feedback
- An internal reference voltage
- Output of the common mode SC-amplifiers of the Ambient Light/Temperature Channels
- Frequency on RCO output

In case the Critical Error Flag was set high, the 'Err' register indicates which node voltages got out of their normal operating range. More info about the 'Err' register can be found in Section 7.4.7.

The Critical Error Flag remains high as long as the 'Err' register is not cleared. Once the 'Err' register is cleared, the Critical Error Flag will be cleared as well.

Note: after POR, or after wake-up from Sleep/Standby, some bits in the 'Err' register might be set. As such the Critical Error Flag might be set as well.



## Universal Active Light Sensor Interface

### 7.4 User Registers Overview

Name	Address	Bit 7	Bit 6	Bit 5	Bit 4	Bit 3	Bit 2	Bit 1	Bit 0
SetAna	0x0	Tdem3	Tdem2	Tdem1	Tdem0	LEDDRV_HG	Tdc_pulse1	Tdc_pulse0	Unity_Gain
SetAH	0x1	DACA7	DACA6	DACA5	DACA4	DACA3	DACA2	DACA1	DACA0
SetAL	0x2	GAIN_ADJ_ AA_A2	GAIN_ADJ_ AA_A1	GAIN_ADJ_ AA_A0	BW_ADJ_ AA_A2	BW_ADJ_ AA_A1	BW_ADJ_ AA_A0	BW_SEL_ LP_A1	BW_SEL_ LP_A0
SetBH	0x3	DACB7	DACB6	DACB5	DACB4	DACB3	DACB2	DACB1	DACB0
SetBL	0x4	GAIN_ADJ_ AA_B2	GAIN_ADJ_ AA_B1	GAIN_ADJ_ AA_B0	BW_ADJ_ AA_B2	BW_ADJ_ AA_B1	BW_ADJ_ AA_B0	BW_SEL_ LP_B1	BW_SEL_ LP_B0
SetPF	0x5	NP3	NP2	NP1	NP0	-	RPF2	RPF1	RPF0
Err	0x6	=	Err6	Err5	Err4	Err3	Err2	Err1	=
Rst	0x7	=	=	=		\		ТО	POR
GainBuf	0xA	=	=	=	GAIN_BUF4	GAIN_BUF3	GAIN_BUF2	GAIN_BUF1	GAIN_BUF0
Calib1	0xB	TRIM_ TC_BGI4	TRIM_ TC_BGI3	TRIM_ TC_BGI2	TRIM TC_BGI1	TRIM_ TC_BGI0	-	-	-
Calib2	0xC	-	-	TRIM_ TEMP5	TRIM_ TEMP4	TRIM_ TEMP3	TRIM_ TEMP2	TRIM_ TEMP1	TRIM_ TEMP0
EnChan	0xD	EN_TEMP	EN_DIAG_A	EN_DIAG_B	EN_CH_A	EN_CH_B	EN_CH_C	EN_CH_D	-
Tamb	0xE	-	- <	[[]]	\\\\-\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	<del>-</del>	-	Tamb1	Tamb0

In the next sections, all the bits of these registers are described. The value of the register at Power-On is indicated in the line 'Init' (0 or 1 or x=unknown) and the read/write access ability is indicated in the line 'Read/Write' (R indicates Read access, W indicates Write access).

## Universal Active Light Sensor Interface

#### 7.4.1 SetAna register

This register contains some settings of the analog chain.

	Bit	7	6	5	4	3	2	1	0
SetAna		Tdem3	Tdem2	Tdem1	Tdem0	LEDDRV_HG	Tdc_ pulse1	Tdc_ pulse0	Unity_Gain
0x0	Read/Write	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W
	Init	0	0	0	0	0	1	0	1

Tdem<3:0>: changes the demodulator delay time in the active light channel

Tdem3	Tdem2	Tdem1	Tdem0	Delay time (in µs, +/-5%)
0	0	0	\ <b>0</b> \	0
0	0	0 <	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	0.4
0	0	10	0	0.8
0	0		1 (	1.2
0	1		0	1.6
0		0	(\1\)	2
0		1		2.4
0			7	2.8
	0 (	700	0	3.2
) \ 1	0	$\bigcirc$	1	3.6
<b>1</b>	9	1	0	4
1	0	1	1	4.4
<1>)	<u></u>	0	0	4.8
1	1	0	1	5.2
1	1	1	0	5.6
1	1	1	1	6

- LEDDRV\_HG: 1 = selects high gain mode of LED driver, 0 = selects low gain mode
- Tdc\_pulse<1:0>: defines the time that the DC component in the active light pulse signal is enabled before the actual active light pulses start

Tdc_ pulse1	Tdc_ pulse0	Delay time (in µs, +/-5%)
0	0	50
0	1	100
1	0	200
1	1	400

 Unity\_Gain: only during active light measurements: 1=ADC buffer is bypassed, 0=ADC gain stage is used (gain is set with bits GAIN\_BUF<4:0> in register 'GainBuf')

## Universal Active Light Sensor Interface

#### 7.4.2 SetAH register

This register defines the DAC level for IR channel A.

	Bit	7	6	5	4	3	2	1	0
SetAH		DACA7	DACA6	DACA5	DACA4	DACA3	DACA2	DACA1	DACA0
0x1	Read/Write	R/W							
	Init	0	0	0	0	0	0	0	0

DACA<7:0>: the 8 bits of the DAC level for IR channel A

#### 7.4.3 SetAL register

This register defines the gain and cut-off frequency adjustments for IR channel A.

	Bit	7	6	5	(())4\>	3/\\	2	1	0
		GAIN_	GAIN_	GAIN	BW_	BW	> BW_	BW_	BW_
SetAL		ADJ_	ADJ_	ADJ_/	ADJ_	ADJ	ADJ_	SEL_	SEL_
		AA_A2	AA_A1	AA_A0	AA_A2	AA_A1	AA_A0	LP_A1	LP_A0
0x2	Read/Write	R/W	R/W/	\\\\\R/\\\\	R/W	) R/W	R/W	R/W	R/W
	Init	0	0(//	0	0	/ 1	1	0	1

GAIN\_ADJ\_AA\_A<2:0>: gain adjustment of anti-aliasing filter of channel A

GAIN_ADJ_ AA_A2	GAIN_ADJ_ AA_A1	GAIN_ADJ_ AA_A0	Gain	Gain (dB)
0(())	) <sub>0</sub>	J) 0	2.00	6.02
0		1	4.29	12.64
0		0	6.57	16.35
0	\$\\\J\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	1	8.86	18.95
1	0	0	11.14	20.94
1	0	1	13.43	22.56
	1	0	15.71	23.93
	1	1	18.00	25.11

BW\_ADJ\_AA\_A<2:0>: cut-off frequency adjustment of anti-aliasing filter of channel A

BW_ADJ_ AA_A2	BW_ADJ_ AA_A1	BW_ADJ_ AA_A0	3dB Cut-off Frequency (kHz)					
0	0	0	18					
0	0	1	20					
0	1	0	22.5					
0	1	1	25					
1	0	0	30					
1	0	1	35					
1	1	0	43					
1	1	1	55					

## Universal Active Light Sensor Interface

BW\_SEL\_LP\_A<1:0>: cut-off frequency selection of low-pass filter of channel A

BW_SEL_ LP_A1	BW_SEL_ LP_A0	Cut-off Frequency (%f <sub>0</sub> )	Cut-off Frequency (kHz @ f <sub>0</sub> =70kHz)
0	0	≅23.5	≅16.5
0	1	≅12	<u>≅</u> 7.8
1	0	<b>≅</b> 5.9	<u>≅</u> 4.2
1	1	≅3	<b>≅2.1</b>

#### 7.4.4 SetBH register

This register defines the DAC level for IR channel B.

	Bit	7	6	5	4	3 , '	2	1	0
SetBH		DACB7	DACB6	DACB5	DACB4	DACB3	DACB2	DACB1	DACB0
0x3	Read/Write	R/W	R/W	R/W_	(VRM)	R/W\	NR/W	R/W	R/W
	Init	0	0	9/6	0	(0)	> o	0	0

DACB<7:0>: the 8 bits of the DAC level for IR channel B

#### 7.4.5 SetBL register

This register defines the gain and cut-off frequency adjustments for IR channel B.

	Bit	7	6	5	<u>)</u> 4	3	2	1	0
		GAIN_	GAIN	GAIN	BW_	BW_	BW_	BW_	BW_
SetBL		ADJ	ADJ_C	ADJ_	ADJ_	ADJ_	ADJ_	SEL_	SEL_
		AA_B2	AA_B1	AA_B0	AA_B2	AA_B1	AA_B0	LP_B1	LP_B0
0x4	Read/Write	R/W	R/W	R/W	R/W	R/W	R/W	R/W	R/W
	Init	0	0)	0	0	1	1	0	1

GAIN\_ADJ\_AA\_B<2:0>: gain adjustment of anti-aliasing filter of channel B

	\ / 0		<u> </u>	
GAIN_ADJ_ AA_B2	GAIN_ADJ_ AA_B1	GAIN_ADJ_ AA_B0	Gain	Gain (dB)
0	0	0	2.00	6.02
0	0	1	4.29	12.64
0	1	0	6.57	16.35
0	1	1	8.86	18.95
1	0	0	11.14	20.94
1	0	1	13.43	22.56
1	1	0	15.71	23.93
1	1	1	18.00	25.11

BW\_ADJ\_AA\_B<2:0>: cut-off frequency adjustment of anti-aliasing filter of channel B

BW_ADJ_ AA_B2	BW_ADJ_ AA_B1	BW_ADJ_ AA_B0	3dB Cut-off Frequency (kHz)
0	0	0	18
0	0	1	20
0	1	0	22.5
0	1	1	25
1	0	0	30

# Universal Active Light Sensor Interface

1	0	1	35
1	1	0	43
1	1	1	55

BW\_SEL\_LP\_B<1:0>: cut-off frequency selection of low-pass filter of channel B

BW_SEL_ LP_B1	BW_SEL_ LP_B0	Cut-off Freuency (%f <sub>0</sub> )	Cut-off Frequency (kHz @ f₀=70kHz)
0	0	≅23.5	≅16.5
0	1	≅12	≅7.8
1	0	<b>≅</b> 5.9	<b>≅4.2</b>
1	1	≅3	<u></u> ≅2.1

#### 7.4.6 SetPF register

This register defines the frequency settings and the number of pulses for the active light measurements.

	Bit	7	6	5	4	3>	2	1	0	
SetPF		NP3	NP2	WP1	NP0	<b>~</b> -	RPF2	RPF1	RPF0	
0x5	Read/Write	R/W	R/W	RW	RAW	R	R/W	R/W	R/W	•
	Init	0	(1 \	0	/// 0 \	0	1	0	0	

NP<3:0>: number of pulses for the active light measurements, as defined in the table below:

Bit 3 - NP3	Bit 2 - NP2	Bit 1 - NP1	Bit 0 - NP0	Number of Pulses
0	0	)) 0	0	2
0	0	0	1	4
0 ^	0	1	0	6
0	0	1	1	8
0	1	0	0	10
0/1///	1	0	1	12
0	1	1	0	14
0	1	1	1	16
1	0	0	0	18
1	0	0	1	20
1	0	1	0	22
1	0	1	1	24
1	1	0	0	26
1	1	0	1	28
1	1	1	0	30
1	1	1	1	32

### Universal Active Light Sensor Interface

 RPF<2:0>: frequency selection of pulses for the active light measurements, as defined below:

Bit 2 - RPF2	Bit 1 - RPF1	Bit 0 - RPF0	Frequency of Pulses (in kHz, +/-5%)
0	0	0	48.1
0	0	1	52.1
0	1 0		56.8
0	1	1	62.5
1	0	0	69.4
1	1 0		78.1
1	1	0	89.3
1	1	(1)	104.2

#### 7.4.7 Err register

As described in Section 7.3 (under section 'Bit 0: Critical Error is detected/not detected'), the voltages on critical nodes are monitored continuously. When a voltage on such a critical node goes outside its operating range, the Critical Error Flag and the appropriate error bit in the 'Err' register will be set high. As such, the source of the error can be found in the 'Err' register.

The error bit remains high as long as the error condition is present, or as long as the error bit is not cleared (in case the error condition is not present anymore).

	Bit	(7)	6 \ 5	4	3	2	1	0	
Err		-\(	Err6 Err5	Err4	Err3	Err2	Err1	-	
0x6	Read/Write	R	R/W* R/W	* R/W*	R/W*	R/W*	R/W*	R	_
	Init	0	0	X**	X**	X**	0	0	

The following bits are defined (0= no error detected; 1=error is detected):

- Err<7>: not implemented, read as '0'
- Err6: critical error detected on TIA output
- Err5: critical error detected on the difference between DAC output and shunt-feedback
- Err4: critical error detected on internal voltage reference: when the internal voltage reference is below 1V.
- Err3: critical error detected on one of the common mode SC-filters of the ambient light/temperature channels
- Err2: critical error detected on RCO: either a stuck-at-high or a stuck-at-low condition occurred at the output of the RCO. Note that in SLP, the error flag on the RCO will be set high.
- Err1: set to '1' when a falling edge on the WT pin is detected while the device is in Sleep Mode
- Err<0>: not implemented, read as '0'

<sup>\*:</sup> only writing '0' is allowed. If a '1' is written, the bit value in the register will not be changed, but Bit 7 of the Internal Status Flags will be set high (Previous Command Invalid).

<sup>\*\*: &#</sup>x27;x' indicates that the value after POR is unknown. If the voltages of the nodes are out of range right after POR, it will be immediately reflected in the 'Err' register and the Critical Error Flag will be set. The same is valid after wake-up from Sleep/Standby.



### Universal Active Light Sensor Interface

#### 7.4.8 Rst register

This register allows differentiation of either a POR or a reset due to a watchdog time-out + settings for the DC light compensation circuitry.

	Bit	7	6	5	4	3	2	1	0
Rst		-	-	-	-	-	-	TO	POR
0x7	Read/Write	R/W	R/W	R/W	R/W	R	R	R	R/W
	Init	0	0	0	0	0	0	0	1

- Rst<7:2>: not implemented, read as '0'
- TO: 1=a Watchdog time-out and a master reset occurred. 0=no Watchdog time-out occurred, or after Power-On, or after a falling edge at the WT pin
- POR: 1=a POR occurred, 0=a POR has not occurred. To detect subsequent Power-On-Resets, the POR-bit shall be cleared right after Power-On.

### Universal Active Light Sensor Interface

#### 7.4.9 GainBuf register

This register contains the gain settings of the ADC input buffer. The use of this buffer is depending on bit 'Unity\_Gain' in the register 'SetAna'.

	Bit	7	6	5	4	3	2	1	0
GainBuf		-	-	1	GAIN_ BUF4	GAIN_ BUF3	GAIN_ BUF2	GAIN_ BUF1	GAIN_ BUF0
0xA	Read/Write	R	R	R	R/W	R/W	R/W	R/W	R/W
	Init	0	0	0	1	1	0	1	0

- GainBuf<7:5>: not implemented, read as '0'
- GAIN\_BUF<4:0>: defines the gain setting of the ADC input buffer

			_ \ \	^ \	
GAIN_ BUF4	GAIN_ BUF3	GAIN_ BUF2	GAIN_ BUF1	GAIN_ BUF0	Gain
0	0	0	70		> 2
0	0	0	1 ((	0	1
0	0	0	1	1	0.67
0	0	<u>)</u>	0	0	0.5
0	0	1	0	1	0.4
0<<	0	(A)	)\1	0	0.33
(0)	0		<sup>&gt;</sup> 1	1	0.29
$\bigcirc$	1	9	0	0	0.25
0		)0	0	1	0.22
0		0	1	0	0.2
1	> \( \( \)	0	0	1	10
1	0	0	1	0	5
1	0	0	1	1	3.33
1	0	1	0	0	2.5
1	0	1	0	1	2
1	0	1	1	0	1.67
1	0	1	1	1	1.43
1	1	0	0	0	1.25
1	1	0	0	1	1.11
1	1	0	1	0	1



#### 7.4.10 Calib1/Calib2 register

These registers contain the gain settings of the bandgap TC correction and the temperature sensor.

	Bit	7	6	5	4	3	2	1	0
Calib1		TRIM_ TC_BGI4	TRIM_ TC_BGI3	TRIM_ TC_BGI2	TRIM_ TC_BGI1	TRIM_ TC_BGI0	ı	ı	-
0xB	Read/Write	R	R	R	R	R	R	R	R
	Init	X	X	X	X	X	0	0	0

- TRIM\_TC\_BGI<4:0>: defines the TC correction of the bandgap current
- Calib1<2:0>: not implemented, read as '0'

The Calib1 register is used to indicate the slope of the temperature sensor curve in LSB/Kelvin. The slope is calculated out of a 2-point measurement of the temperature curve and is permanently programmed in the OTP by means of a 5-Bit word and accessible via the Calib1 register, see Errort Reference source not found..

Calib1 - T	RIM_TC_BGI				
Dec	Bin	Slope (LSB/Kelvin)			
0	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	/-51			
1		-52			
2	10	-53			
3	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	-54			
4	100	<b>-55</b>			
5	101	-56			
(6)	110	-57			
	411	-58			
8	1000	-59			
9	1001	-60			
10	1010	-61			
11	~)1011	-62			
12	1100	-63			
<<13	1101	-64			
14/	1110	-65			
15	1111	-66			
16	10000	-67			
17	10001	-68			
18	10010	-69			
19	10011	-70			
20	10100	-71			
21	10101	-72			
22	10110	-73			
23	10111	-74			
24	11000	-75			
25	11001	-76			
26	11010	-77			
27	11011	-78			
28	11100	-79			
29	11101	-80			
30	11110	-81			
31	11111	-82			

Table 19: 5-Bit temperature sensor slope information as it is stored in the calib1 register.



### Universal Active Light Sensor Interface

	Bit	7	6	5	4	3	2	1	0
Calib2		-	-	TRIM_ TEMP5	TRIM_ TEMP4	TRIM_ TEMP3	TRIM_ TEMP2	TRIM_ TEMP1	TRIM_ TEMP0
0xC	Read/Write	R	R	R	R	R	R	R	R
	Init	0	0	Х	Х	Х	Х	X	Х

- Calib2<7:6>: not implemented, read as '0'
- TRIM\_TEMP<5:0>: defines the calibration settings of the temperature sensor

The offset of the temperature curve is measured at one temperature (preferably 30deg. C) and permanently stored in the zenerzap OTP with 6 bit word length.

This information is accessible via the Calib2 register, see Table 20.

0.	Calib2 - TRIM TEMP		Slope: -67 LSB/K							
Ca	alib∠ - I Kili	/I_IEWIP		25degC			30degC			
Dec	Bin	Offset (degC)	LSL	expected	USL	\\LSL	expected	USL		
1	1	-31	10003.07	10036.51	10069.95	9668.67	9702.11	9735.55		
2	10	-30	10069.95	10103.39	10136.83	9735.55	9768.99	9802.43		
3	11	-29	10136.83	10170.27	10203.71	9802.43	9835.87	9869.31		
4	100	-28	10203.71	10237.15	10270.59	9869.31	9902.75	9936.19		
5	101	-27	10270.59	10304.03	10337.47	9936.19	9969.63	10003.07		
6	110	-26	10337.47	10370.91	10404.35	10003.07	10036.51	10069.95		
7	111	-25	10404.35	10437.79	10471.23	10069.95	10103.39	10136.83		
8	1000	-24	10471.23	10504.67	10538.11	10136.83	10170.27	10203.71		
9	1001	-23	10538.11	10571.55	10604.99	10203.71	10237.15	10270.59		
10	1010	-22	10604.99	10638.43	10671.87	10270.59	10304.03	10337.47		
11	1011	-21	10671.87	10705.31	10738.75	10337.47	10370.91	10404.35		
12	1100	-20	10738.75	10772.19	10805.63	10404.35	10437.79	10471.23		
13	1101	-19	10805.63	10839.07	10872.51	10471.23	10504.67	10538.11		
14	1110	-18	10872.51	10905.95	10939.39	10538.11	10571.55	10604.99		
15	1111	-17	10939.39	10972.83	11006.27	10604.99	10638.43	10671.87		
16	10000	-16	11006.27	11039.71	11073.15	10671.87	10705.31	10738.75		
17	10001	-15	11073.15	11106.59	11140.03	10738.75	10772.19	10805.63		
18	10010	-14	11140.03	11173.47	11206.91	10805.63	10839.07	10872.51		
19	10011	-13	11206.91	11240.35	11273.79	10872.51	10905.95	10939.39		
20	10100	-12	11273.79	11307.23	11340.67	10939.39	10972.83	11006.27		
21	10101	-11	11340.67	11374.11	11407.55	11006.27	11039.71	11073.15		
22	10110	-10	11407.55	11440.99	11474.43	11073.15	11106.59	11140.03		
23	10111	-9	11474.43	11507.87	11541.31	11140.03	11173.47	11206.91		
24	11000	-8	11541.31	11574.75	11608.19	11206.91	11240.35	11273.79		
25	11001	-7	11608.19	11641.63	11675.07	11273.79	11307.23	11340.67		
26	11010	-6	11675.07	11708.51	11741.95	11340.67	11374.11	11407.55		
27	11011	-5	11741.95	11775.39	11808.83	11407.55	11440.99	11474.43		
28	11100	-4	11808.83	11842.27	11875.71	11474.43	11507.87	11541.31		
29	11101	-3	11875.71	11909.15	11942.59	11541.31	11574.75	11608.19		
30	11110	-2	11942.59	11976.03	12009.47	11608.19	11641.63	11675.07		
31	11111	-1	12009.47	12042.91	12076.35	11675.07	11708.51	11741.95		
32	100000	0	12076.35	12109.79	12143.23	11741.95	11775.39	11808.83		
33	100001	1	12143.23	12176.67	12210.11	11808.83	11842.27	11875.71		
34	100010	2	12210.11	12243.55	12276.99	11875.71	11909.15	11942.59		
35	100011	3	12276.99	12310.43	12343.87	11942.59	11976.03	12009.47		



# Universal Active Light Sensor Interface

36	100100	4	12343.87	12377.31	12410.75	12009.47	12042.91	12076.35
37	100101	5	12410.75	12444.19	12477.63	12076.35	12109.79	12143.23
38	100110	6	12477.63	12511.07	12544.51	12143.23	12176.67	12210.11
39	100111	7	12544.51	12577.95	12611.39	12210.11	12243.55	12276.99
40	101000	8	12611.39	12644.83	12678.27	12276.99	12310.43	12343.87
41	101001	9	12678.27	12711.71	12745.15	12343.87	12377.31	12410.75
42	101010	10	12745.15	12778.59	12812.03	12410.75	12444.19	12477.63
43	101011	11	12812.03	12845.47	12878.91	12477.63	12511.07	12544.51
44	101100	12	12878.91	12912.35	12945.79	12544.51	12577.95	12611.39
45	101101	13	12945.79	12979.23	13012.67	12611.39	12644.83	12678.27
46	101110	14	13012.67	13046.11	13079.55	12678.27	12711.71	12745.15
47	101111	15	13079.55	13112.99	13146.43	12745.15	12778.59	12812.03
48	110000	16	13146.43	13179.87	13213.31	12812.03	12845.47	12878.91
49	110001	17	13213.31	13246.75	13280.19	12878.91	12912.35	12945.79
50	110010	18	13280.19	13313.63	13347.07	12945.79	12979.23	13012.67
51	110011	19	13347.07	13380.51	13413.95	13012.67	13046.11	13079.55
52	110100	20	13413.95	13447.39	13480.83	13079.55	13112.99	13146.43
53	110101	21	13480.83	13514.27	13547.71	13146.43	13179.87	13213.31
54	110110	22	13547.71	13581.15	13614.59	13213.31	13246.75	13280.19
55	110111	23	13614.59	13648.03	13681.47	13280.19	13313.63	13347.07
56	111000	24	13681.47	13714.91	13748.35	13347.07	13380.51	13413.95
57	111001	25	13748.35	13781.79	13815.23	13413.95	13447.39	13480.83
58	111010	26	13815.23	13848.67	13882.11	13480.83	13514.27	13547.71
59	111011	27	13882.11	13915.55	13948.99	13547.71	13581.15	13614.59
60	111100	28	13948.99	13982.43	14015.87	13614.59	13648.03	13681.47
61	111101	29	14015.87	14049.31	14082.75	13681.47	13714.91	13748.35
62	111110	30	14082.75	14116.19	14149.63	13748.35	13781.79	13815.23
63	111111	31	14149.63	14183.07	14216.51	13815.23	13848.67	13882.11
		/ / . \ / )						



# Universal Active Light Sensor Interface

0-				Slope: -67 LSB/K								
Ca	ilib2 - TRIN	М_ТЕМР		85degC	105degC							
Dec	Bin	Offset (degC)	LSL	expected	USL	LSL	expected	USL				
1	1	-31	5990.27	6023.71	6057.15	4652.67	4686.11	4719.55				
2	10	-30	6057.15	6090.59	6124.03	4719.55	4752.99	4786.43				
3	11	-29	6124.03	6157.47	6190.91	4786.43	4819.87	4853.31				
4	100	-28	6190.91	6224.35	6257.79	4853.31	4886.75	4920.19				
5	101	-27	6257.79	6291.23	6324.67	4920.19	4953.63	4987.07				
6	110	-26	6324.67	6358.11	6391.55	4987.07	5020.51	5053.95				
7	111	-25	6391.55	6424.99	6458.43	5053.95	5087.39	5120.83				
8	1000	-24	6458.43	6491.87	6525.31	5120.83	5154.27	5187.71				
9	1001	-23	6525.31	6558.75	6592.19 〈	5187.71	5221.15	5254.59				
10	1010	-22	6592.19	6625.63	6659.07	5254.59	5288.03	5321.47				
11	1011	-21	6659.07	6692.51	6725.95	5321.47	5354.91	5388.35				
12	1100	-20	6725.95	6759.39	6792.83	5388.35	5421.79	5455.23				
13	1101	-19	6792.83	6826.27	6859.71	5455.23	5488.67	5522.11				
14	1110	-18	6859.71	6893.15	6926.59	5522.11	5555.55	5588.99				
15	1111	-17	6926.59	6960.03	6993.47	5588.99	5622.43	5655.87				
16	10000	-16	6993.47	7026.91	7060.35	5655.87	5689.31	5722.75				
17	10001	-15	7060.35	7093.79	7127.23	5722.75	5756.19	5789.63				
18	10010	-14	7127.23	7160.67	7194.11	5789.63	5823.07	5856.51				
19	10011	-13	7194.11	7227.55	7260.99	5856.51	5889.95	5923.39				
20	10100	(-12)	7260.99	7294.43	7327.87	5923.39	5956.83	5990.27				
21	10101	-11	7327.87	7361.31	7394.75	5990.27	6023.71	6057.15				
22	10110	-10	7394.75	7428.19	7461.63	6057.15	6090.59	6124.03				
23	10111	-9 //	7461.63	7495.07	7528.51	6124.03	6157.47	6190.91				
24	11000	-8	7528.51	7561.95	7595.39	6190.91	6224.35	6257.79				
25	11001	-7	7595.39	7628.83	7662.27	6257.79	6291.23	6324.67				
26	11010	-6	7662.27	7695.71	7729.15	6324.67	6358.11	6391.55				
27	11011	-5	7729.15	7762.59	7796.03	6391.55	6424.99	6458.43				
28	11100	-4	7796.03	7829.47	7862.91	6458.43	6491.87	6525.31				
29	11101	-3	7862.91	7896.35	7929.79	6525.31	6558.75	6592.19				
30	11110	-2	7929.79	7963.23	7996.67	6592.19	6625.63	6659.07				
31	11111	-1	7996.67	8030.11	8063.55	6659.07	6692.51	6725.95				
32	100000	0	8063.55	8096.99	8130.43	6725.95	6759.39	6792.83				
33	100001	1	8130.43	8163.87	8197.31	6792.83	6826.27	6859.71				
34	100010	2	8197.31	8230.75	8264.19	6859.71	6893.15	6926.59				
35	100011	3	8264.19	8297.63	8331.07	6926.59	6960.03	6993.47				
36	100100	4	8331.07	8364.51	8397.95	6993.47	7026.91	7060.35				
37	100101	5	8397.95	8431.39	8464.83	7060.35	7093.79	7127.23				
38	100110	6	8464.83	8498.27	8531.71	7127.23	7160.67	7194.11				
39	100111	7	8531.71	8565.15	8598.59	7194.11	7227.55	7260.99				
40	101000	8	8598.59	8632.03	8665.47	7260.99	7294.43	7327.87				
41	101001	9	8665.47	8698.91	8732.35	7327.87	7361.31	7394.75				
42	101010	10	8732.35	8765.79	8799.23	7394.75	7428.19	7461.63				
43	101011	11	8799.23	8832.67	8866.11	7461.63	7495.07	7528.51				
44	101100	12	8866.11	8899.55	8932.99	7528.51	7561.95	7595.39				
45	101101	13	8932.99	8966.43	8999.87	7595.39	7628.83	7662.27				

### Universal Active Light Sensor Interface

46	101110	14	8999.87	9033.31	9066.75	7662.27	7695.71	7729.15
47	101111	15	9066.75	9100.19	9133.63	7729.15	7762.59	7796.03
48	110000	16	9133.63	9167.07	9200.51	7796.03	7829.47	7862.91
49	110001	17	9200.51	9233.95	9267.39	7862.91	7896.35	7929.79
50	110010	18	9267.39	9300.83	9334.27	7929.79	7963.23	7996.67
51	110011	19	9334.27	9367.71	9401.15	7996.67	8030.11	8063.55
52	110100	20	9401.15	9434.59	9468.03	8063.55	8096.99	8130.43
53	110101	21	9468.03	9501.47	9534.91	8130.43	8163.87	8197.31
54	110110	22	9534.91	9568.35	9601.79	8197.31	8230.75	8264.19
55	110111	23	9601.79	9635.23	9668.67	8264.19	8297.63	8331.07
56	111000	24	9668.67	9702.11	9735.55	8331.07	8364.51	8397.95
57	111001	25	9735.55	9768.99	9802.43	8397.95	8431.39	8464.83
58	111010	26	9802.43	9835.87	9869.31	8464.83	8498.27	8531.71
59	111011	27	9869.31	9902.75	9936.19	8531.71	8565.15	8598.59
60	111100	28	9936.19	9969.63	10003.07	8598.59	8632.03	8665.47
61	111101	29	10003.07	10036.51	10069.95	8665.47	8698.91	8732.35
62	111110	30	10069.95	10103.39	10136.83	8732.35	8765.79	8799.23
63	111111	31	10136.83	10170,27	10203.71	8799.23	8832.67	8866.11

Table 20: 6-Bit Temperature curve offset information for a typical slope of -67 LSB/K.

#### 7.4.11 EnChan register

This register contains bit to enable/disable active light and ambient light channels.

	Bit	7	6	5	4	3	2	1	0	
EnChan		EN_ TEMP	EN_ DIAG_A	EN_ DIAG_B	EN_ CH_A	EN_ CH_B	EN_ CH_C	EN_ CH_D	ı	
0xD	Read/Write	RAW	R/W	R/W	R/W	R/W	R/W	R/W	R	_
	Init (		1	1	1			1	1	

- EN\_TEMR: I = temperature channel is in use, 0 = temperature channel is not in use
- EN DIAG A: 1 = enables diagnostics on active light channel A, 0 = disables the diagnostics
- EN\_DIAG\_B: 1 = enables diagnostics on active light channel B, 0 = disables the diagnostics
- EN\_CH\_A: 1 = active light channel A is enabled (TIA + Demodulator + Anti-Aliasing Filter + SC-LPF), 0 = active light channel A is completely switched off to reduce current consumption
- EN\_CH\_B: 1 = active light channel B is enabled (TIA + Demodulator + Anti-Aliasing Filter + SC-LPF), 0 = active light channel B is completely switched off to reduce current consumption
- EN\_CH\_C: 1 = ambient light channel C is in use, 0 = ambient light channel C is not in use
- EN CH D: 1 = ambient light channel D is in use, 0 = ambient light channel D is not in use

The bits EN\_CH\_A/EN\_CH\_B can be used to switch off channels that are not needed, and thus reducing the current consumption.

When going into Sleep or Standby the setting of these bits is ignored, all channels will be switched off independently of EN\_CH\_A/EN\_CH\_B.

The bits EN\_TEMP/EN\_CH\_C/EN\_CH\_D are used to indicate which channels are in use and which channels are not in use.

In case all EN\_CH\_C/D bits are set to zero, but an ambient measurement is requested, then the Command Invalid status flag will be set high. The measurement itself will not be executed.

# Universal Active Light Sensor Interface

#### 7.4.12 Tamb register

This register contains settings for the DC light compensation circuitry + controls the repetition rate of the auto-zero timer.

	Bit	7	6	5	4	3	2	1	0
Tamb		-	-	-	-	-	-	Tamb1	Tamb0
0xE	Read/Write	R/W	R/W	R/W	R/W	R	R	R/W	R/W
	Init	0	0	0	0	0	0	1	0

- Tamb<7:2>: not implemented, read as '0'
- Tamb<1:0>: controls the repetition rate of the auto-zero timer

Tamb1	Tamb0	Repetition Rate (ms +/-5%)
0	0 <	1,25
0	1	2.5
1	0	5
1 <		10

### Universal Active Light Sensor Interface

#### 7.5 Window Watchdog Timer

The internal watchdog timer is a watchdog based on two different windows: an open and a closed window. During the open window the master can restart the watchdog timer. During the closed window, no restarts are accepted.

The restart (re-initialisation) of the watchdog timer happens via the WT (Watchdog Trigger) pin: when a falling edge is detected on the WT pin, the watchdog will be restarted.

The low time on the WT pin should be at least a time  $t_{wt}$ .

After a POR or a reset issued by the watchdog and after a wake-up from Sleep Mode (either by uploading the NRM command, or by using the  $WAKE\_UP$  pin), the window watchdog will open an active window of a time  $t_{wdt\_init}$ , during which a watchdog restart must be issued by the  $\mu$ C. If no watchdog restart is received by the end of the open window, the  $\mu$ C will be reset.

After this initial period, the window watchdog is programmed to wait a time t<sub>wdt\_closed</sub> during which no watchdog restarts are allowed. If a watchdog restart is sent during the closed window time, the watchdog will reset the master via the *MR* (Master Reset) pin.

After a closed window, an open window of a time  $t_{wdt}$  open will follow during which a watchdog restart is expected. If no watchdog restart is received till the end of the open window, the  $\mu$ C will be reset via the MR pin.

Changing mode between Normal Running Mode and Standby Mode will not influence the watchdog timing or state. Also a CR command will not change the used window times. The watchdog counter will not be influenced when changing mode between NRM and STBY or when uploading a CR command.

The Watch Dog Timer is disabled in Sleep Mode. A falling edge on the *WT* pin in the Sleep Mode will set an error flag in the register 'Err'. Coming back from Sleep Mode to Normal Running Mode always restarts the watchdog with the initial timing window.

This figure shows what timing windows are used in the different operating modes:

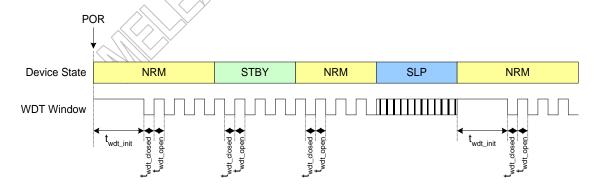


Figure 12: Window times during different operating modes

The two diagrams below show the functionality of the watchdog timer:

### Universal Active Light Sensor Interface

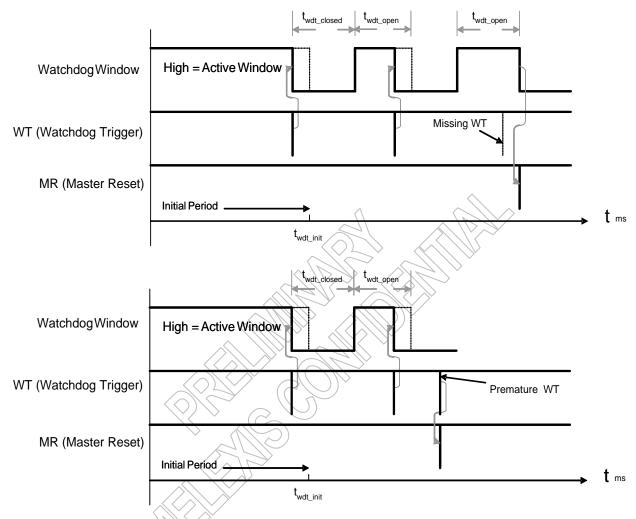


Figure 13: Functionality of the window watchdog timer

A reset of the  $\mu$ C due to time-out of the watchdog is achieved by setting the MR pin low during a time  $t_{MR}$  (default state of the MR pin is high).

When the device is operating in Sleep or Standby Mode, the  $WAKE\_UP$  pin will be monitored. When a falling edge is detected on that pin, the device will switch to Normal Running Mode and, when waking up from Sleep Mode, the Watchdog Timer will be started (with an initial window time of  $t_{wdt\_init}$ ).

Note that no pull-up or pull-down resistor is foreseen on the  $WAKE\_UP$  pin. To avoid that parasitic spikes can wake up the device, the  $WAKE\_UP$  input is debounced (typical debounce time is in the range of 2µs). The low time on the  $WAKE\_UP$  pin should be at least a time  $t_{wu\_l}$ .



### Universal Active Light Sensor Interface

#### 7.6 Reset Behaviour

#### **Power-On Reset**

After a Power-On Reset, the device is operating in Normal Running Mode. All internal data registers are set to their initial state:

- the device state is Normal Running Mode
- the Watchdog counter is initialized to generate the initial window time
- all registers containing (diagnostic) measurement data are initialized to 0x00
- bits 7, 4, 3 of the Internal Status Flags are cleared
- the user settings registers are set to their initial values (see Section 7.4)
- the 'Err' register will initialize to 0x00. However, as some voltages are continuously measured, it will reflect immediately if an error is detected or not.

The MR pin will be initialized to '1'. The DR pin will be initialized to '0', but after the time  $t_{\text{startup}}$  it will switch to '1' to indicate that the device is ready to accept the first command (see also Section 7.9).

The output of the *MISO* pin is depending on the *CS* state: if *CS* is high, the *MISO* pin is in tri-state. If *CS* is low, the output of the *MISO* pin is undefined.

#### **CR Command**

At every upload of the CR command, the device returns to the state like it is after a Power-On-Reset, except for the Watchdog counter and the state of the *MR* line. The Watchdog counter and the state of the *MR* line will not be influenced by uploading a CR command. Also, the CR command will not change the contents of the 'Rst' register.

After a CR command the DR pin will be kept low during a time t<sub>startup</sub>.

#### Read-out

At the end of each read-out, all registers containing (diagnostic) measurement data are cleared to 0x00.

#### Watchdog time-out

When a reset occurs due to a watchdog time-out, the *MR* pin will go low for a time t<sub>MR</sub>. The Watchdog counter will be initialized with the window time t<sub>wdt\_init</sub>. All other states, lines and registers of the ASIC will not be affected.

#### Changing operation mode

When changing operation mode (RSLP, CSLP, RSTBY, CSTBY, NRM) the right status flags are set. Changing operation mode will not affect the user settings registers and the (diagnostic) measurement data registers.

The DR pin will be set to '0' and after the time  $t_{wakeup\_slp}$  resp.  $t_{wakeup\_stby}$  it will be set to '1', when waking up from Sleep resp. Standby Mode.



#### 7.7 Wake-up from Sleep or Standby

The figure below shows what happens when switching operation mode, and the behaviour of the *DR* pin and the watchdog timer.

The WAKE\_UP pin is only monitored during Sleep and Standby. When a falling edge is detected during Sleep or Standby, the following will happen:

- the *DR* pin goes low for a time t<sub>wakeup\_stby</sub> or t<sub>wakeup\_stp</sub>
- the watchdog timer is initialised and starts counting, when waking up from Sleep
- the device changes to Normal Running Mode, enabling the appropriate blocks

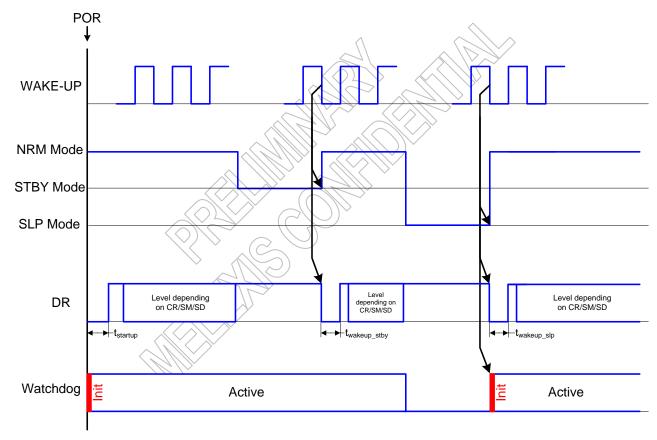


Figure 14: Behaviour of DR and Watchdog when switching mode



#### 7.8 CRC Calculation

The 8-bit CRC calculation will be based on the polynomial  $x^8 + x^2 + x^1 + x^0$ . This polynomial is widely used in the industry, it is e.g. used for generating:

- the Header Error Correction field in ATM (Asynchronous Transfer Mode) cells
- the Packet Error Code in SMBus data packets

Some probabilities of detecting errors when using this polynomial:

- 100% detection of one bit errors
- 100% detection of double bit errors (adjacent bits)
- 100% detection of two single-bit errors for frames less than 128 bits in length
- 100% detection of any odd number of bits in error
- 100% detection of burst errors up to 8 bits
- 99.61% detection of any random error

A possible hardware implementation using a Linear Feedback Shift Register (LFSR) is shown in the figure below:

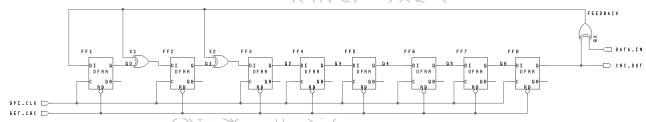


Figure 14: 8-bit CRC implementation using a LFSR

The generation of the CRC requires the following steps:

- Reset all flip-flops
- 0x00 is the initial value, shifting in all zeroes does not affect the CRC
- Shift in the read-out data bytes. First byte is Data Byte 1 (= Internal Status Flags), last byte is Data Byte (X+1) (with X defined in Figure 8).
- When the last byte has been shifted in, the flip-flops contain the CRC: CRC=FF[8..1].

An easy method to check if there were no transmission errors is to calculate the CRC of the whole read-out data stream including the CRC Byte. When the calculated CRC results in 0x00, the transmission was most likely error free. If the resulting CRC is not equal to zero, then an error occurred in the transmission and the complete data stream should be ignored.

Some CRC results for example messages are given in Table 21.

ASCII String messages	CRC result
-None-	0x00
"A"	0xC0
"123456789"	0xF4
a string of 256 upper case "A" characters with no line breaks	0x8E
A Characters with the line bleaks	

Table 21: CRC examples



#### 7.9 Global Timing Diagrams

A global timing diagram with separate SM-RO cycles is given in Figure 15. After power-up there is a Power-On-Reset phase (POR) to initialize the sensor into a reset state. When the device is ready to accept the first command, the *DR* pin goes high. In Figure 15 the first command is the WR command to define the contents of the user registers (optionally). The first measurement cycle is e.g. initiated by uploading a SM command. After completion of the measurement cycle, the *DR* goes high. This indicates that the read-out cycle can be started. A RO command has to be uploaded to bring the data on the *MISO* pin. When the read-out is completed, a new measurement cycle can be started. In Figure 15 a SM command is used. This starts a next measurement cycle. Once *DR* is high, a read-out can be done again.

In between different Measurement/Read-Out cycles, the user registers can be changed with WR commands. Optionally those registers can be read back with the RR command to check if the right values were uploaded.

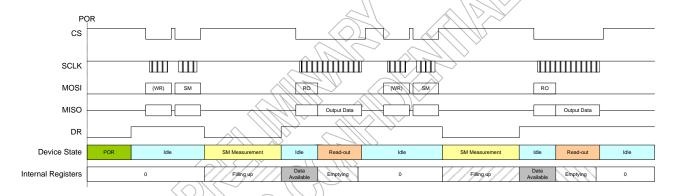


Figure 15: Global timing diagram with separate SM-RO

Figure 16 shows a timing diagram wherein separate SM-RO cycles are mixed with combined SM-RO cycles. After the Power-On-Reset phase, a SM measurement cycle is started. Once the *DR* pin is high, the data can be read out. A SM command with extra clocks is used to combine the read-out and the start of the next measurement cycle. With the extra clocks, the data of the internal registers is transferred to the *MISO* pin. When the *CS* pin goes high, the next measurement cycle (SM) will be started.

Once the *DR* pin is high, a normal RO command is uploaded to bring the data to the *MISO* pin. If needed, the settings in the user registers can be changed with the WR command and optionally the RR command can be used to check if the right values were uploaded.

A new measurement cycle can be started with e.g. a normal SM command. When the DR pin is high, the data can be transferred by uploading e.g. a SM command that combines the read-out and the start of a new measurement cycle.

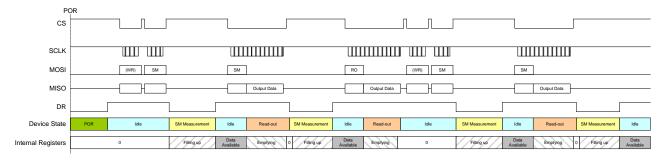



Figure 16: Global timing diagram with separate SM-RO and combined SM-RO together




### Universal Active Light Sensor Interface

## 8 Performance Graphs


#### 8.1 LED Channel DC Measurement

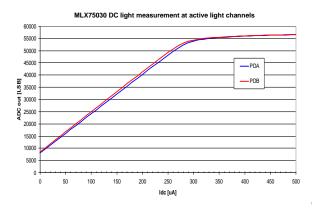


#### 8.2 Temperature Sensor Characteristics

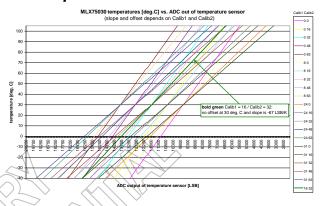

### 8.3 Ambient Light Channel C

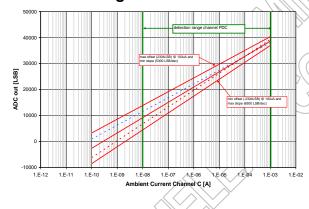


#### 8.4 Ambient Light Channel D

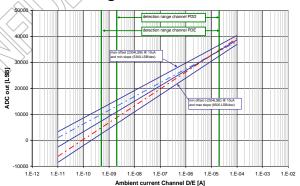



# 9 Application Information

#### 9.1 Application circuit for typ. active light channel and two ambient channels

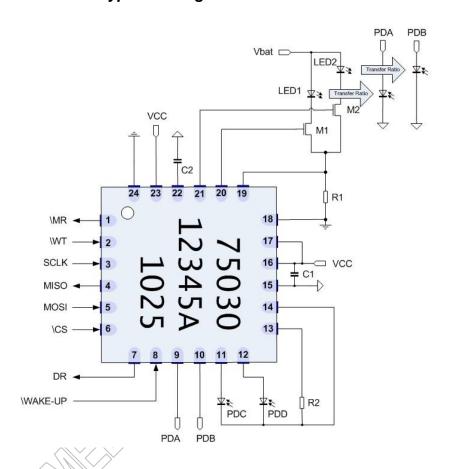

Component	Type	Value	Description
C1	SMD capacitor	47nF	Blocking capacitor, connected to analog GND
C2	SMD capacitor	68nF	Blocking capacitor for int. voltage regulator, connected to analog GND
R1	SMD resistor	6.4 Ohms	Shunt Resistor
R2	SMD resistor	56k Ohms	Ambient Light Diagnosis termination resistor
M1			LED driver MOSFET
M2			LED driver MOSFET
LED1/2			Active light channel Infrared LED
PDA / PDB			Active light channel infrared photodiode, daylight blocking mold
PDC			V-lambda photodiode
PDD			Photodiode

Table 22: Application circuit components for on ambient channel disabled (but used for additional diagnosis)



### Universal Active Light Sensor Interface

### 10 Application Comments

The MLX75030 is featuring very sensitive current inputs on the pins 9 and 10 for active light detection and on the pins 11 and 12 for ambient light measurements in a range over several orders of magnitude. In order to achive optimum results in the application it is recommended to consider the following hints for the design of the PCB:

- 1. The both supply voltage pins 16 (VDDA for analog circuit parts) and 23 (VDDD for digital circuit parts) shall be star-connected to the local (external) regulator output (3.0V-3.6V) in order to avoid digital disturbance injection into the analog supply.
- 2. Note that the device works with two separate ground connections: Pin 15 works as analog ground for the sensitive input circuitry whereas pin 24 works as digital ground and as ground connection of the LED path, which carries high pulse currents.
- 3. The Exposed Pad of the package should be star-connected to the local (external) ground pin of the regulator.
- 4. The external blocking capacitors C1 and C2 shall be placed as close as possible to the corresponding pins of the device.
- 5. The external photodiodes on the active light channel inputs as well as on the ambient light inputs shall be placed as close as possible to the corresponding pins of the device. If this is not possible due to constructive reasons, the connections shall be shielded by a noise-free analog ground plane in order to avoid performance-loss due to disturbance coupling.



### Universal Active Light Sensor Interface

# 11 Standard information regarding manufacturability of Melexis products with different soldering processes

Our products are classified and qualified regarding soldering technology, solderability and moisture sensitivity level according to following test methods:

#### Reflow Soldering SMD's (Surface Mount Devices)

- IPC/JEDEC J-STD-020
   Moisture/Reflow Sensitivity Classification for Nonhermetic Solid State Surface Mount Devices (classification reflow profiles according to table 5-2)
- EIA/JEDEC JESD22-A113
   Preconditioning of Nonhermetic Surface Mount Devices Prior to Reliability Testing (reflow profiles according to table 2)

#### Wave Soldering SMD's (Surface Mount Devices) and THD's (Through Hole Devices)

- EN60749-20
  - Resistance of plastic- encapsulated SMD's to combined effect of moisture and soldering heat
- EIA/JEDEC JESD22-B106 and EN60749-15
   Resistance to soldering temperature for through-hole mounted devices

#### Iron Soldering THD's (Through Hole Devices)

EN60749-15
 Resistance to soldering temperature for through-hole mounted devices

#### Solderability SMD's (Surface Mount Devices) and THD's (Through Hole Devices)

 EIA/JEDEC JESD22-B102 and EN60749-21 Solderability

For all soldering technologies deviating from above mentioned standard conditions (regarding peak temperature, temperature gradient, temperature profile etc) additional classification and qualification tests have to be agreed upon with Melexis.


The application of Wave Soldering for SMD's is allowed only after consulting Melexis regarding assurance of adhesive strength between device and board.

Melexis is contributing to global environmental conservation by promoting **lead free** solutions. For more information on qualifications of **RoHS** compliant products (RoHS = European directive on the Restriction Of the use of certain Hazardous Substances) please visit the quality page on our website: <a href="http://www.melexis.com/quality.asp">http://www.melexis.com/quality.asp</a>

#### 12 ESD Precautions

Electronic semiconductor products are sensitive to Electro Static Discharge (ESD). Always observe Electro Static Discharge control procedures whenever handling semiconductor products.

# 13 Package Information

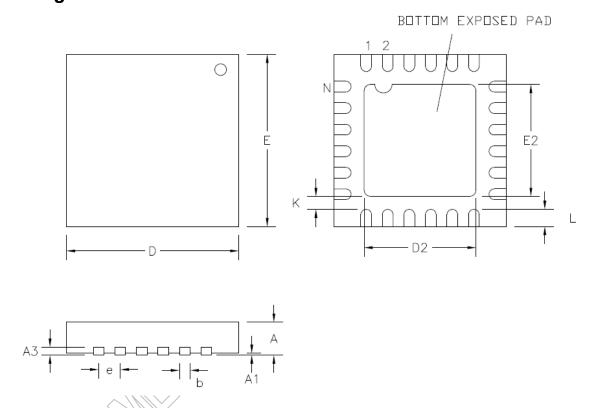

	DxE	N	е		А	A1	A3	D2	E2	L	K	b
		All dimensions in mm										
Quad	4 × 4	24	0.50 .0.05	min	0.80	0.00	0.20	2.50	2.50	0.35	0.20	0.18
	4 x 4	24	0.50 ±0.05	max	1.00	0.05	REF	2.70	2.70	0.45	_	0.30

Table 23: Package dimensions

Package	Θjc [°C/W]	Θja [°C/W] (JEDEC 1s0p board)	Oja [°C/W] (JEDEC 1s2p board)
QFN 4x4 16		154	50

Table 24: 9JA values



### Universal Active Light Sensor Interface

#### 14 Disclaimer

Devices sold by Melexis are covered by the warranty and patent indemnification provisions appearing in its Term of Sale. Melexis makes no warranty, express, statutory, implied, or by description regarding the information set forth herein or regarding the freedom of the described devices from patent infringement. Melexis reserves the right to change specifications and prices at any time and without notice. Therefore, prior to designing this product into a system, it is necessary to check with Melexis for current information. This product is intended for use in normal commercial applications. Applications requiring extended temperature range, unusual environmental requirements, or high reliability applications, such as military, medical lifesupport or life-sustaining equipment are specifically not recommended without additional processing by Melexis for each application.

The information furnished by Melexis is believed to be correct and accurate. However, Melexis shall not be liable to recipient or any third party for any damages, including but not limited to personal injury, property damage, loss of profits, loss of use, interrupt of business or indirect, special incidental or consequential damages, of any kind, in connection with or arising out of the furnishing, performance or use of the technical data herein. No obligation or liability to recipient or any third party shall arise or flow out of Melexis' rendering of technical or other services.



For the latest version of this document, go to our website at www.melexis.com

Or for additional information contact Melexis Direct:

Europe, Africa, Asia: Phone: +32 1367 0495 E-mail: sales\_europe@melexis.com

America:
Phone: +1 603 223 2362
E-mail: sales\_usa@melexis.com

ISO/TS 16949 and ISO14001 Certified