

---

# PF0310A

MOS FET Power Amplifier Module for VHF Band

# HITACHI

ADE-208-315A (Z)  
2nd. Edition  
July 1996


---

## Features

- Small package:  $30 \times 10 \times 5.9$  mm
- High efficiency: 55% Typ
- Low power control current: 0.5 mA Max

## Pin Arrangement


• RF-J

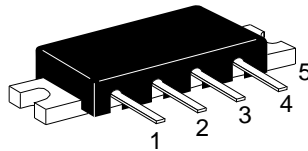

- 1: Pin
- 2:  $V_{PC}$
- 3:  $V_{DD}$
- 4: Pout
- 5: GND (Flange)

# PF0310A

## Internal Diagram and External Circuit

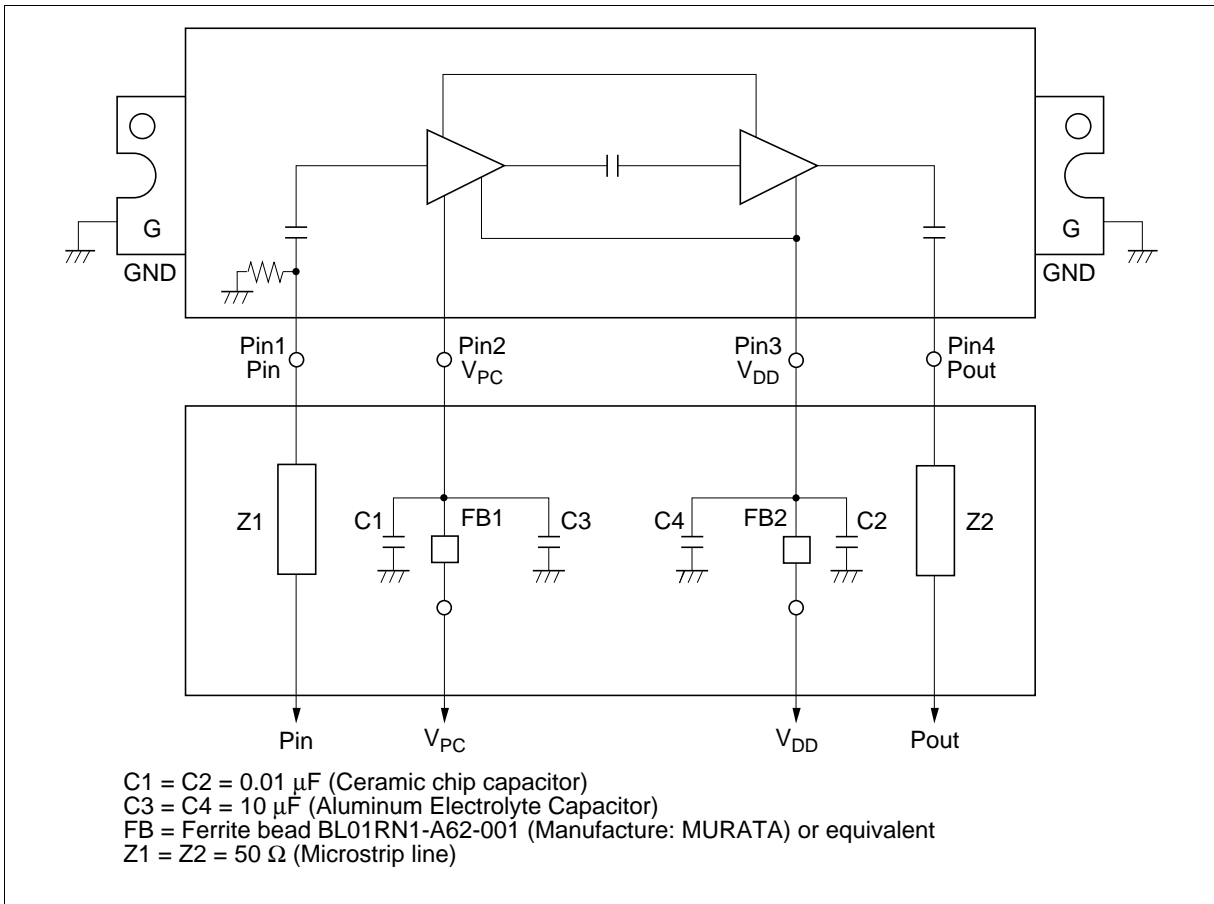


### Absolute Maximum Ratings ( $T_c = 25^\circ\text{C}$ )

Item	Symbol	Rating	Unit
Supply voltage	$V_{DD}$	17	V
Supply current	$I_{DD}$	3	A
PC voltage	$V_{PC}$	4.5	V
Input power	Pin	100	mW
Operating case temperature	$T_c$ (op)	-30 to +100	$^\circ\text{C}$
Storage temperature	$T_{stg}$	-40 to +110	$^\circ\text{C}$


**Electrical Characteristics** ( $T_c = 25^\circ\text{C}$ )



Item	Symbol	Min	Typ	Max	Unit	Test Condition
Frequency range	f	136	—	150	MHz	—
Drain cutoff current	$I_{DS}$	—	—	100	$\mu\text{A}$	$V_{DD} = 17\text{ V}, V_{PC} = 0\text{ V}$
Total efficiency	$\eta_T$	45	55	—	%	$P_{in} = 20\text{ mW}, V_{DD} = 9.6\text{ V},$ $P_{out} = 7\text{ W}$ (at $V_{PC}$ controlled), $R_L = R_g = 50\ \Omega, T_c = 25^\circ\text{C}$
2nd harmonic distortion	2nd H.D.	—	-25	-20	dBc	
3rd harmonic distortion	3rd H.D.	—	-35	-30	dBc	
4th harmonic distortion	4rd H.D.	—	-40	-30	dBc	
Input VSWR	VSWR (in)	—	1.5	3.0	—	
Output VSWR	VSWR (out)	—	1.5	—	—	
Output power (1)	$P_{out}$ (1)	7	9	—	W	$P_{in} = 20\text{ mW}, V_{DD} = 9.6\text{ V},$ $V_{PC} = 4\text{ V}, R_L = R_g = 50\ \Omega$
Output power (2)	$P_{out}$ (2)	2.5	3.5	—	W	$P_{in} = 20\text{ mW}, V_{DD} = 6\text{ V},$ $V_{PC} = 3.7\text{ V}, R_L = R_g = 50\ \Omega$
Load VSWR tolerance	—	No degradation			—	$P_{in} = 20\text{ mW}, V_{DD} = 15\text{ V},$ $P_{out} \leq 7\text{ W}$ , (at $V_{PC}$ controlled), Output VSWR = 6:1 All phases
Stability	—	No parasitic oscillation			—	$P_{in} = 20\text{ mW}, V_{DD} = 6\text{ to }15\text{ V},$ $P_{out} \leq 7\text{ W}$ , (at $V_{PC}$ controlled), Output VSWR = 3:1 All phases



**Mechanical Characteristics**


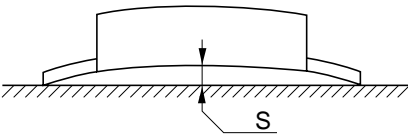
Item	Conditions	Spec
Torque for screw up the heatsink flange	M2.6 Screw Bolts	1.5 to 3.5 kg $\cdot$ cm
Warp size of the heatsink flange: S		S = 0 +0.1/-0 mm



**Characteristics Curve**

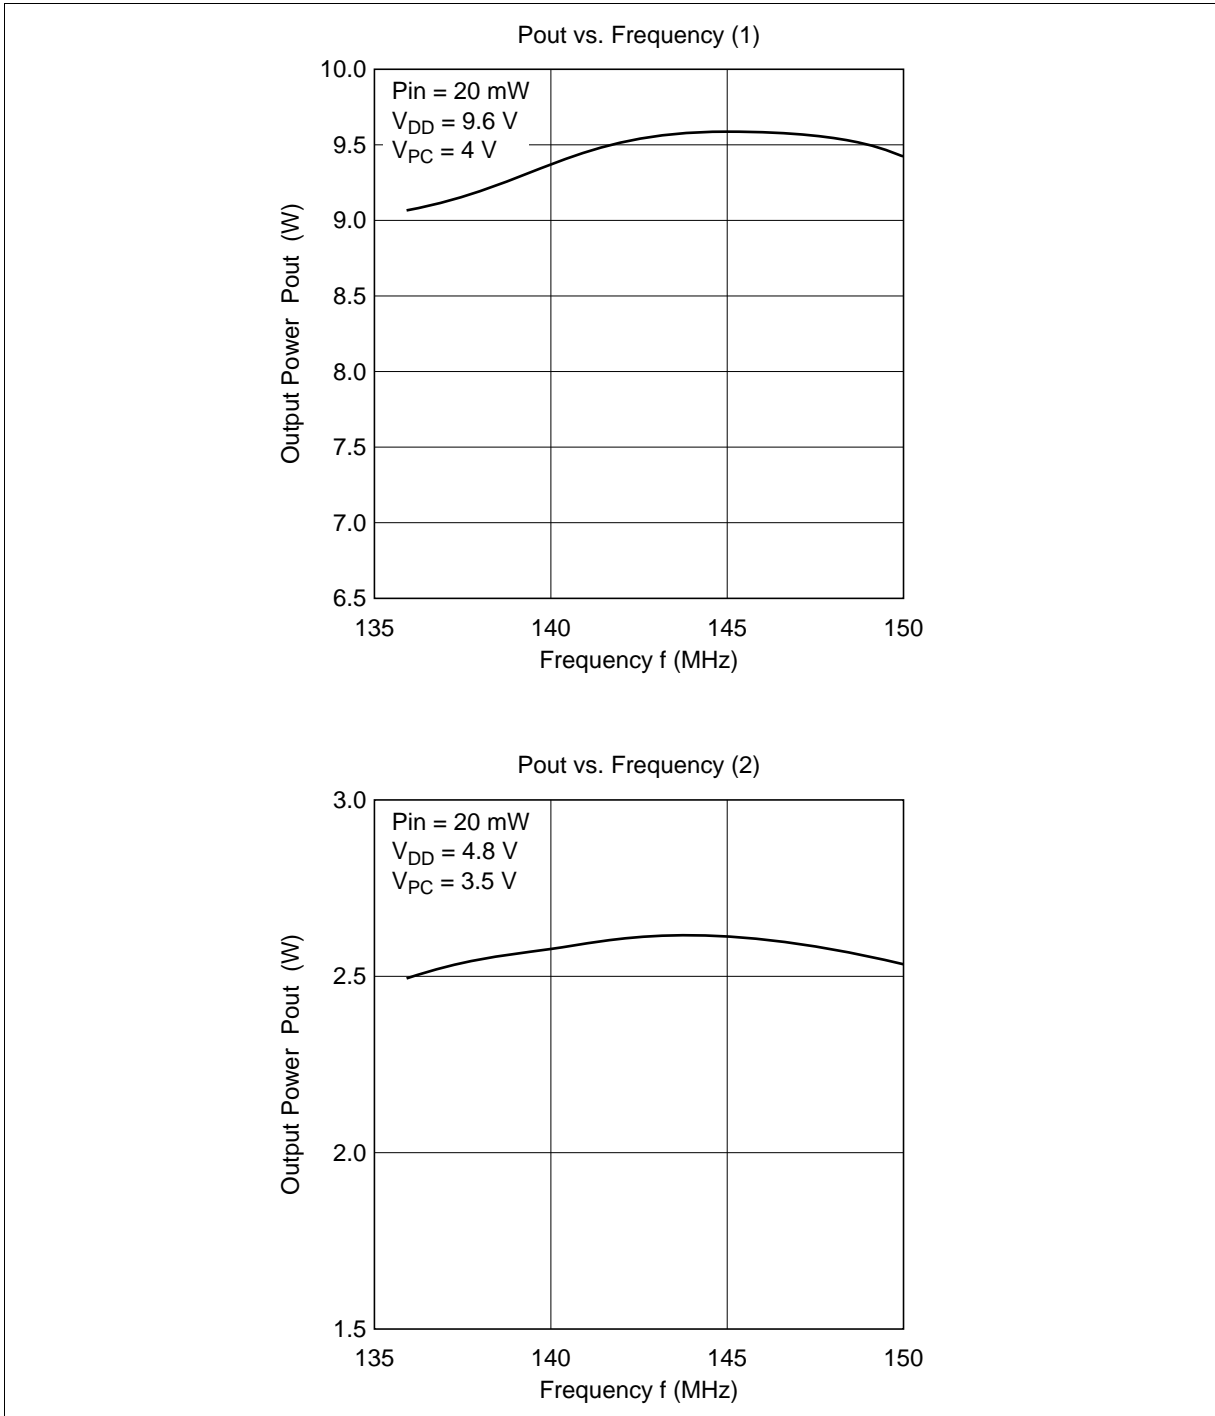

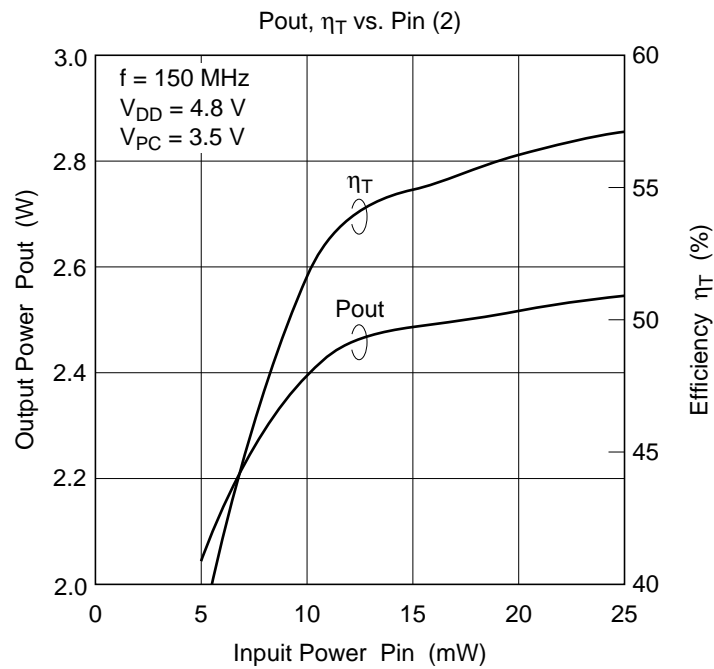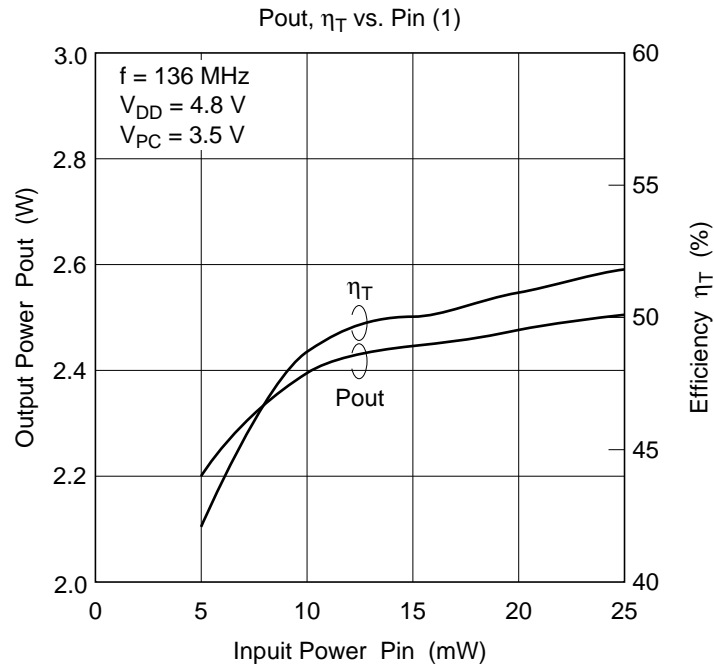

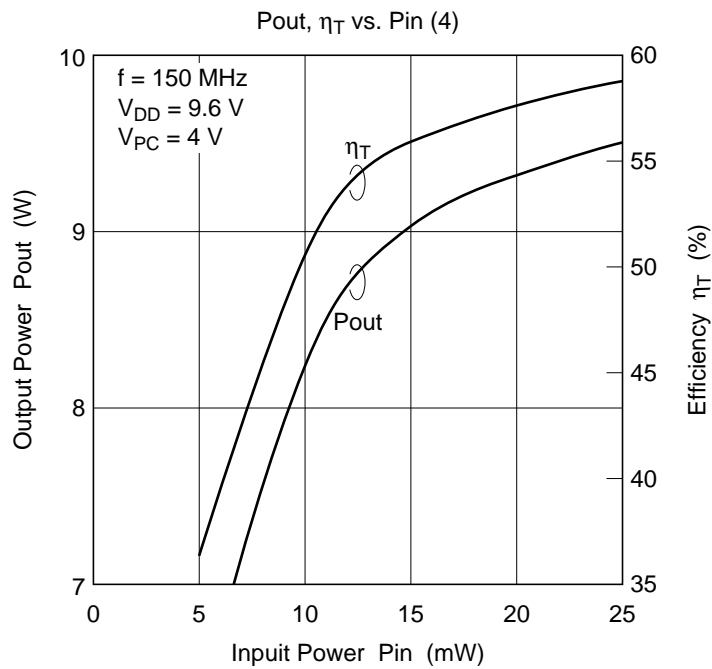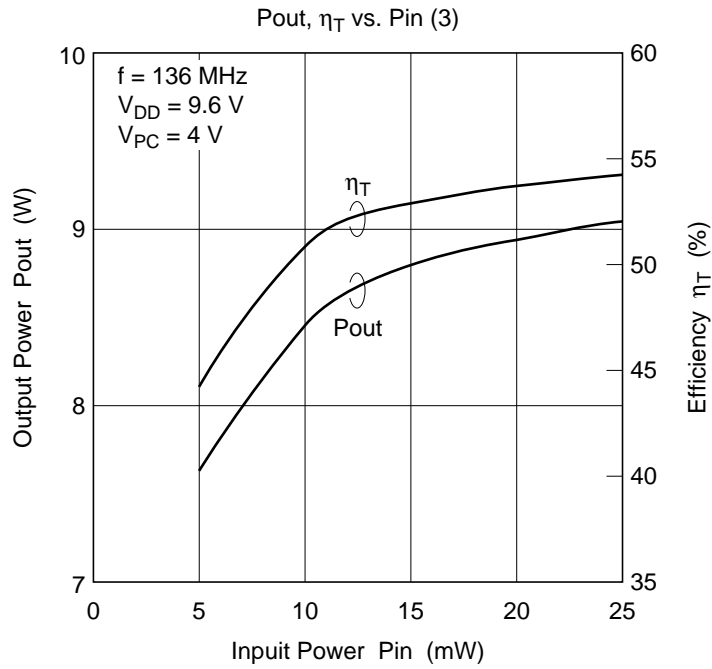

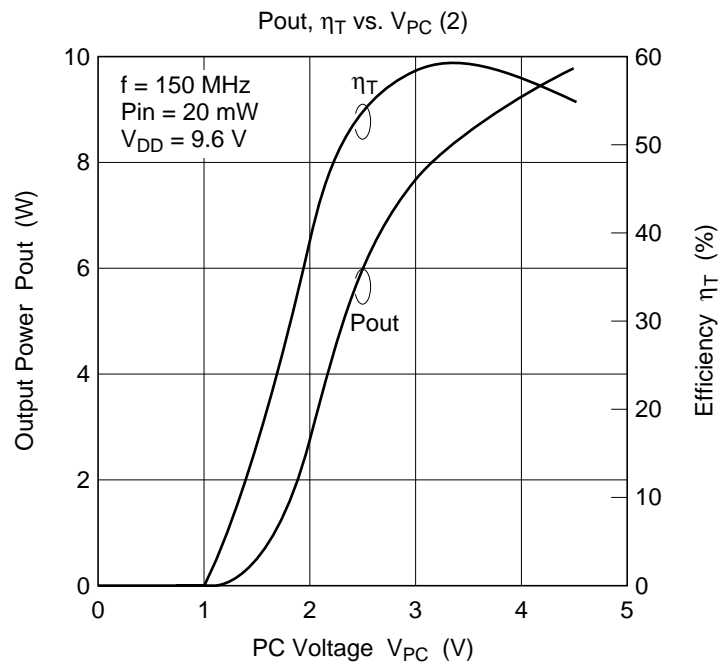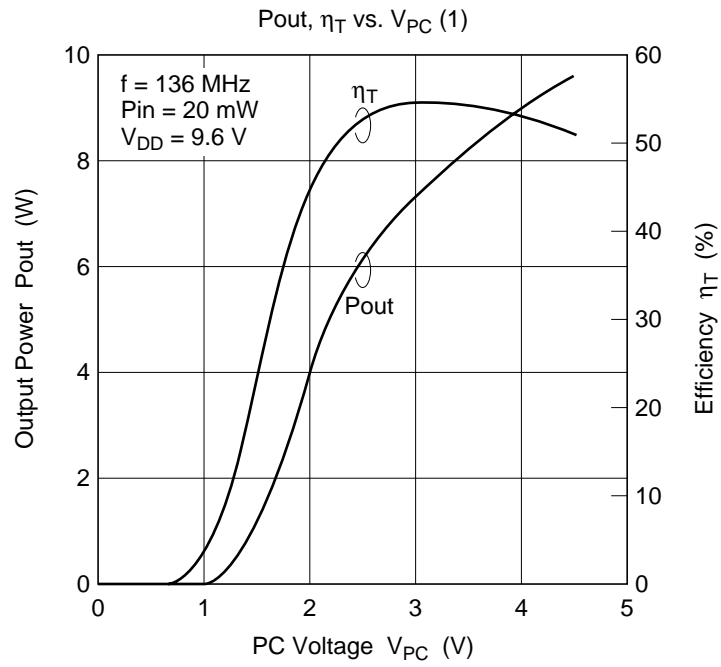


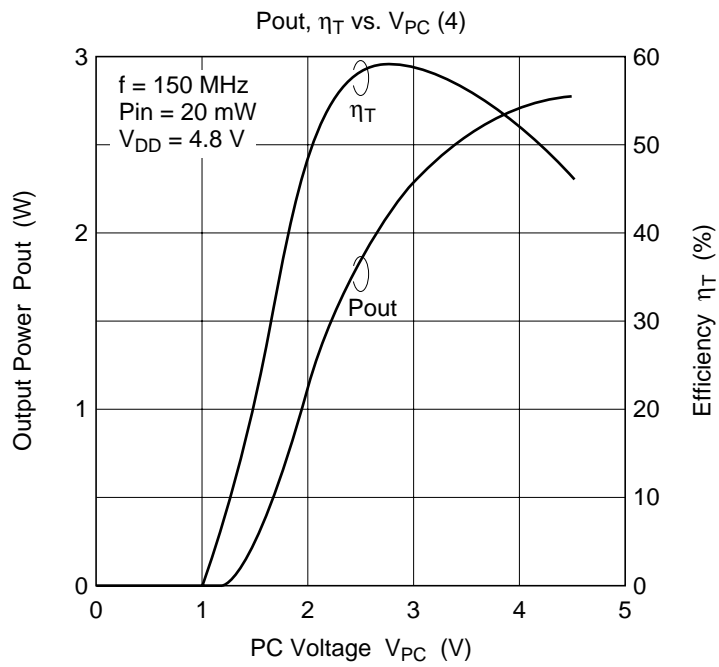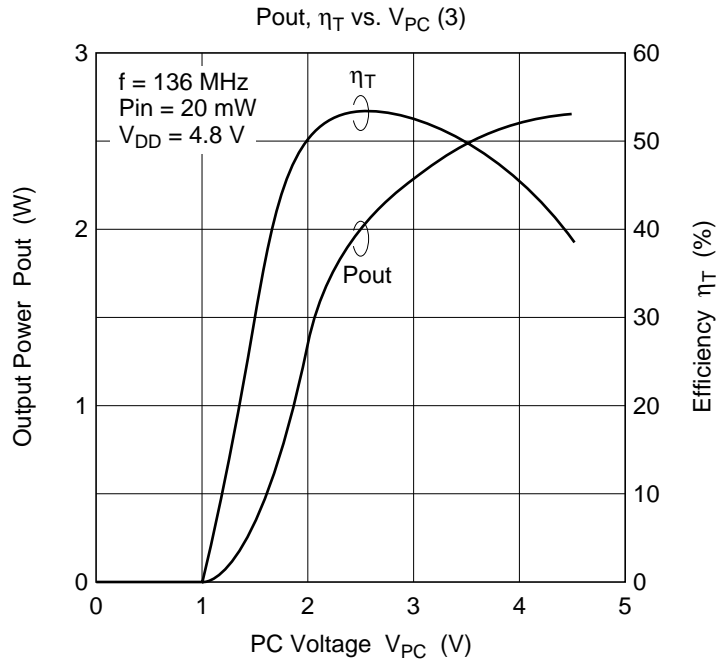



Package Dimensions

Unit: mm

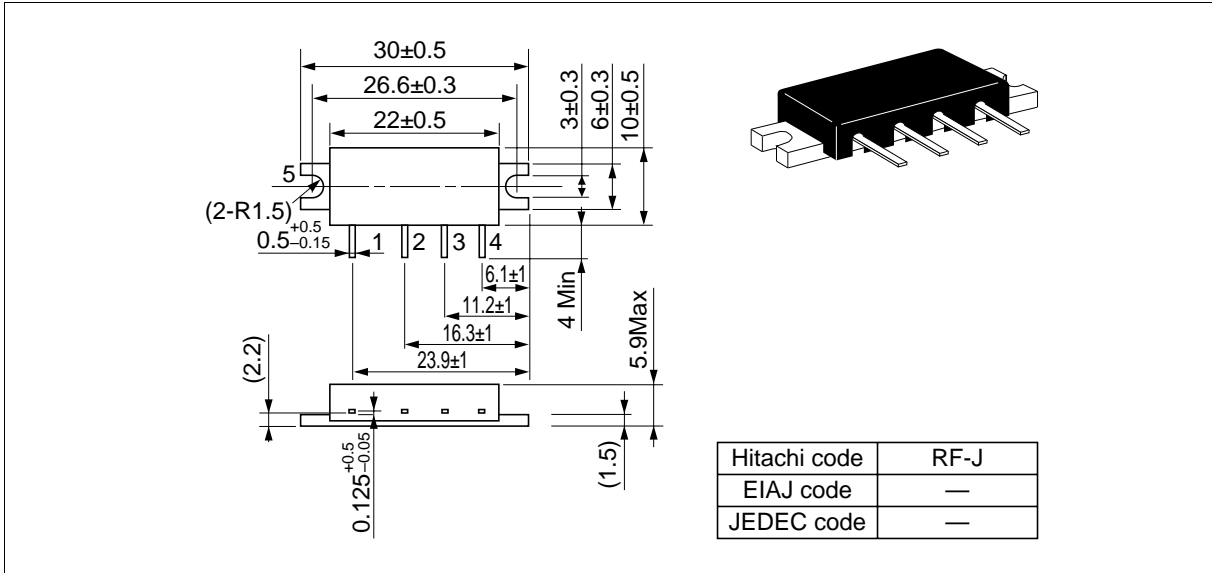

---

---

## Cautions

1. Hitachi neither warrants nor grants licenses of any rights of Hitachi's or any third party's patent, copyright, trademark, or other intellectual property rights for information contained in this document. Hitachi bears no responsibility for problems that may arise with third party's rights, including intellectual property rights, in connection with use of the information contained in this document.
2. Products and product specifications may be subject to change without notice. Confirm that you have received the latest product standards or specifications before final design, purchase or use.
3. Hitachi makes every attempt to ensure that its products are of high quality and reliability. However, contact Hitachi's sales office before using the product in an application that demands especially high quality and reliability or where its failure or malfunction may directly threaten human life or cause risk of bodily injury, such as aerospace, aeronautics, nuclear power, combustion control, transportation, traffic, safety equipment or medical equipment for life support.
4. Design your application so that the product is used within the ranges guaranteed by Hitachi particularly for maximum rating, operating supply voltage range, heat radiation characteristics, installation conditions and other characteristics. Hitachi bears no responsibility for failure or damage when used beyond the guaranteed ranges. Even within the guaranteed ranges, consider normally foreseeable failure rates or failure modes in semiconductor devices and employ systemic measures such as fail-safes, so that the equipment incorporating Hitachi product does not cause bodily injury, fire or other consequential damage due to operation of the Hitachi product.
5. This product is not designed to be radiation resistant.
6. No one is permitted to reproduce or duplicate, in any form, the whole or part of this document without written approval from Hitachi.
7. Contact Hitachi's sales office for any questions regarding this document or Hitachi semiconductor products.

---

---

# HITACHI

## Hitachi, Ltd.

Semiconductor & IC Div.  
Nippon Bldg., 2-6-2, Ohte-machi, Chiyoda-ku, Tokyo 100-0004, Japan  
Tel: Tokyo (03) 3270-2111 Fax: (03) 3270-5109

URL      NorthAmerica      : <http://semiconductor.hitachi.com/>  
             Europe                : <http://www.hitachi-eu.com/hel/ecg>  
             Asia (Singapore)      : <http://www.has.hitachi.com.sg/grp3/sicd/index.htm>  
             Asia (Taiwan)         : [http://www.hitachi.com.tw/E/Product/SICD\\_Frame.htm](http://www.hitachi.com.tw/E/Product/SICD_Frame.htm)  
             Asia (HongKong)      : <http://www.hitachi.com.hk/eng/bo/grp3/index.htm>  
             Japan                    : <http://www.hitachi.co.jp/Sicd/indx.htm>

## For further information write to:

Hitachi Semiconductor  
(America) Inc.  
2000 Sierra Point Parkway  
Brisbane, CA 94005-1897  
Tel: <1> (800) 285-1601  
Fax: <1> (303) 297-0447

Hitachi Europe GmbH  
Electronic components Group  
Dornacher Straße 3  
D-85622 Feldkirchen, Munich  
Germany  
Tel: <49> (89) 9 9180-0  
Fax: <49> (89) 9 29 30 00

Hitachi Europe Ltd.  
Electronic Components Group.  
Whitebrook Park  
Lower Cookham Road  
Maidenhead  
Berkshire SL6 8YA, United Kingdom  
Tel: <44> (1628) 585000  
Fax: <44> (1628) 778322

Hitachi Asia Pte. Ltd.  
16 Collyer Quay #20-00  
Hitachi Tower  
Singapore 049318  
Tel: 535-2100  
Fax: 535-1533

Hitachi Asia Ltd.  
Taipei Branch Office  
3F, Hung Kuo Building, No.167,  
Tun-Hwa North Road, Taipei (105)  
Tel: <886> (2) 2718-3666  
Fax: <886> (2) 2718-8180

Hitachi Asia (Hong Kong) Ltd.  
Group III (Electronic Components)  
7/F., North Tower, World Finance Centre,  
Harbour City, Canton Road, Tsim Sha Tsui,  
Kowloon, Hong Kong  
Tel: <852> (2) 735 9218  
Fax: <852> (2) 730 0281  
Telex: 40815 HITEC HX

Copyright © Hitachi, Ltd., 1998. All rights reserved. Printed in Japan.

## HITACHI