

TC Series

50/60 Hz Industrial Current Transformer up to 600A

Features

- For 50/60 Hz current, from 25 to 600 A nominal primary current.
- High number of secondary turns for a precise measurements of primary current.
- Low value for secondary currents, directly suitable for electronic circuit measurements.
- Cases made of UL94-VO material.
- Insulation prim/sec 4K Vac.
- Operating temperature from -40° to 70° C.



Product List



Part Number	I _p /I _s (A)	N _s	VB (Vac)	RB (Ω)	Accuracy	Case	Outputs	Diagram
TC-1012505	25 / 0.05	500	2	40	2%	A	1 - 2	1
TC-1015005	50 / 0.05	1000	4	80	1%	A	1 - 2	1
TC-2011002	100 / 0.2	500	4	20	1%	B	1 - 4	2
TC-2011001	100 / 0.1	1000	4	20	0.5%	B	1 - 4	2
TC-3014004	400 / 0.4	1000	8	20	0.5%	C	1 - 4	2
TC-3014002	400 / 0.2	2000	4	20	0.25%	C	1 - 4	2
TC-3016006	600 / 0.6	1000	6	10	0.25%	C	1 - 4	2
TC-3016002	600 / 0.2	3000	4	20	0.5%	C	1 - 4	2
	25 / 0.2	125	4	20	2.5%	B	1 - 2	3
TC-2031002	50 / 0.2	250	4	20	1.5%	B	1 - 3	3
	100 / 0.2	500	4	20	1%	B	1 - 4	3
	200 / 0.2	1000	4	20	0.5%	C	1 - 2	3
TC-3034002	300 / 0.2	1500	4	20	0.35%	C	1 - 3	3
	400 / 0.2	2000	4	20	0.25%	C	1 - 4	3
	200 / 0.4	500	8	20	1%	C	1 - 2	3
TC-3036004	400 / 0.4	1000	8	20	0.5%	C	1 - 3	3
	600 / 0.4	1500	8	20	0.25%	C	1 - 4	3

Notes:

I_p: Primary alternating current (rms) I_s: Secondary alternating current (rms) N_s: Secondary turns.
 VB: Voltage in RB (rms) RB: Secondary load resistance.

Dimensions

CASE A

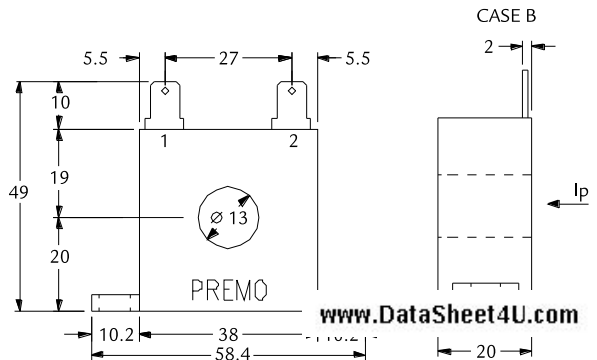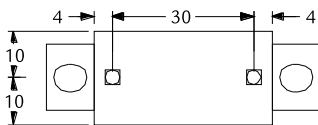


TC Series

50/60 Hz Industrial Current Transformer up to 600A


www.DataSheet4U.com

Current Transformers & Sensors


Dimensions

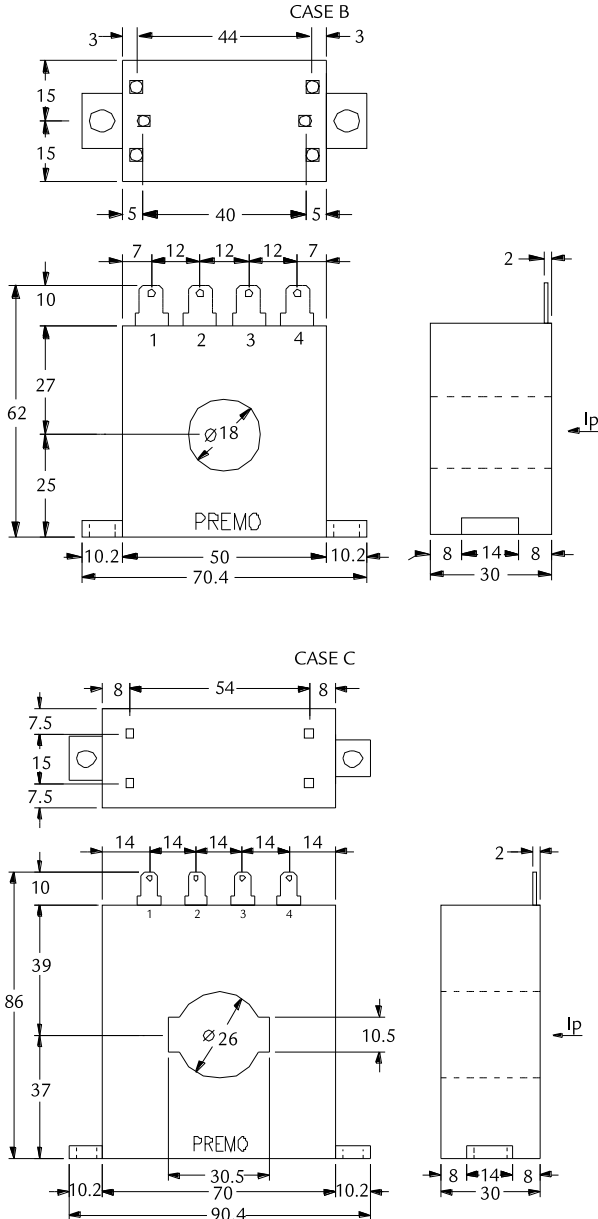

Test Circuit

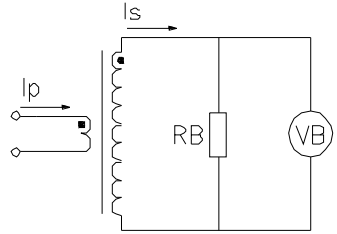

Electric Diagram

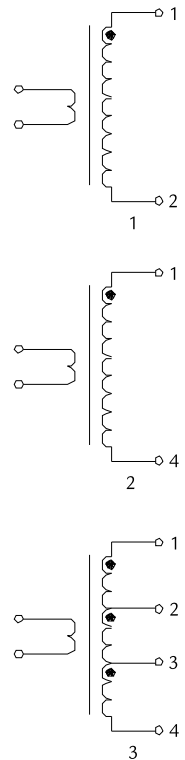

FIXATION:

Holes for self-tapping screws 2.9 x 9 or M4 screws and nuts.
 Dimensions in mm.
 Pin dimensions: 6.35 x 0.80 mm.