

# **TMR7553-P**

## **Unibody Precision Current Sensor**

### **Description**

TMR7553-P is a close loop current sensor for accurate measurement of DC, AC, pulsed current and arbitrary waveform current with galvanic isolation between primary and secondary circuits.



#### **Features and Benefits**

- High accuracy
- Excellent linearity
- · Ultra low temperature drift
- · Fast response time
- Galvanic isolation
- · High immunity to external interference
- Anti-CAF
- RoHS & REACH compliant

### **Applications**

- DC motor drives
- Inverter and variable frequency drives (VFD)
- Uninterruptible power supplies (UPS)
- · Power supplies for welding application
- · Switching power supplies


#### Selection Guide

Part Number	Primary Nominal Current	Primary Current Measuring Range	
TMR7553-1000P	100 A	±200 A	
TMR7553-2000P	200 A	±400 A	
TMR7553-3000P	300 A	±600 A	

#### Insulation and Environmental Characteristics

Parameters	Symbol	Тур.	Unit	
Dielectric Strength	$V_{D}$	5	kV(50 Hz, 1 min)	
Insulation Resistance	R <sub>IS</sub>	1000	ΜΩ	
Creepage Distance	d <sub>CP</sub>	20	mm	
Clearance	d <sub>CL</sub>	5	mm	
Ambient Operating Temperature	T <sub>A</sub>	-40 to +105	°C	
Ambient Storage Temperature	T <sub>STG</sub>	-40 to +105	°C	
Mass	m	78	g	







## Catalogue

1. Specifications	03
2. Typical Output Characteristics	04
3. Parameters Definition and Formula	05
4. Application Information	06
5. Dimensions	07



## 1. Specifications

 $\rm T_A$  = +25 °C,  $\rm V_{CC}$  = ±15 V,  $\rm R_M$  = 5  $\Omega,$  unless otherwise noted

Parameter	Symbol	Condition	Min.	Тур.	Max.	Unit
		General Electrical Data				
Primary Nominal Current	I <sub>PN</sub>	TMR7553-1000P	-	100	-	A
		TMR7553-2000P	-	200	-	
		TMR7553-3000P	-	300	-	
Primary Current Measuring Range	I <sub>PM</sub>	TMR7553-1000P	-200	-	200	А
		TMR7553-2000P	-400	-	400	
		TMR7553-3000P	-600	-	600	
Sensitivity	S	$I_P = 0 \text{ to } \pm I_{PN}$	-	0.5	-	mA/A
Number of Secondary Turns	Ns	-	-	2000	-	-
Output Current	I <sub>OUT</sub>	I <sub>P</sub> = 0 to ±I <sub>PM</sub>	-	I <sub>OE</sub> + S × I <sub>P</sub>	-	V
Supply Voltage	V <sub>cc</sub>	±5 %	±12	±15	±20	V
Current Consumption	I <sub>c</sub>	I <sub>P</sub> = 0	-	±15	-	mA
Secondary Coil Resistance	R <sub>s</sub>	T <sub>A</sub> = +25 °C	-	-	23	Ω
Measuring Resistance	R <sub>M</sub>	For maximum measuring resistance value, please refer to Figure 2, 3, 4, 5, 6	0	-	-	Ω
		Static Performance Data				
Accuracy	X <sub>G</sub>	$T_A = +25 ^{\circ}\text{C},  I_P = 0 \text{ to } \pm I_{PN}$	-0.15	±0.06	0.15	% I <sub>PN</sub>
		$T_A = -40 ^{\circ}\text{C} \text{ to } +105 ^{\circ}\text{C}, I_P = 0 \text{ to } \pm I_{PN}$	-0.6	±0.3	0.6	
Linearity Error	٤	$T_A = -40  ^{\circ}\text{C} \text{ to } +105  ^{\circ}\text{C},  I_P = 0 \text{ to } \pm I_{PN}$	-	±0.05	ı	% I <sub>PN</sub>
Symmetry	ε <sub>SYM</sub>	$T_A = -40  ^{\circ}\text{C} \text{ to } +105  ^{\circ}\text{C},  I_P = 0 \text{ to } \pm I_{PN}$	99.8	100	100.2	%
Sensitivity Error	ε <sub>S</sub>	$T_A = -40 ^{\circ}\text{C} \text{ to } +105 ^{\circ}\text{C}, I_P = 0 \text{ to } \pm I_{PN}$	-0.5	-	0.5	%
Offset Error	I <sub>OE</sub>	T <sub>A</sub> = +25 °C, I <sub>P</sub> = 0	-0.1	±0.05	0.1	mA
Hysteresis	I <sub>OH</sub>	$I_P = \pm I_{PN} \rightarrow 0$	-0.1	-	0.1	mA
		Dynamic Performance Data				
Response Time	t <sub>R</sub>	di/dt > 50 A/µs, 10% to 90% of I <sub>PN</sub>	-	1	-	μs
Bandwidth	BW	-3 dB	DC	-	200	kHz



## 2. Typical Output Characteristics

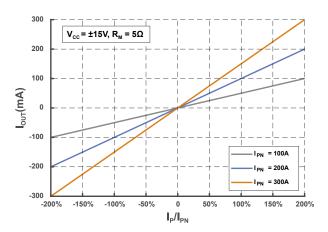


Figure 1. Output Voltage vs Primary Current

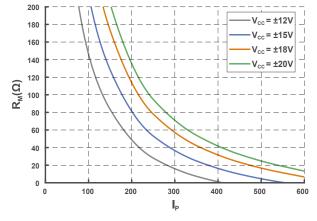


Figure 2. Measuring Resistance (@T<sub>A</sub> = 105 °C)

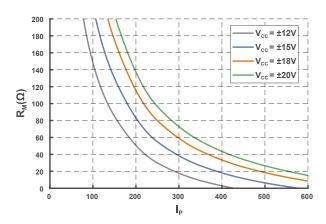


Figure 3. Measuring Resistance (@T<sub>A</sub> = 85 °C)

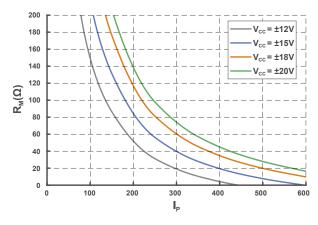


Figure 4. Measuring Resistance (@T<sub>A</sub> = 70 °C)

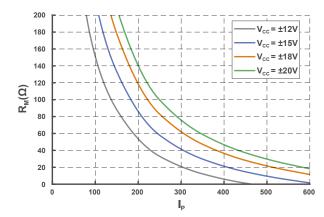


Figure 5. Measuring Resistance (@ $T_A$  = 50 °C)

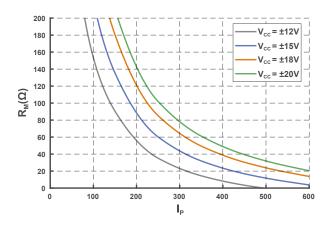


Figure 6. Measuring Resistance (@T<sub>A</sub> = 25 °C)



#### 3. Parameters Definition and Formula

#### 1) Output Current

$$I_{OUT} = I_{OE} + S \times I_{P}$$

 $I_{OUT}$  stands for current sensor output current at given primary current,  $I_{OE}$  stands for offset error, S stands for sensitivity,  $I_P$  stands for primary current.

#### 2) Accuracy

$$X_{G} = \underset{I_{P} \in [-I_{PN}, I_{PN}]}{\text{MAX}} \left( \frac{I_{OUT} - (S \times I_{P})}{S \times I_{PN}} \times 100\% \right)$$

I<sub>PN</sub> stands for nominal primary current.

#### 3) Sensitivity

$$S = \frac{I_{OUT(@ I_{PN})} - I_{OUT(@ -I_{PN})}}{2 \times I_{PN}}$$

 $I_{OUT_{(@\ I_{PN})}}$  and  $I_{OUT_{(@\ I_{PN})}}$  stand for the current output at  $I_{PN}$  and  $-I_{PN}$  respectively.

#### 4) Linearity

$$\epsilon_{L} = \underset{I_{P} \in \left[ -I_{PN}, \ I_{PN} \right]}{\mathsf{MAX}} \left( \frac{I_{OUT} - \left( \overline{I}_{OE} + \overline{S} \times I_{P} \right)}{S \times I_{PN}} \times 100\% \right)$$

 $\bar{S}$  and  $\bar{I}_{OE}$  stand for the average values of the sensitivity and offset error.

#### 5) Symmetry

$$\epsilon_{\text{SYM}} = \left| \frac{I_{\text{OUT}(@ I_{PN})} - \bar{I}_{\text{OE}}}{I_{\text{OUT}(@ -I_{PN})} - \bar{I}_{\text{OE}}} \right| \times 100\%$$

#### 6) Hysteresis

$$I_{OH}$$
 = MAX  $\Delta H$ 

ΔH is the maximum residual output current between full scale positive and negative nominal current.

#### 7) Measuring Resistance

$$R_{M MAX} = N_S \times \frac{V_{CC} - 3.7V}{I_P} - 4 - R_S \times \frac{234.5 + T_A}{234.5 + 25}$$

 $R_{M\ MAX}$  is the maximum measuring resistance,  $N_S$  is the number of turns of the secondary coil winding and  $T_A$  stands for ambient operating temperature.



#### 4. Application Information

#### **Electrical Connection**

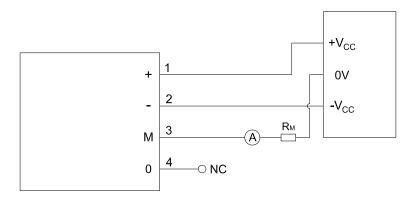


Figure 7. Electrical Connection

#### Mounting Recommendation

1. Mounting method:  $1 \times \Phi$  4.2 mm hole and  $1 \times \Phi$  4.2 mm slotted hole

2 × M4 copper or SS304 screws (Recommended torque 1.2 N·m)

Or

 $2 \times \Phi$  5.4 mm hole

2 × M5 copper or SS304 screws (Recommended torque 1.2 N·m)

2. Primary through hole dimensions: Φ 20 mm

3. Secondary electrical connection: Molex 22041041 (Molex 5045-04A)

Crimp Housing: Molex 22011042 Crimping Terminal: Molex 08500113

#### Remarks

- 1. I<sub>OUT</sub> is positive when the primary current (I<sub>P</sub>) is in the same direction as the arrow indication on the label and vice versa.
- 2. Improper connection may result in permanent damage of the sensor.
- 3. Sensor secondary circuitry must be powered prior primary current is being added and when depowering secondary circuitry, primary current must be close to 0A. Improper procedure may result in worse accuracy or result in permanent damage of the sensor.
- 4. Dynamic performances (di/dt and response time) are best with a single busbar completely filling the primary through hole.
- 5. Sensor is customizable upon request.



### 5. Dimensions

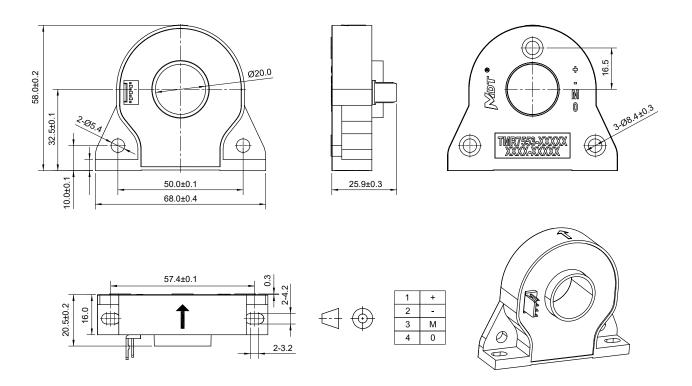


Figure 8. Dimension (unit: mm, tolerances for unmarked scales ±1 mm)

#### Copyright © 2024 by MultiDimension Technology Co., Ltd.

Information furnished herein by MultiDimension Technology Co., Ltd. (hereinafter MDT) is believed to be accurate and reliable. However, MDT disclaims any and all warranties and liabilities of any kind, with respect to any examples, hints or any performance or use of technical data as described herein and/or any information regarding the application of the product, including without limitation warranties of non-infringement of intellectual property rights of any third party. This document neither conveys nor implies any license under patent or other industrial or intellectual property rights. Customer or any third-party must further determine the suitability of the MDT products for its applications to avoid the applications default of customer or third-party. MDT accept no liability in this respect.

MDT does not assume any liabilities of any indirect, incidental, punitive, special or consequential damages (including without limitation of lost profits, lost savings, business interruption, costs related to the removal or replacement of any products or rework charges) whether or not such damages are based on tort (including negligence), warranty, breach of contract or any other legal theory. Notwithstanding any damages that customer might incur for any reason whatsoever, MDT's aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the terms and conditions of commercial sale of MDT.

Absolute maximum ratings are the extreme limits the device will withstand without damage to the MDT product. However, the electrical and mechanical characteristics are not guaranteed as the maximum limits (above recommended operating conditions) are approached. MDT disclaims any and all warranties and liabilities of the MDT product will operate at absolute maximum ratings.

Specifications may change without notice.

Please download latest document from our official website www.dowaytech.com/en.

#### Recycling

The product(s) in this document need to be handed over to a qualified solid waste management services company for recycling in accordance with relevant regulations on waste classification after the end of the product(s) life.



