29mm



# AC / DC Sensing Current Module with Digital Data output

### Feature:

- Continuous output and Modbus-RTU version
- Operating voltage DC5.0V
- 98 mΩ internal conductor resistance
- Sensing current range : AC : 0~1.2A (50Hz, 60Hz) DC : 0~±1.7A
- High accuracy : AC : (0~0.4A) ± 4mA
  - (0.4~1.2A) ± 1%
- DC : ±(0~0.4A) ± 4mA
  ±(0.4~1.7A) ± 1%
- High resolution : AC / DC : 1.2mA
- UART, Baud Rate : 9600 bps, Parity bit : None , Data bit : 8 , Stop bit : 1
- Temperature calibration
- Isolation Voltage 1KV
- Application note: <u>http://www.winson.com.tw/Product/83</u>

## **General Description:**

The Winson WCM2702 provides economical and precise solution for both AC and DC current sensing in industrial, commercial and communications systems.

The WCM2702 consists of a current sensor, temperature sensor, a very high accuracy A/D converter and digital signal output of current.

The WCM2702 includes a current path with 98 m $\Omega$  typical internal conductor resistance. This extremely low resistance can effectively reduce power loss, operating temperature and increase the reliability greatly, user's MCU can get the real data from DATA pin.

The WCM2702 provides temperature calibration of the internal current sensor and accurately measures the current of AC 50 / 60Hz and DC at temperature from -20°C~70°C. The WCM2702 also offers solutions for true RMS current measurement of various loads.



# WCM2702



ABSOLUTE MAXIMUM RATING
Supply Voltage, Vdd 6V
Pass Current, IP2.5A
Pass Current (10ms pulse), Ipulse5A
Basic Isolation Voltage 1000V
Operating Temperature Range, Ta
20°C to +70°C
Storage Temperature Range, Ts

1.VDD 2.GND 3.RST 4.INT 5.CK 6.DA 7.RX 8.TX

# **Selection Guide:**

Model	Maximum	Current	Operating	mode	
Woder	AC	DC	Voltage		
WCM2702-AC50C	1.2A	-	5.0V	Continuous	
WCM2702-DC50C		±1.7A	5.0V	Continuous	
WCM2702-50C	1.2A	±1.7A	5.0V	Continuous	
WCM2702-50M	1.2A	±1.7A	5.0V	Modbus-RTU	

# Pad Description:

Pad No	Pad Name	I/O	Description	
1	VDD	-	The positive power input pin	
2	GND	-	The system ground	
3	RST	I	The system reset	
4	INT	I	Sampling control	
5	СК	I/O	System programming, reconvo	
6	DA	I/O	System programming, reserve	
7	RX	I	The data of measured current output. Its output is UART	
8	ТΧ	0	communication. The baud rate is 9.6K bits/sec.	



# **Electrical Characteristics:**

### **Common Operating Characteristics**

Symbol	Parameter	Test Condition	Min.	Тур.	Max.	Unit
VDD	Operation Voltage	-	4.9	5	5.1	V
IDD	Operation Current	-	-	8	10	mA
R <sub>primary</sub>	Conductor Resistance	IP = 2 A	-	98	-	mΩ
TOP	Operating Temperature	-	-20	-	70	°C

#### -AC50C


# $T_{OP} = 25 \ ^{\circ}C, V_{DD} = 5.000V$


Symbol	Parameter	Test Condition	Min.	Тур.	Max.	Unit
IOP	AC Current Range	-	0	-	1.2	А
		IOP=0~0.4A , TOP=25°C	-	±4	-	mA
ETOT	AC Current Total Output	IOP=0.4~1.2A , TOP=25°C	-	±1	-	%
EIUI	Error	IOP=0~1.2A ,		_		0/
		TOP=-20°C to 70°C	-	±5	-	%

### -DC50C

## $T_{OP} = 25 \degree C, V_{DD} = 5.000V$

		Vi		, ,		
Symbol	Parameter	Test Condition	Min.	Тур.	Max.	Unit
IOP	DC Current Range	-	0	-	±1.7	А
		IOP=±(0~0.4A) , TOP=25°C	-	±4	-	mA
гтот	DC Current Total Output	IOP=±(0.4~1.7A), TOP=25°C	-	±1	-	%
ETOT	Error	IOP=0~±1.7A ,				0/
		TOP=-20°C to 70°C	- ±5	±5	-	%



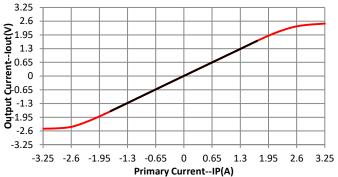




**Application Note:** 

### **Application Diagram:**

Master (MCU)

RX

ΤХ

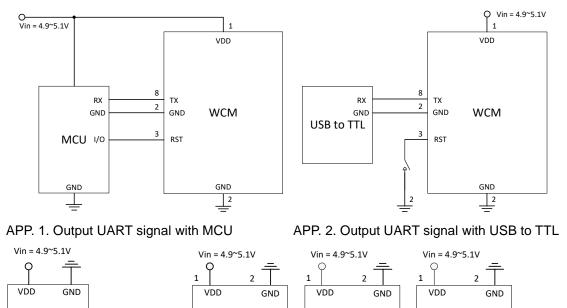

WCM 2

7

RX

ΤХ

8

WCM 3

7

RX

ΤХ

8

. . .

RX

ΤХ

## Measured Current Data Output (Continuous Mode):

ΤХ

8

WCM 1

7

The measured current can be **continuously transmitted** by UART format.

RX

(1) If the measured data is AC "1.234"A, then the output data is '~', '0', '1', '2', '3', '4', '\r', '\n', total of 8 bytes; the output data is ASCII code.

App. 3 Modbus Connection

- (2) If the measured data is +DC "1.234"A, then the output data is '+', '0', '1', '2', '3', '4', '\r', '\n', total of 8 bytes; the output data is ASCII code.
- (3) If the measured data is -DC "1.234"A, then the output data is '-', '0', '1', '2', '3', '4', '\r', '\n', total of 8 bytes; the output data is ASCII code.



## Measured Current Data Output (Modbus-RTU Mode):

#### **Modbus Parameter List**

For example description, please refer to the "Current Module Application Note:

#### Modbus-RTU Data Format

Slave Address	Function Code	Data	Check Code (CRC16)
1 Byte	1 Byte	N x Byte	2 Byte (Low byte first)

#### **Function Code**

Function Code	Description
03H	Read up to 125 continuous memory words
06H	Write one memory word

#### **Exception Code**

Exception Code	Description
01H	Illegal function code
02H	Illegal data address
03H	Illegal data count

When responding to an exception, the MSB (Most Significant Bit) of the function code is automatically set to 1.



#### True RMS Current Measurement:

In order to calculate true RMS of AC current, you need to know "zero" value of AC current first. The "zero" value of symmetric AC current is the average value *Vo*(dc) of the current shown in Figure 1.

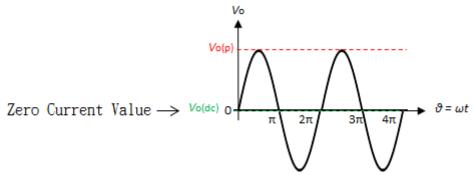


Figure 1 The zero current value of sine waveform

But in asymmetrical AC current, the "zero" value is not the average value *V*o(dc) of the current. Based on this "zero" value and do RMS calculation. You will get wrong answer.



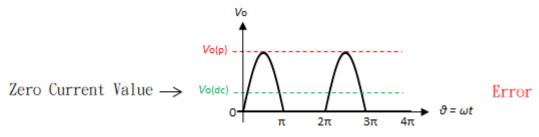


Figure 2 The zero current value of the asymmetric waveform (Error)

The WCM series offer a true RMS solution for both symmetric and asymmetric AC current. It can correctly detect "zero" current value, shown in Figure 3. and do perfect RMS calculation.



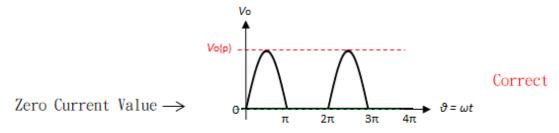



# WCM2702

# Package:

(Unit: mm)

