

# **Hall Effect Base Linear Current Sensor**

#### **Features:**

- New spring structure with high measurement stability (increased by more than 2 times)
- 10.4 x 8 mm<sup>2</sup> split through hole design
- Output voltage proportional to AC and DC current
- Wide sensing current range 0~35 A at 5V volt
- High sensitivity 72 mV/A
- Wide operating voltage range 3.0~12V
- Low operating current 3 mA
- Isolation voltage 4000 V
- Ratiometric output from supply voltage
- 23 KHz Bandwidth
- Two bronze sticks for easy soldering on PCB





# **Functional Description:**

The WCS7800 consists of a precise, low-temperature drift linear hall sensor IC and 10.4x8 mm<sup>2</sup> split through hole. Users can use system's own electric wire by pass it through this hole to measure passing current. **The unique spring structure of WCS7800 can improve the tightness on both sides of the iron core, making measurement more stable and reducing the influence of structural opening and closing tolerances.** This design allows system designers to monitor any current path without breaking or changing original system layout at all. Any current flowing through this hole will generate a magnetic field which is sensed by the integrated Hall IC and converted into a proportional voltage.


The Winson WCS7800 current sensor provides economical and precise solution for both DC and AC current sensing in industrial, commercial and communications systems.

The terminals of the conductive path are electrically isolated from the sensor leads. This allows the WCS7800 current sensor to be used in applications requiring electrical isolation without the use of opto-isolators or other costly isolation techniques and make system more competitive in cost.




AC: rms 25A



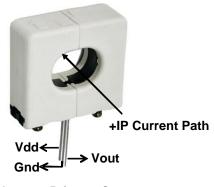

**Vout vs. Primary Current** 

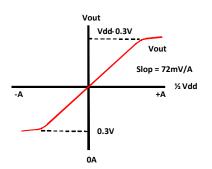


## **Absolute Maximum Range**

| Supply Voltage, Vdd14V             |
|------------------------------------|
| Pass Through Wire Channel10.4X8mm² |
| Output Current Sink0.4mA           |
| Output Current Source2mA           |
| Basic Isolation Voltage4000V       |
| Operating Temperature Range ,Ta    |
| 20°C to +125°C                     |
| Storage Temperature Range,Ts       |
|                                    |
| Power Dissipation, Pd 1W           |

| Order Information |             | (Vdd = 5V)    |  |  |
|-------------------|-------------|---------------|--|--|
| Part No.          | Sensitivity | Current range |  |  |
| 14/007000         | 70          | DC:± 0 ~ 35A  |  |  |
| WCS7800           | 72mV/A      | 10 051        |  |  |

### **Function Block:**

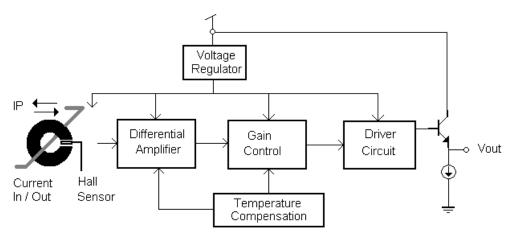



# WCS7800


| Floor | ·-:I   | Chara | -4    | 1:     |
|-------|--------|-------|-------|--------|
| cieci | tricai | Cnara | cteri | stics: |


 $(T=+25^{\circ}C, V_{dd}=5.0V)$ 


| Characteristic           | Symbol                    | Test Conditions      | Min  | Тур    | Max  | Units           |
|--------------------------|---------------------------|----------------------|------|--------|------|-----------------|
| Supply Voltage           | $V_{dd}$                  | _                    | 3.0  | _      | 12   | V               |
| Supply Current           | I <sub>supply</sub>       | IP = 0 A             | _    | 3.5    | 6.0  | mA              |
| Zero Current Vout        | $V_{0G}$                  | IP = 0 A             | 2.35 | 2.5    | 2.65 | ٧               |
| Conductor Through Hole   | _                         | _                    | _    | 10.4x8 | _    | mm <sup>2</sup> |
| Sensitivity              | Sens                      | IP = ±10 A           | 60   | 72     | 84   | mV/A            |
| Bandwidth                | BW                        | _                    | _    | 23     | _    | kHz             |
| Measurable Current Range | MD                        | Vdd=5V (DC Mode)     | _    | ±35    | _    | ۸               |
|                          | MR                        | Vdd=5V (AC RMS )     | _    | 25     | _    | Α               |
| Temperature Drift        | △Vout                     | IP = 0 A             | _    | ±1.0   | _    | mV/°C           |
| Output Noise             | V <sub>Np-p</sub>         | IP = 0 A             | _    | 15     | _    | mV              |
|                          | V <sub>Np-p(0.01uF)</sub> | IP = 0 A, C = 0.01uF | _    | 3      | _    | IIIV            |


<sup>1.</sup> All output-voltage measurements are made with a voltmeter having an input impedance of at least  $100k\Omega$ 

## **Characteristic Diagrams:**

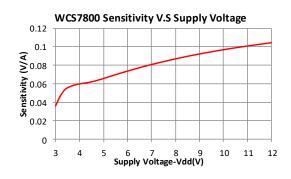

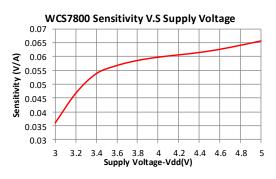

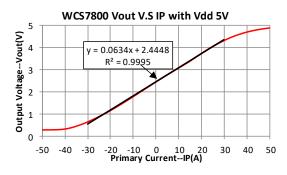


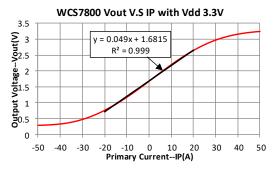


<sup>2.</sup> Do not apply any 'resistor load' on output pin, it will degrade IC's performance.

# WCS7800

#### WCS7800 Sensitivity standardization of 30°C (5V) V.S Temperature

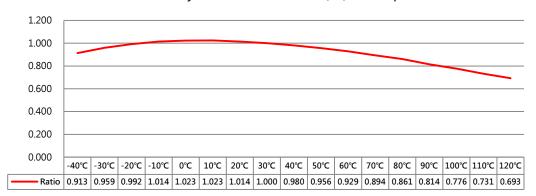


### WCS7800 Sensitivity standardization of 30°C (3.3V) V.S Temperature

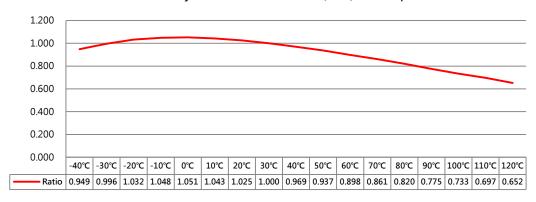




### **Application Circuit:**

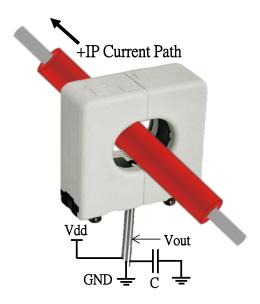

Capacitor C(0.01uF~0.1uF) is recommend to be connected between Vout and GND to reduce output noise.

# **Application Notice:**

There is a linear variation of sensitivity along the y directions. Keep wire as fixed as possible to get steadiest reading.

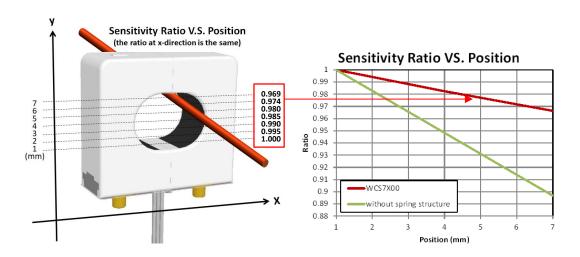

The unique spring structure of WCS7X00 can significantly reduce the impact of the vertical position of the current wire on the sensitivity.


**WCS Application Note**: please refer to Winson Website -> Products-> Application Note -> WCS Application Note:

http://www.winson.com.tw/Product/83



# **Package Information:**

# Unit: mm

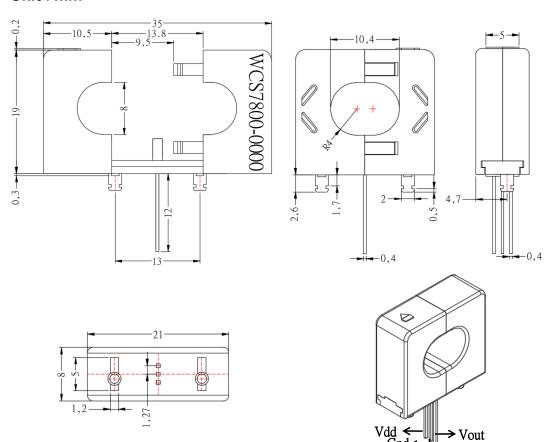

## PCB Layout Reference View (Top View)

