


## Smart Sensors (Laser Type) ZX Series (ZX-L-N)

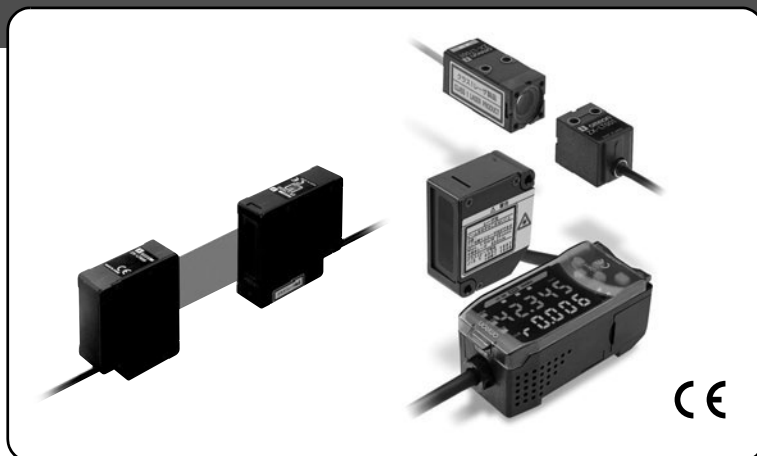

### Ordering Information

#### ■ Sensors

##### Sensor Heads (Reflective)

| Optical system     | Beam shape | Sensing distance | Resolution*1 | Model     |
|--------------------|------------|------------------|--------------|-----------|
| Diffuse reflective | Spot beam  | 40±10 mm         | 2 μm         | ZX-LD40   |
|                    |            | 100±40 mm        | 16 μm        | ZX-LD100  |
|                    |            | 300±200 mm       | 300 μm       | ZX-LD300  |
|                    | Line beam  | 40±10 mm         | 2 μm         | ZX-LD40L  |
|                    |            | 100±40 mm        | 16 μm        | ZX-LD100L |
|                    |            | 300±200 mm       | 300 μm       | ZX-LD300L |
| Regular reflective | Spot beam  | 30±2 mm          | 0.25 μm      | ZX-LD30V  |
|                    | Line beam  |                  |              | ZX-LD30VL |


\*1. For an average count of 4,096.

##### Sensor Heads (Through-beam)

| Optical system | Measuring width | Sensing distance | Resolution*1 | Model    |
|----------------|-----------------|------------------|--------------|----------|
| Through-beam   | 1-mm dia.       | 0 to 2000 mm     | 4 μm         | ZX-LT001 |
|                | 5 mm            | 0 to 500 mm      |              | ZX-LT005 |
|                | 10 mm           |                  |              | ZX-LT010 |
|                | 30 mm           | 12 μm            | ZX-LT030     |          |

\*1. For an average count of 64.


##### Amplifier Units

| Appearance  | Power supply | Output type | Model      |
|---|--------------|-------------|------------|
|  | DC           | NPN         | ZX-LDA11-N |
|   |              | PNP         | ZX-LDA41-N |


**Note:** Compatible connection with the Sensor Head.

## Accessories (Order Separately)



### Calculating Unit

| Appearance  | Model   |
|---|---------|
|  | ZX-CAL2 |


### Side-view Attachments

| Appearance  | Applicable Sensor Head | Model   | Quantity |
|---|------------------------|---------|----------|
|  | ZX-LT1001/LT005        | ZX-XF12 | 1        |
|   | ZX-LT010               | ZX-XF22 |          |

### Logging Tool for Personal Computers

| Appearance  | Name   | Model                    |
|---|--|--------------------------|
|  | RS-232C  | ZX-SF11                  |
|   | USB  | ZX-SF21                  |
|  | Smart Monitor (Logging Software + Function Setting Software) | ZX-SW11EV3 (See note 1.) |

### Setup Tool for Personal Computer

| Appearance   | Name  | Model                     |
|--|---|---------------------------|
|  | Communications Interface Unit (RS-232C) + Smart Monitor Basic*2 (Function Setting Software) | ZX-SFW11EV3 (See note 1.) |

**Note 1.** The ZX-SFW11EV3 or ZX-SW11EV3 is required to use the Smart Monitor with the ZX-LDA11-N/41-N. Earlier versions cannot be used.

**2.** The Smart Monitor Basic does not have a logging function. Other than the logging function, the Smart Monitor Basic supports the same functions as the Smart Monitor.


### Cables with Connectors on Both Ends (for Extension)\*1

| Cable length | Model   | Quantity |
|--------------|---------|----------|
| 1 m          | ZX-XC1A | 1        |
| 4 m          | ZX-XC4A |          |
| 8 m          | ZX-XC8A |          |
| 9 m *2       | ZX-XC9A |          |

\*1. Robot Cable models are also available. The model numbers are ZX-XC□R.

\*2. For use only with Reflective Sensors.

### Bank Unit

| Appearance   | Model   |
|--|---------|
|  | ZX-SB11 |

# Specifications

## ■ Sensor Heads (Reflective)

| Item                               | Model | ZX-LD40  | ZX-LD100                | ZX-LD300               | ZX-LD30V                              | ZX-LD40L   | ZX-LD100L               | ZX-LD300L              | Z3X-LD30VL                            |
|------------------------------------|-------|--|-------------------------|------------------------|---------------------------------------|--|-------------------------|------------------------|---------------------------------------|
| Optical system                     |       | Diffuse reflective   |                         |                        | Regular reflective                    | Diffuse reflective   |                         |                        | Regular reflective                    |
| Light source (wave length)         |       | Visible-light semiconductor laser with a wavelength of 650 nm and an output of 1 mW max.<br>EN class 2, FDA class II |                         |                        |                                       |  |                         |                        |                                       |
| Measurement point                  |       | 40 mm  | 100 mm                  | 300 mm                 | 30 mm                                 | 40 mm  | 100 mm                  | 300 mm                 | 30 mm                                 |
| Measurement range                  |       | ±10 mm   | ±40 mm                  | ±200 mm                | ±2 mm                                 | ±10 mm   | ±40 mm                  | ±200 mm                | ±2 mm                                 |
| Beam shape                         |       | Spot   |                         |                        | Line                                  |  |                         |                        |                                       |
| Beam size*1                        |       | 50-μm dia.   | 100-μm dia.             | 300-μm dia.            | 75-μm dia.                            | 75 μm x 2 mm   | 150 μm x 2 mm           | 450 μm x 2 mm          | 100 μm x 1.8 mm                       |
| Resolution*2                       |       | 2 μm   | 16 μm                   | 300 μm                 | 0.25 μm                               | 2 μm   | 16 μm                   | 300 μm                 | 0.25 μm                               |
| Linearity*3                        |       | ±0.2% FS (entire range)  | ±0.2% FS (80 to 120 mm) | ±2% FS (200 to 400 mm) | ±0.2% FS (entire range)               | ±0.2% FS (32 to 48 mm)   | ±0.2% FS (80 to 120 mm) | ±2% FS (200 to 400 mm) | ±0.2% FS (entire range)               |
| Temperature characteristic*4       |       | ±0.03% FS/°C (Except for ZX-LD300 and ZX-LD300L, which are ±0.1% FS/°C.)   |                         |                        |                                       |  |                         |                        |                                       |
| Ambient illumination               |       | Incandescent lamp: 3,000 lx max. (on light receiving side)   |                         |                        |                                       |  |                         |                        |                                       |
| Ambient temperature                |       | Operating: 0 to 50°C, Storage: -15 to 60°C (with no icing or condensation)   |                         |                        |                                       |  |                         |                        |                                       |
| Ambient humidity                   |       | Operating and storage: 35% to 85% (with no condensation)   |                         |                        |                                       |  |                         |                        |                                       |
| Insulation resistance              |       | 20 MΩ min. at 500 VDC  |                         |                        |                                       |  |                         |                        |                                       |
| Dielectric strength                |       | 1,000 VAC, 50/60 Hz for 1 min  |                         |                        |                                       |  |                         |                        |                                       |
| Vibration resistance (destruction) |       | 10 to 150 Hz, 0.7-mm double amplitude 80 min each in X, Y, and Z directions  |                         |                        |                                       |  |                         |                        |                                       |
| Shock resistance (destruction)     |       | 300 m/s <sup>2</sup> 3 times each in six directions (up/down, left/right, forward/backward)                          |                         |                        |                                       |  |                         |                        |                                       |
| Degree of protection               |       | IEC60529, IP50   |                         |                        | IEC60529, IP40                        | IEC60529, IP50   |                         |                        | IEC60529, IP40                        |
| Connection method                  |       | Connector relay (standard cable length: 500 mm)  |                         |                        |                                       |  |                         |                        |                                       |
| Weight (packed state)              |       | Approx. 150 g  |                         |                        | Approx. 250 g                         | Approx. 150 g  |                         |                        | Approx. 250 g                         |
| Materials                          |       | Case: PBT (polybutylene terephthalate), Cover: Aluminum, Lens: Glass   |                         |                        | Case and cover: Aluminum, Lens: Glass | Case: PBT (polybutylene terephthalate), Cover: Aluminum, Lens: Glass |                         |                        | Case and cover: Aluminum, Lens: Glass |
| Accessories                        |       | Instruction sheet, Laser warning label (English)   |                         |                        |                                       |  |                         |                        |                                       |

\*1. Beam size: The beam size is defined by  $1/e^2$  (13.5%) of the strength of the beam at the beam center (measured value). Incorrect detection may occur if there is light leakage outside the defined spot and the material around the sensing object is more reflective than the sensing object.

\*2. Resolution: The resolution is the deviation ( $\pm 3\sigma$ ) in the linear output when connected to the ZX-LDA Amplifier Unit. (The resolution is measured with the standard reference object (white ceramic), at the measurement point with the ZX-LDA set for an average count of 4,096 per period.) The resolution is given at the repeat accuracy for a stationary workpiece, and is not an indication of the distance accuracy. The resolution may be adversely affected under strong electromagnetic fields.

\*3. Linearity: The linearity is given as the error in an ideal straight line displacement output when measuring the standard reference object. The linearity and measurement values vary with the object being measured.

\*4. Temperature characteristic: The temperature characteristic is measured at the measurement point with the Sensor and reference object (OMRON's standard reference object) secured with an aluminum jig.

**Note:** Highly reflective objects can result in incorrect detection by causing out-of-range measurements.

## ■ Sensor Heads (Through-beam)

| Item                              | Model  | ZX-LT001                        | ZX-LT005              | ZX-LT010             | ZX-LT030                    |
|-----------------------------------|--|---------------------------------|-----------------------|----------------------|-----------------------------|
| <b>Optical system</b>             | Through-beam   |                                 |                       |                      |                             |
| <b>Light source (wave length)</b> | Visible-light semiconductor laser with a wavelength of 650 nm<br>EN class 1, FDA class II        |                                 |                       |                      |                             |
| <b>Maximum output</b>             | 0.2 mW max.  |                                 | 0.35 mW max.          |                      | 0.2 mW max.                 |
| <b>Measurement width</b>          | 1-mm dia.  | 1- to 2.5-mm dia.               | 5 mm                  | 10 mm                | 30 mm                       |
| <b>Measurement distance</b>       | 0 to 500 mm  | 500 to 2,000 mm                 | 0 to 500 mm           |                      |                             |
| <b>Minimum sensing object</b>     | 8- $\mu$ m dia. (opaque)   | 8- to 50- $\mu$ m dia. (opaque) | 0.05-mm dia. (opaque) | 0.1-mm dia. (opaque) | 0.3-mm dia. (opaque)        |
| <b>Resolution*1</b>               | 4 $\mu$ m *2   | ---                             | 4 $\mu$ m *3          |                      | 12 $\mu$ m *4               |
| <b>Temperature characteristic</b> | $\pm$ 0.2% FS/ $^{\circ}$ C  |                                 |                       |                      | $\pm$ 0.3% FS/ $^{\circ}$ C |
| <b>Ambient illumination</b>       | Incandescent lamp: 10,000 lx max. (on light-receiving side)                                      |                                 |                       |                      |                             |
| <b>Ambient temperature</b>        | Operating: 0 to 50 $^{\circ}$ C, Storage: -25 to 70 $^{\circ}$ C (with no icing or condensation) |                                 |                       |                      |                             |
| <b>Ambient humidity</b>           | Operating: 35% to 85% (with no condensation)   |                                 |                       |                      |                             |
| <b>Degree of protection</b>       | IEC60529, IP40   |                                 |                       |                      |                             |
| <b>Connection method</b>          | Connector relay (standard cable length: 500 mm)  |                                 |                       |                      |                             |
| <b>Weight (packed state)</b>      | Approx. 220 g  |                                 |                       |                      | Approx. 450 g               |
| <b>Cable length</b>               | Extendable up to 10 m with special extension cable.  |                                 |                       |                      |                             |
| <b>Materials</b>                  | <b>Case</b>  | Polyetherimide                  |                       |                      | Zinc die-cast               |
|                                   | <b>Cover</b>   | Polycarbonate                   |                       |                      |                             |
|                                   | <b>Front filter</b>  | Glass                           |                       |                      |                             |
| <b>Tightening torque</b>          | 0.3 N·m max.   |                                 |                       |                      |                             |
| <b>Accessories</b>                | Instruction sheet, Sensor Head-Amplifier Connection Cable  |                                 |                       |                      | Mounting Bracket            |
|                                   | Optical axis adjustment seal   |                                 |                       |                      |                             |

\*1. This value is obtained by converting the deviation ( $\pm 3\sigma$ ) in the linear output that results when the sensor head is connected to the amplifier unit, into the measurement width.

\*2. For an average count of 64. The value is 5  $\mu$ m for an average count of 32.

This is the value that results when a minimum sensing object blocks the light near the center of the 1-mm measurement width.

\*3. For an average count of 64. The value is 5  $\mu$ m for an average count of 32.

\*4. For an average count of 64. The value is 15  $\mu$ m for an average count of 32.

## ■ Amplifier Units

| Item   | Model | ZX-LDA11-N   | ZX-LDA41-N  |
|--|-------|--|---|
| Measurement period*1   |       | 150 μs   |   |
| Possible average count settings                              |       | 1, 2, 4, 8, 16, 32, 64, 128, 256, 512, 1,024, 2,048, or 4,096  |   |
| Temperature characteristic                                   |       | When connected to a Reflective Sensor Head: 0.01% FS/°C, When connected to a Through-beam Sensor Head: 0.1% FS/°C  |   |
| Linear output*2  |       | Current output: 4 to 20 mA/FS, Max. load resistance: 300 Ω<br>Voltage output: ±4 V (± 5 V, 1 to 5 V *3), Output impedance: 100 Ω   |   |
| Judgement outputs (3 outputs: HIGH/PASS/LOW)*1               |       | NPN open-collector outputs, 30 VDC, 50 mA max. Residual voltage: 1.2 V max.  | PNP open-collector outputs, 30 VDC, 50 mA max. Residual voltage: 2 V max.                                     |
| Laser OFF input, zero reset input, timing input, reset input |       | ON: Short-circuited with 0-V terminal or 1.5 V or less<br>OFF: Open (leakage current: 0.1 mA max.)   | ON: Supply voltage short-circuited or supply voltage within 1.5 V<br>OFF: Open (leakage current: 0.1 mA max.) |
| Functions  |       | Measurement value display, present value/set value/light level/resolution display, scaling, display reverse, display OFF mode, ECO mode, number of display digit changes, sample hold, peak hold, bottom hold, peak-to-peak hold, self-peak hold, self-bottom hold, average hold, delay hold, intensity mode, zero reset, initial reset, ON-delay timer, OFF-delay timer, one-shot timer, deviation, previous value comparison, sensitivity adjustment, keep/clamp switch, direct threshold value setting, position teaching, 2-point teaching, automatic teaching, hysteresis width setting, timing inputs, reset input, monitor focus, linear output compensation, (A-B) calculations*4, (A+B) calculations*4, mutual interference*4, laser deterioration detection, zero reset memory, zero reset display, key lock |   |
| Indications  |       | Operation indicators: High (orange), pass (green), low (yellow), 7-segment main display (red), 7-segment subdisplay (yellow), laser ON (green), zero reset (green), enable (green)   |   |
| Power supply voltage   |       | 12 to 24 VDC ±10%, Ripple (p-p): 10% max.  |   |
| Current consumption  |       | 140 mA max. with power supply voltage of 24 VDC (with Sensor connected)  |   |
| Ambient temperature  |       | Operating and storage: 0 to 50°C (with no icing or condensation)   |   |
| Ambient humidity   |       | Operating and storage: 35% to 85% (with no condensation)   |   |
| Insulation resistance  |       | 20 MΩ min. at 500 VDC  |   |
| Dielectric strength  |       | 1,000 VAC, 50/60 Hz for 1 min  |   |
| Vibration resistance (destruction)                           |       | 10 to 150 Hz, 0.7-mm double amplitude 80 min each in X, Y, and Z directions  |   |
| Shock resistance (destruction)                               |       | 300 m/s <sup>2</sup> 3 times each in six directions (up/down, left/right, forward/backward)  |   |
| Connection method  |       | Prewired (standard cable length: 2 m)  |   |
| Weight (packed state)  |       | Approx. 350 g  |   |
| Materials  |       | Case: PBT (polybutylene terephthalate), Cover: Polycarbonate   |   |
| Accessories  |       | Instruction sheet  |   |

\*1. The response time for the first linear output or judgment output is calculated as follows (with fixed sensitivity): Measurement period × (Average count setting + 1). The response time for the second and later outputs is the measurement period specified in the table.

\*2. The output can be switched between a current output and voltage output using a switch on the bottom of the Amplifier Unit.

\*3. Setting is possible via the monitor focus function.

\*4. A Calculating Unit (ZX-CAL2) is required.

## ■ Calculating Unit

| Item                               | ZX-CAL2   |
|------------------------------------|---|
| Applicable Amplifier Units         | ZX-LDA11-N/41-N/ZX-EDA11/41/ZX-TDA11/41   |
| Current consumption                | 12 mA max. (supplied from the Smart Sensor Amplifier Unit)                                  |
| Ambient temperature                | Operating: 0 to 50°C, Storage: -15 to 60°C (with no icing or condensation)                  |
| Ambient humidity                   | Operating and storage: 35% to 85% (with no condensation)                                    |
| Connection method                  | Connector   |
| Dielectric strength                | 1,000 VAC, 50/60 Hz for 1 min   |
| Insulation resistance              | 100 MΩ (at 500 VDC)   |
| Vibration resistance (destructive) | 10 to 150 Hz, 0.7-mm double amplitude 80 min each in X, Y, and Z directions                 |
| Shock resistance (destructive)     | 300 m/s <sup>2</sup> 3 times each in six directions (up/down, left/right, forward/backward) |
| Materials                          | Display: Acrylic, Case: ABS resin   |
| Weight (packed state)              | Approx. 50 g  |

## ■ ZX-series Communications Interface Unit

| Item                               | ZX-SF11   | ZX-SF21   |
|------------------------------------|---|---|
| Current consumption                | 60 mA max. (supplied by the Amplifier Unit)   |   |
| Applicable Amplifier Units         | ZX Series   |   |
| Applicable Amplifier Unit versions | ZX-LDA□1-N Ver. 1.000 or higher<br>ZX-EDA□1 Ver. 1.100 or higher<br>ZX-TDA□1 Ver. 1.000 or higher   |   |
| Max. No. of Amplifier Units        | 5   |   |
| Communications functions           | Communications port   | RS-232C port (9-pin D-Sub Connector)   USB                                  |
|                                    | Communications protocol   | CompoWay/F*   |
|                                    | Baud rate   | 38,400 bps  |
|                                    | Data configuration  | Data bits: 8, Parity: none, Start bits: 1, Stop bits: 1, Flow control: none |
| Indicators                         | Power supply: green, Sensor communications: green, Sensor communications error: red, External terminal communications: green, External terminal communications error: red |   |
| Protective circuits                | Reverse polarity protection   |   |
| Ambient temperature                | Operating: 0 to 50°C, storage: -15 to 60°C (with no icing or condensation)  |   |
| Ambient humidity                   | Operating and storage: 35% to 85% (with no condensation)  |   |
| Insulation resistance              | 20 MΩ min. (at 500 VDC)   |   |
| Dielectric strength                | 1,000 VAC, 50/60 Hz for 1 min, Leakage current: 10 mA max.  |   |
| Materials                          | Case: PBT (polybutylene terephthalate), Cover: Polycarbonate  |   |
| Accessories                        | Instruction sheet, 2 clamps   |   |

\* Contact your OMRON representative for CompoWay/F communications specifications.

# Engineering Data (Typical)


## Angle Characteristic (Reflective Sensors)

The angle characteristic plots the relation between the inclination of the measurement object and the error in the linear output at the measurement point.


**Note:** SUS304 = Stainless steel SUS304

### ● ZX-LD40

#### Side-to-side Inclination

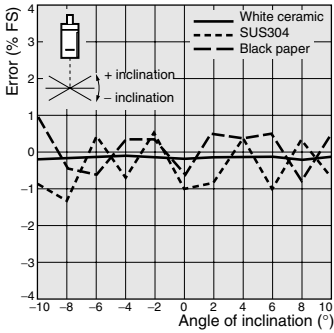


#### Front-to-back Inclination

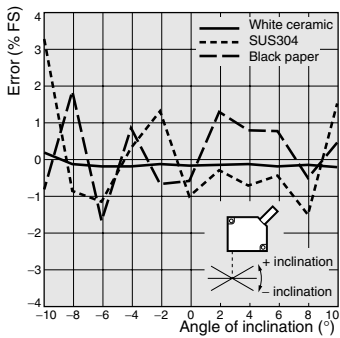


### ● ZX-LD40L

#### Side-to-side Inclination

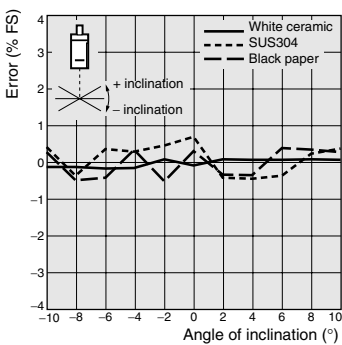


#### Front-to-back Inclination

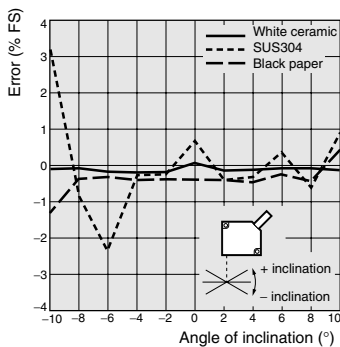


### ● ZX-LD100

#### Side-to-side Inclination

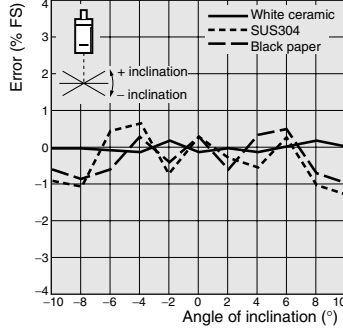


#### Front-to-back Inclination

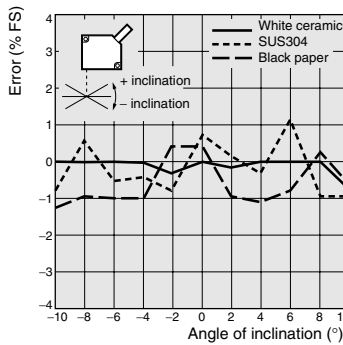


### ● ZX-LD100L

#### Side-to-side Inclination

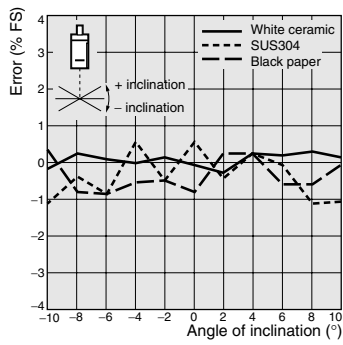


#### Front-to-back Inclination

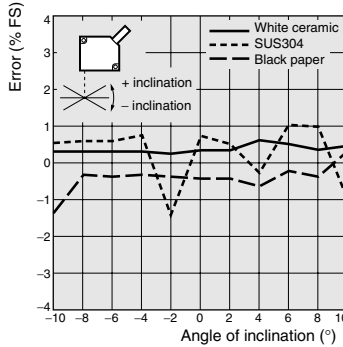


### ● ZX-LD300

#### Side-to-side Inclination

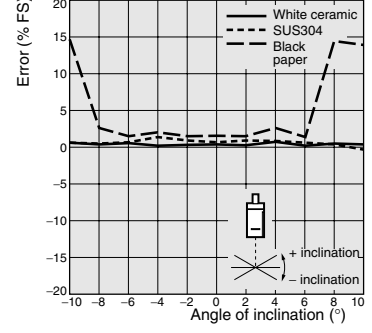


#### Front-to-back Inclination

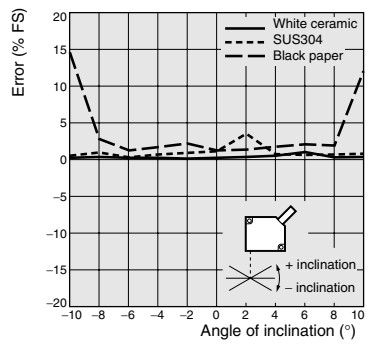


### ● ZX-LD300L

#### Side-to-side Inclination

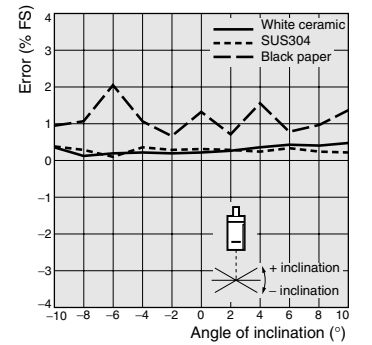


#### Front-to-back Inclination

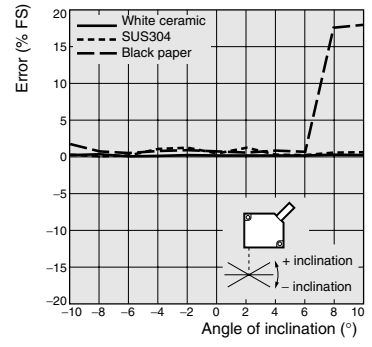


● ZX-LD30V

Side-to-side Inclination

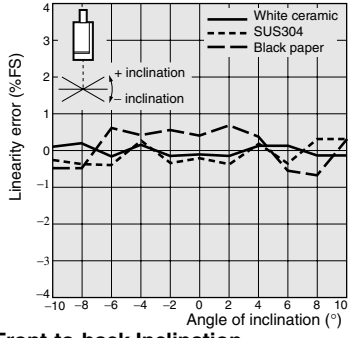


Front-to-back Inclination

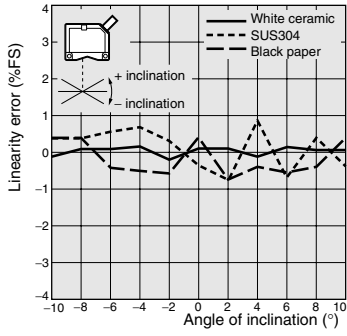


● ZX-LD30VL

Side-to-side Inclination

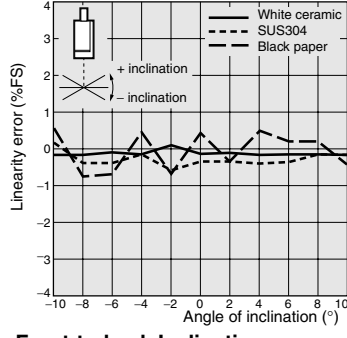

Front-to-back Inclination

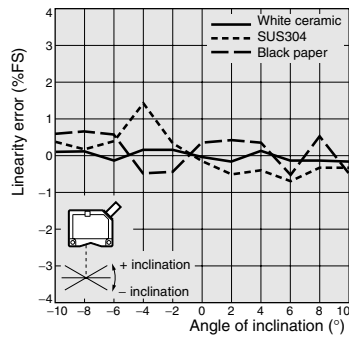





Linearity Characteristic for Different Materials (Reflective Sensors)

● ZX-LD40


0° Inclination

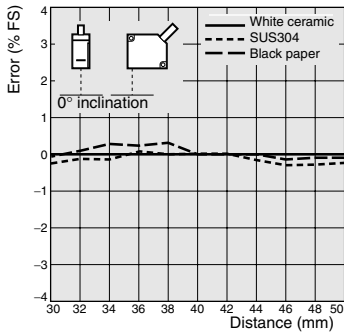

-10° Inclination Front-to-back

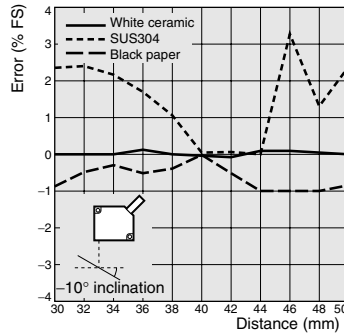


10° Inclination

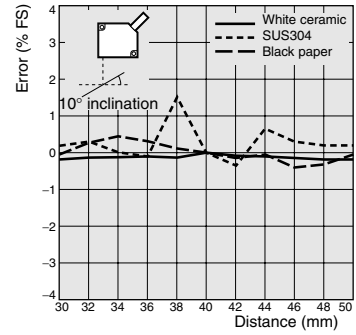


● ZX-LD100


0° Inclination

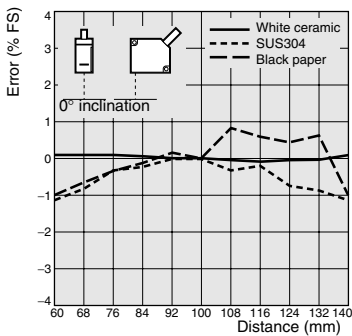

-10° Inclination Front-to-back

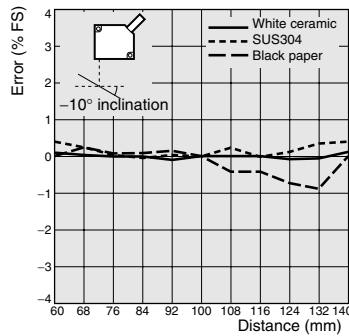


10° Inclination

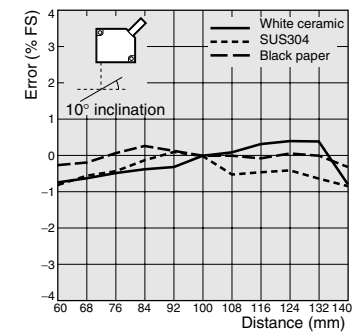


● ZX-LD300


0° Inclination

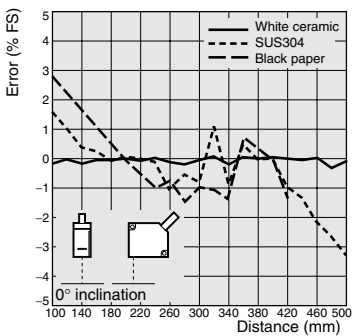

-10° Inclination Front-to-back

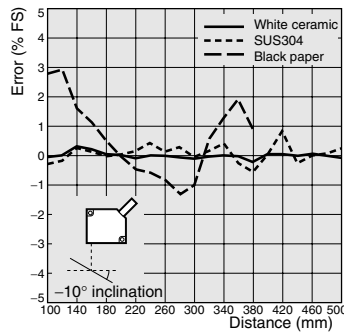


10° Inclination

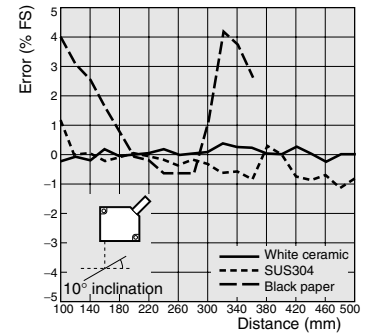


● ZX-LD40L


0° Inclination

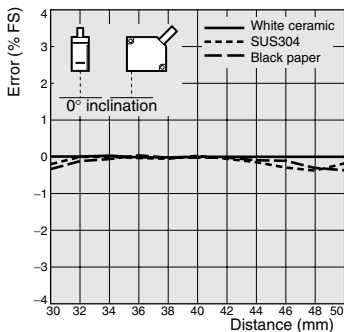

-10° Inclination Front-to-back

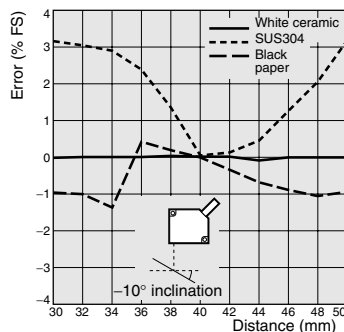


10° Inclination

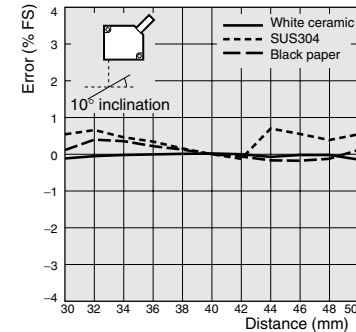


● ZX-LD100L


0° Inclination

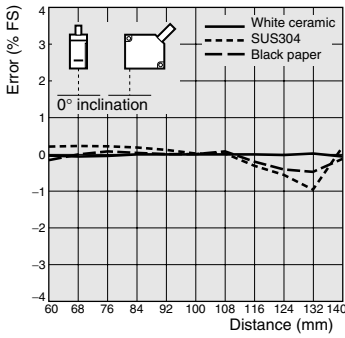

-10° Inclination Front-to-back

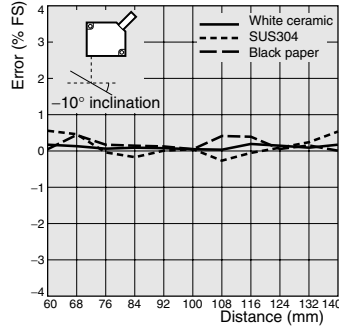


10° Inclination

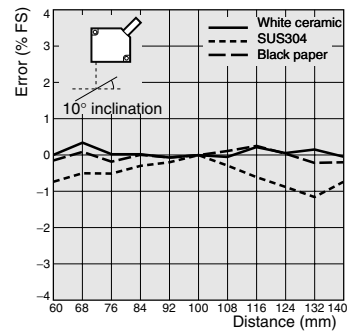


● ZX-LD300L


0° Inclination

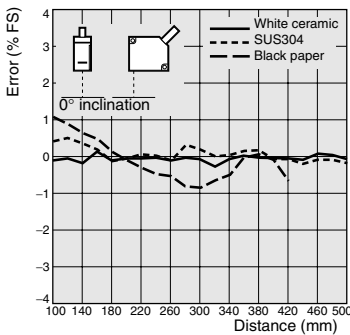

-10° Inclination Front-to-back

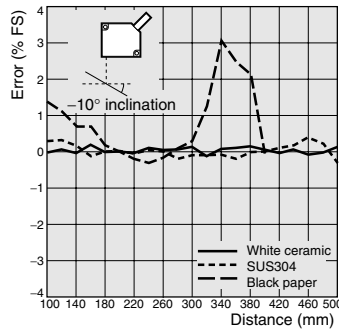


10° Inclination

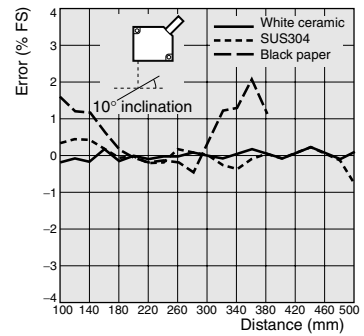


● ZX-LD30V


0° Inclination

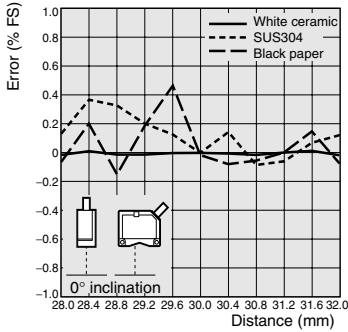

-10° Inclination Front-to-back

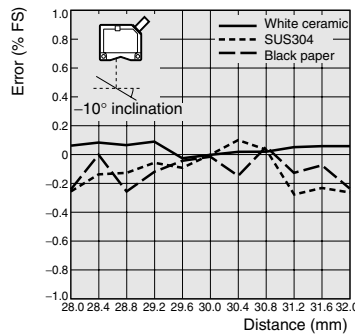


10° Inclination

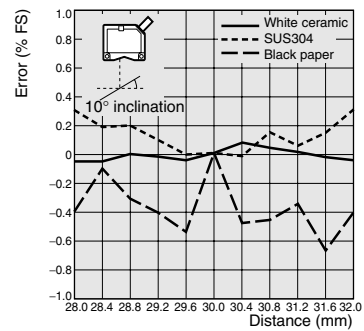


● ZX-LD30VL


0° Inclination

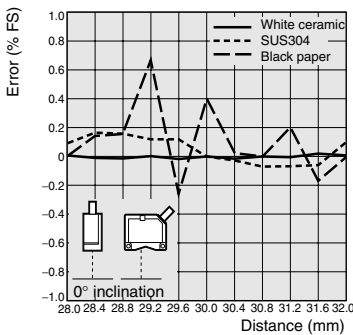

-10° Inclination Front-to-back

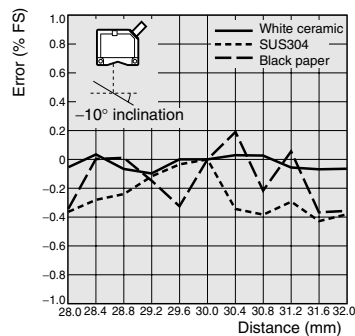


10° Inclination

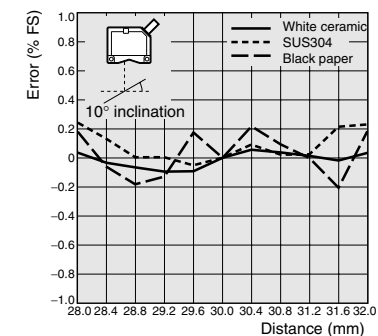

## Beam Size (Reflective Sensors)

### ● Spot Beams

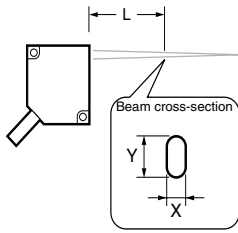

#### ZX-LD40

| L | 30 mm  | 40 mm   | 50 mm  |
|---|--------|---------|--------|
| X | 240 μm | 40.0 μm | 250 μm |
| Y | 350 μm | 30.0 μm | 370 μm |


#### ZX-LD100

| L | 60 mm  | 100 mm  | 140 mm |
|---|--------|---------|--------|
| X | 390 μm | 100 μm  | 430 μm |
| Y | 620 μm | 65.0 μm | 650 μm |

#### ZX-LD300

| L | 100 mm   | 300 mm | 500 mm   |
|---|----------|--------|----------|
| X | 1,050 μm | 180 μm | 1,100 μm |
| Y | 450 μm   | 300 μm | 850 μm   |

### ● Line Beams

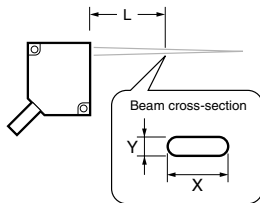

#### ZX-LD40L

| L | 30 mm    | 40 mm    | 50 mm    |
|---|----------|----------|----------|
| X | 2,000 μm | 2,000 μm | 2,000 μm |
| Y | 240 μm   | 50.0 μm  | 250 μm   |


#### ZX-LD100L

| L | 60 mm    | 100 mm   | 140 mm   |
|---|----------|----------|----------|
| X | 2,000 μm | 2,000 μm | 2,000 μm |
| Y | 410 μm   | 100 μm   | 430 μm   |

#### ZX-LD300L

| L | 100 mm   | 300 mm   | 500 mm   |
|---|----------|----------|----------|
| X | 2,000 μm | 2,000 μm | 2,500 μm |
| Y | 750 μm   | 300 μm   | 650 μm   |


### ● Spot Beams

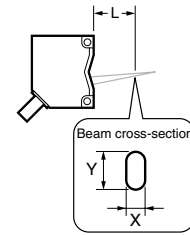

#### ZX-LD30V

| L | 28 mm   | 30 mm   | 32 mm   |
|---|---------|---------|---------|
| X | 60.0 μm | 30.0 μm | 120 μm  |
| Y | 50.0 μm | 40.0 μm | 90.0 μm |

### ● Line Beams

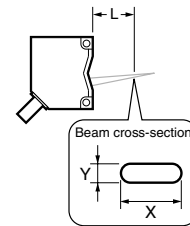


#### ZX-LD30VL

| L | 28 mm    | 30 mm    | 32 mm    |
|---|----------|----------|----------|
| X | 1,800 μm | 1,800 μm | 1,800 μm |
| Y | 90.0 μm  | 60.0 μm  | 110 μm   |

Sensing Object Characteristics (Through-beam Sensors)


● ZX-LT001

(For 0.02-mm-dia. pin gauge)

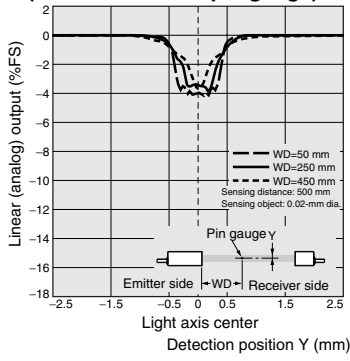


● ZX-LT001

(For 0.05-mm-dia. pin gauge)

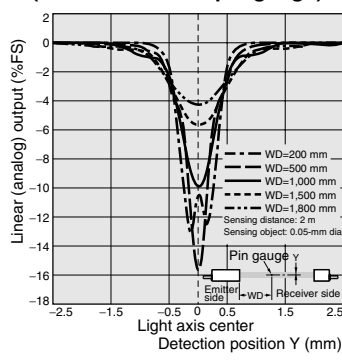


● ZX-LT005

(For 0.05-mm-dia. pin gauge)

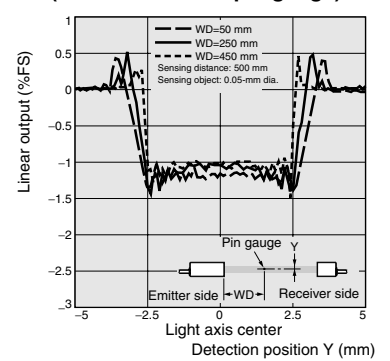


● ZX-LT010

(For 0.1-mm-dia. pin gauge)

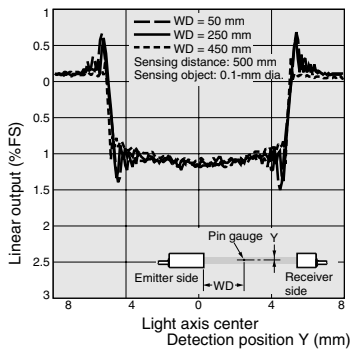


Linearity Characteristics

● ZX-LT005

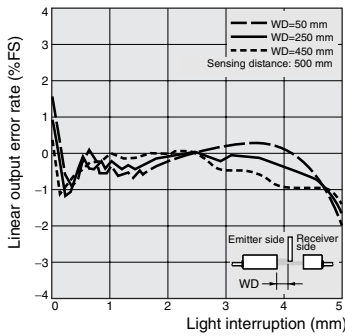

● ZX-LT010

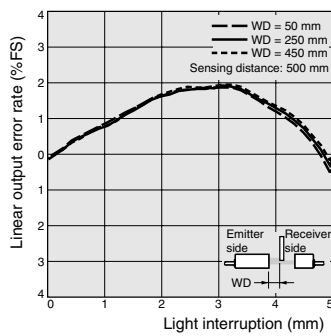


# Linear Output vs. Sensing Distance


The output can be switched between a current output and a voltage output using a switch on the Amplifier Unit.

## ZX-LD40/LD40L

### Current Output

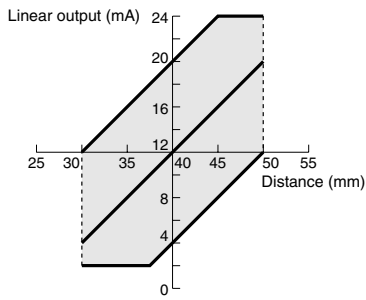


### Voltage Output

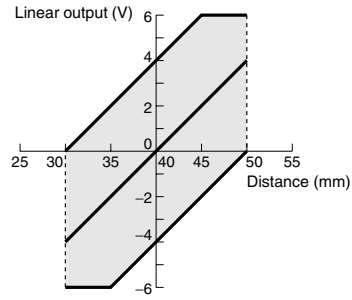


## ZX-LD100/LD100L

### Current Output

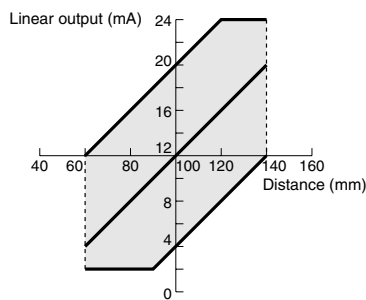


### Voltage Output

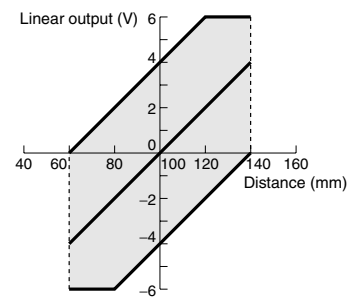


## ZX-LD300/LD300L

### Current Output

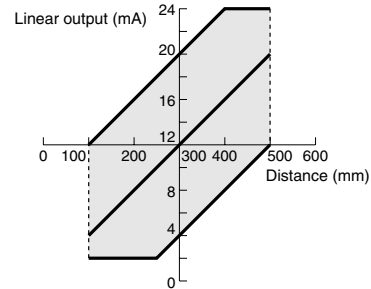


### Voltage Output

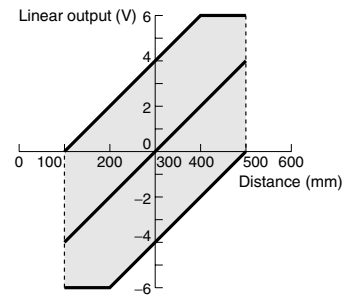


## ZX-LD30V/LD30VL

### Current Output

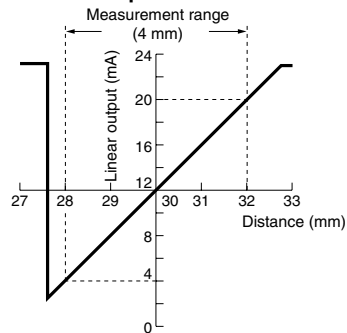


### Voltage Output

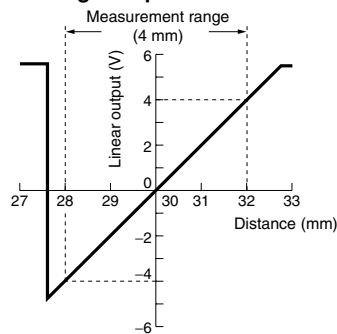


# I/O Circuit Diagrams


**NPN Amplifier Unit: ZX-LDA11-N**

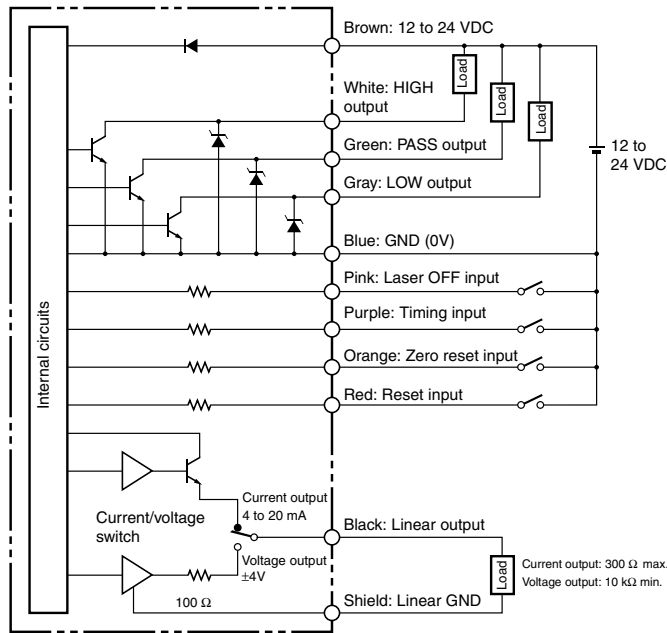

**PNP Amplifier Unit: ZX-LDA41-N**

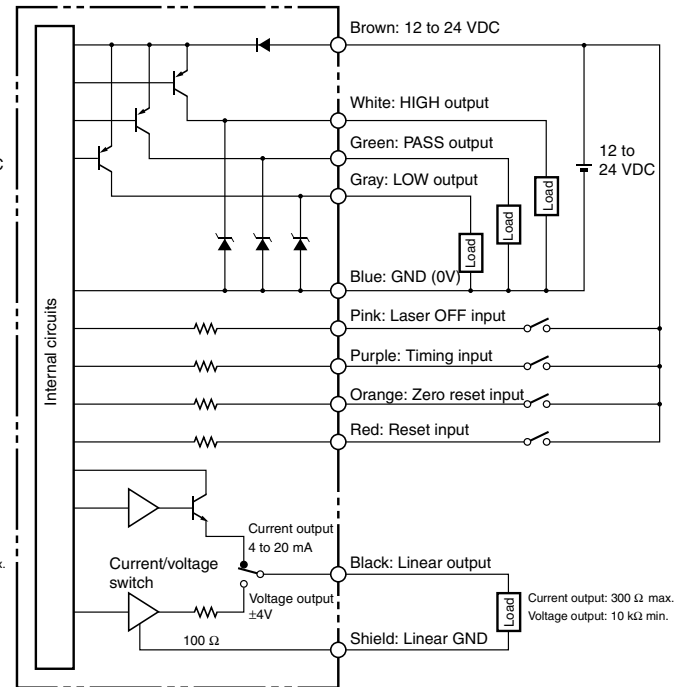

## Connections: Amplifier Unit

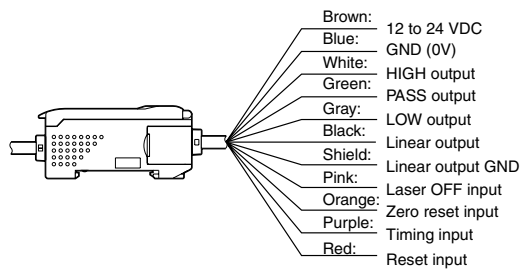


- Note 1.** Use a separate stabilized power supply for the Amplifier Unit, particularly when high resolution is required.
- 2.** Wire the Unit correctly. Incorrect wiring may result in damage to the Unit. (Do not allow wiring, particularly the linear output, to come into contact with other lines.)
- 3.** Use the 0-V line (blue) for the power supply and use the shield wire (linear output ground) together with the linear output (black line) for linear output. Each of these grounds must be used for the designed purpose. When not using the linear output, connect the linear ground (shield) to the 0-V ground.

# Part Names


## Sensor Heads (Reflective)

- ZX-LD40
- ZX-LD100
- ZX-LD300
- ZX-LD40L
- ZX-LD100L
- ZX-LD300L
- ZX-LD30V\*
- ZX-LD30VL\*

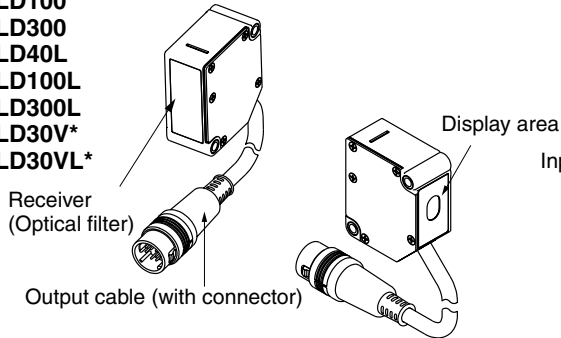

## Amplifier Units


- ZX-LDA11-N
- ZX-LDA41-N

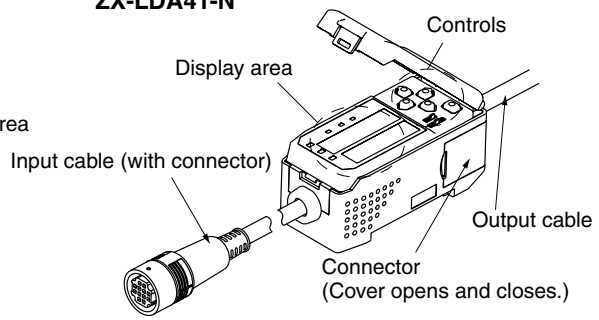

\*The dimensions for these models are slightly different. Refer to page 23 for details.


## Sensor Heads (Through-beam)

- ZX-LT001
- ZX-LT005
- ZX-LT010
- ZX-LT030

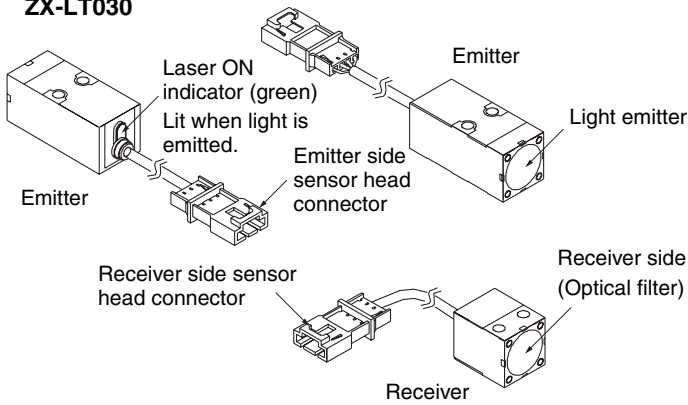

## Calculating Unit

- ZX-CAL2

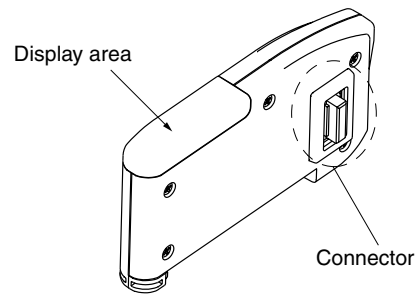

# Precautions

## ■ Design Precautions

### Ratings and Performance

- Conform to the specified ratings and performance. Refer to *Specifications* for details.
  1. Do not impose voltage exceeding the rated voltage, otherwise the Sensor may be damaged.
  2. When supplying power to the Sensor, make sure that the polarity of the power is correct, otherwise, the Sensor may be damaged. Do not connect to an AC power supply.
  3. Do not short-circuit the load for the open collector output, otherwise the Sensor may be damaged.
- Do not disconnect the connector connecting the Sensor Head and the controller while power is being supplied, otherwise the Sensor may be damaged.
- Allow a warm-up period of approximately 10 minutes after turning ON the power supply.
- Objects of certain materials or shapes may not be detectable, or the detection accuracy may not be sufficiently high. These include materials that are transparent or have extremely low reflectivity, and objects that are smaller than the Sensor's spot diameter or have extreme curvature or inclination.

### Power Supply and Wiring

- Prior to turning ON the power supply after wiring is completed, check to make sure that the power supply is correct, that there are no mistaken connections, e.g., connections that would short-circuit the load, and that the load current is appropriate. Incorrect wiring may result in damage to the Sensor or Unit.
- The total length of the Sensor cable or Amplifier cable must be 10 m or less. Use an ZX-XC□A Extension Cable (order separately) if required to extend the cable from the Sensor. Use a shielded cable to extend the Amplifier cable. The shielded cable must be the same as that of the Amplifier cable.
- Do not lay a power supply cable for the ZX together with high-voltage lines or power lines to prevent interference, damage, and malfunction.
- When using a commercially available switching regulator, ground the FG (frame ground) terminal.
- If the power supply line is subject to surges, connect a surge absorber that meets the conditions of the usage environment.
- When using a Calculating Unit, connect the corresponding linear ground of the Amplifier Unit.

### Compatibility

- All Sensor Heads and Amplifier Units are compatible. Different Sensor Heads may be purchased at a later date and used with existing Amplifier Units.

### Mutual Interference

- Two Sensor Heads can be used together, without danger of mutual interference, by connecting the ZX-CAL 2 Calculating Unit between two Amplifier Units.

### Maintenance

- Always turn OFF the power supply before adjusting or removing the Sensor Head.
- Cleaning
 

Do not use thinners, benzine, acetone, or kerosene for cleaning. If dust or oil adheres to the filter on the front of the Sensor Head, use the following procedure to clean.

  1. Use a blower brush (used to clean camera lenses) to blow large dust particles from the surface. Do not blow the dust away with your mouth.
  2. Use a soft cloth (for lenses) with a small amount of alcohol to remove the remaining dust. Do not use a scrubbing action when cleaning because scratches on the filter could result in Sensor inaccuracy.

## ■ Other Precautions

### Environment

1. Do not use the Sensor in strong electromagnetic fields or in an environment where the operation of the Sensor is subject to the reflection of intense light (such as other laser beams or electric arc-welding machines.)
2. Do not operate the Sensor in the following locations:
  - Locations subject to strong vibration.
  - Locations subject to direct sunlight or near heating equipment.
  - Locations subject to high humidity.
  - Locations where the Sensor would accumulate dust, dirt, metallic powder, etc.
  - Locations subject to corrosive or flammable gases.
  - Locations subject to exposure to organic solvents, water, oil, etc.
  - Locations subject to strong electromagnetic or electrical fields.
  - Locations subject to rapid changes in temperature.
  - Locations subject to freezing.



# Laser Safety

The ZX-LD-Series Sensor Heads are FDA Class II and EN Class 2 Laser Products. The ZX-LT-Series Sensor Heads are FDA Class II and EN Class 1 Laser Products. The ZX Series is meant to be built into final system equipment. Pay special attention to the following precautions for the safe use of the product:

**Note:** Europe: Class 1 and Class 2 of EN60825-1: 1994 = IEC825-1: 1993  
 U.S.A.: Class I and Class II of FDA (21 CFR1040.10)

1. Use this product as specified in this instruction manual. Otherwise, you may be exposed to hazardous laser radiation.
2. The ZX-series Smart Sensors radiate laser beams in the visible light range. Do not expose your eyes directly to the laser radiation. Ensure that the laser beam path is terminated during use. If a mirror or shiny surface is positioned in the laser beam path, ensure that the reflected beam path is also terminated. If the Unit must be used without terminating the laser beam path, position the laser beam path so that it is not at eye level.
3. To avoid exposure to hazardous laser radiation, do not displace nor remove the protective housing during operation, maintenance, and any other servicing.
4. The user should return the product to OMRON for all repair and servicing.
5. As for other countries, observe the regulations and standards specified by each country.



## Requirements from Regulations and Standards

### EN60825-1 “Safety of Laser Products, Equipment Classification, Requirements and User’s Guide”

#### ● Summary of Manufacturer’s Requirements

| Requirements;<br>Sub-clause            | Classification   |   |  |  |  |
|--|--|---|--|--|--|
|  | Class 1  | Class 2   | Class 3A   | Class 3B*  | Class 4  |
| Description of hazard class            | Safe under reasonably foreseeable conditions   | Low power; eye protection normally afforded by aversion responses | Same as Class 2. Direct intrabeam viewing with optical aids may be hazardous                                   | Direct intrabeam viewing may be hazardous  | High power; diffused reflection may be hazardous |
| Protective housing                     | Required for each laser product; limits access necessary for performance of functions of the products                            |   |  |  |  |
| Safety interlock in protective housing | Designed to prevent removal of the panel until accessible emission values are below the AEL (see note 2) for the class assigned  |   |  |  |  |
| Remote control                         | Not required   |   |  | Permits easy addition of external interlock in laser installation  |  |
| Key control                            | Not required   |   |  | Laser inoperative when key is removed  |  |
| Emission warning device                | Not required   |   |  | Gives audible or visible warning when laser is switched on or if capacitor bank of pulsed laser is being charged |  |
| Attenuator                             | Not required   |   |  | Gives means beside ON/OFF switch to temporarily block beam   |  |
| Location controls                      | Not required   |   | Controls so located that there is no danger of exposure to AEL above Classes 1 or 2 when adjustments are made. |  |  |
| Viewing optics                         | Emission from all viewing systems must be below Class 1 AEL's as applicable  |   |  |  |  |
| Scanning                               | Scan failure shall not cause product to exceed its classification  |   |  |  |  |
| Class label                            | Required wording   | Figures A and B and specified wording                             |  |  |  |
| Aperture label                         | Not required   |   |  | Specified wording required   |  |
| Service entry label                    | Required as appropriate to the class of accessible radiation   |   |  |  |  |
| Override interlock label               | Required under certain conditions as appropriate to the class of laser used  |   |  |  |  |
| User information                       | Operation manuals must contain instructions for safe use   |   |  |  |  |
| Purchasing and service information     | Promotion brochures must reproduce classification labels; service manuals must contain safety information                        |   |  |  |  |
| Medical products                       | Special calibration instructions required  |   |  | Special calibration instructions, means for measurement and target-indicator required                            |  |
| Fibre optic                            | Cable service connections require tool to disconnect if disconnection breaks protective housing and permits access above Class 1 |   |  |  |  |

\*With respect to the requirements of remote interlock connector, key control, emission warning and attenuator, Class 3B laser products not exceeding five times the AEL of Class 2 in the wavelength range of 400 nm to 700 nm are to be treated as Class 3A laser products.

**Note 1.** This table is intended to provide a convenient summary of requirements. See text of this standard for complete requirements.

2. AEL: Accessible Emission Limit

The maximum accessible emission level permitted within a particular class.  
For your reference, see ANSI Z136.1-1993, Section 2.

Symbol and border: black  
Background: yellow



**Figure A Warning label - Hazard symbol**

Legend and border: black  
Background: yellow



**Figure B Explanatory label**

● FDA (Compliance Guide for Laser Products, 1985, according to 21 CFR1040.10)

| Requirements                            | Class (see note 1) |                    |                    |                    |                    |                    |
|---|--------------------|--------------------|--------------------|--------------------|--------------------|--------------------|
|   | I                  | Ila                | II                 | IIla               | IIlb               | IV                 |
| Performance (all laser products)        |                    |                    |                    |                    |                    |                    |
| Protective housing                      | R (see note 2)     | R (see note 2)     | R (see note 2)     | R (see note 2)     | R (see note 2)     | R (see note 2)     |
| Safety interlock                        | R (see notes 3, 4) | R (see notes 3, 4) | R (see notes 3, 4) | R (see notes 3, 4) | R (see notes 3, 4) | R (see notes 3, 4) |
| Location of controls                    | N/A                | R                  | R                  |                    | R                  | R                  |
| Viewing optics                          | R                  | R                  | R                  | R                  | R                  | R                  |
| Scanning safeguard                      | R                  | R                  | R                  | R                  | R                  | R                  |
| Performance (laser systems)             |                    |                    |                    |                    |                    |                    |
| Remote control connector                | N/A                | N/A                | N/A                | N/A                | R                  | R                  |
| Key control                             | N/A                | N/A                | N/A                | N/A                | R                  | R                  |
| Emission indicator                      | N/A                | N/A                | R                  | R                  | R (see note 10)    | R (see note 10)    |
| Beam attenuator                         | N/A                | N/A                | R                  | R                  | R                  | R                  |
| Reset                                   | N/A                | N/A                | N/A                | N/A                | N/A                | R (see note 13)    |
| Performance (specific purpose products) |                    |                    |                    |                    |                    |                    |
| Medical                                 | S                  | S                  | S                  | S (see note 8)     | S (see note 8)     | S (see note 8)     |
| Surveying, leveling, alignment          | S                  | S                  | S                  | S                  | NP                 | NP                 |
| Demonstration                           | S                  | S                  | S                  | S                  | S (see note 11)    | S (see note 11)    |
| Labeling (all laser products)           |                    |                    |                    |                    |                    |                    |
| Certification & identification          | R                  | R                  | R                  | R                  | R                  | R                  |
| Protective housing                      | D (see note 5)     | D (see note 5)     | D (see note 5)     | D (see note 5)     | D (see note 5)     | D (see note 5)     |
| Aperture                                | N/A                | N/A                | R                  | R                  | R                  | R                  |
| Class warning                           | N/A                | R (see note 6)     | R (see note 7)     | R (see note 9)     | R (see note 12)    | R (see note 12)    |
| Information (all laser products)        |                    |                    |                    |                    |                    |                    |
| User information                        | R                  | R                  | R                  | R                  | R                  | R                  |
| Product literature                      | N/A                | R                  | R                  | R                  | R                  | R                  |
| Service information                     | R                  | R                  | R                  | R                  | R                  | R                  |

Abbreviations:

- R: Required.
- N/A: Not applicable.
- S: Requirements: Same as for other products of that Class. Also see footnotes.
- NP: Not permitted.
- D: Depends on level of interior radiation.

Footnotes:

1. Based on highest level accessible during operation.
2. Required wherever & whenever human access to laser radiation above Class I limits is not needed for product to perform its function.
3. Required for protective housings opened during operation or maintenance, if human access thus gained is not always necessary when housing is open.
4. Interlock requirements vary according to Class of internal radiation.
5. Wording depends on level & wavelength of laser radiation within protective housing.
6. Warning statement label.
7. CAUTION logotype.
8. Requires means to measure level of laser radiation intended to irradiate the body.
9. CAUTION if 2.5 mW cm<sup>2</sup> or less, DANGER if greater than 2.5 mW cm<sup>2</sup>.
10. Delay required between indication & emission.
11. Variance required for Class IIb or IV demonstration laser products and light shows.
12. DANGER logotype.
13. Required after August 20, 1986.

## Use Precautions

### ● EN60825-1

| Requirements;<br>Sub-clause | Classification  |  |  |   |                       |
|-----------------------------|-----------------|--|--|---|-----------------------|
|                             | Class 1         | Class 2                                | Class 3A   | Class 3B*                                 | Class 4               |
| Remote interlock            | Not required    |  |  | Connect to room or door circuits          |                       |
| Key control                 | Not required    |  |  | Remove key when not in use                |                       |
| Beam attenuator             | Not required    |  |  | When in use prevents inadvertent exposure |                       |
| Emission indicator device   | Not required    |  |  | Indicates laser is energized              |                       |
| Warning signs               | Not required    |  |  | Follow precautions on warning signs       |                       |
| Beam path                   | Not required    | Terminate beam at end of useful length |  |   |                       |
| Specular reflection         | No requirements |  |  | Prevent unintentional reflections         |                       |
| Eye protection              | No requirements |  | Required if engineering and administrative procedures not practicable and MPE exceeded |   |                       |
| Protective clothing         | No requirements |  |  | Sometimes required                        | Specific requirements |
| Training                    | No requirements |  | Required for all operator and maintenance personnel                                    |   |                       |

\*With respect to the requirements of remote interlock connector, key control, beam attenuator, and emission indicator, Class 3B laser products not exceeding five times the AEL of Class 2 in the wavelength range of 400 nm to 700 nm are to be treated as Class 3A laser products.

**Note:** This table is intended to provide a convenient summary of requirements. See text of this standard for complete precautions.

### ● ANSI Z136.1:1993 “American National Standard for the Safe Use of Lasers” Control Measures for the Four Laser Classes

| Control measures                          | Classification                                      |          |          |                   |          |          |
|---|---|----------|----------|-------------------|----------|----------|
|   | 1   | 2a       | 2        | 3a                | 3b       | 4        |
| Engineering Controls                      | 1   | 2a       | 2        | 3a                | 3b       | 4        |
| Protective Housing (4.3.1)                | X   | X        | X        | X                 | X        | X        |
| Without Protective Housing (4.3.1.1)      | LSO (see note 2) shall establish Alternate Controls |          |          |                   |          |          |
| Interlocks on Protective Housing (4.3.2)  | ☆   | ☆        | ☆        | ☆                 | X        | X        |
| Service Access Panel (4.3.3)              | ☆   | ☆        | ☆        | ☆                 | X        | X        |
| Key Control (4.3.4)                       | ---   | ---      | ---      | ---               | •        | X        |
| Viewing Portals (4.3.5.1)                 | ---   | ---      | MPE      | MPE               | MPE      | MPE      |
| Collecting Optics (4.3.5.2)               | MPE   | MPE      | MPE      | MPE               | MPE      | MPE      |
| Totally Open Beam Path (4.3.6.1)          | ---   | ---      | ---      | ---               | X<br>NHZ | X<br>NHZ |
| Limited Open Beam Path (4.3.6.2)          | ---   | ---      | ---      | ---               | X<br>NHZ | X<br>NHZ |
| Enclosed Beam Path (4.3.6.3)              | None is required if 4.3.1 and 4.3.2 fulfilled       |          |          |                   |          |          |
| Remote Interlock Connector (4.3.7)        | ---   | ---      | ---      | ---               | •        | X        |
| Beam Stop or Attenuator (4.3.8)           | ---   | ---      | ---      | ---               | •        | X        |
| Activation Warning Systems (4.3.9)        | ---   | ---      | ---      | ---               | •        | X        |
| Emission Delay (4.3.9.1)                  | ---   | ---      | ---      | ---               | ---      | X        |
| Indoor Laser Controlled Area (4.3.10)     | ---   | ---      | ---      | ---               | X<br>NHZ | X<br>NHZ |
| Class 3b Laser Controlled Area (4.3.10.1) | ---   | ---      | ---      | ---               | X        | ---      |
| Class 4 Laser Controlled Area (4.3.10.2)  | ---   | ---      | ---      | ---               | ---      | X        |
| Laser Outdoor Controls (4.3.11)           | ---   | ---      | ---      | ---               | X<br>NHZ | X<br>NHZ |
| Laser in Navigable Airspace (4.3.11.2)    | ---   | ---      | ---      | •                 | •        | •        |
| Temporary Laser Controlled Area (4.3.12)  | ☆<br>MPE  | ☆<br>MPE | ☆<br>MPE | ☆<br>MPE          | ---      | ---      |
| Remote Firing & Monitoring (4.3.13)       | ---   | ---      | ---      | ---               | ---      | •        |
| Labels (4.3.14 and 4.7)                   | X   | X        | X        | X                 | X        | X        |
| Area Posting (4.3.15)                     | ---   | ---      | ---      | •                 | X<br>NHZ | X<br>NHZ |
| Administrative & Procedural Controls      | 1   | 2a       | 2        | 3a                | 3b       | 4        |
| Standard Operating Procedures (4.4.1)     | ---   | ---      | ---      | ---               | •        | X        |
| Output Emission Limitations (4.4.2)       | ---   | ---      | ---      | LSO Determination |          |          |
| Education and Training (4.4.3)            | ---   | ---      | •        | •                 | X        | X        |
| Authorized Personnel (4.4.4)              | ---   | ---      | ---      | ---               | X        | X        |
| Alignment Procedures (4.4.5)              | ---   | ---      | X        | X                 | X        | X        |

| Control measures                                     | Classification      |          |          |          |          |          |
|--|---------------------|----------|----------|----------|----------|----------|
|  | ---                 | ---      | ---      | ---      | •        | X        |
| Protective Equipment (4.4.6)                         | ---                 | ---      | ---      | ---      | •        | X        |
| Spectator (4.4.7)                                    | ---                 | ---      | ---      | ---      | •        | X        |
| Service Personnel (4.4.8)                            | ☆<br>MPE            | ☆<br>MPE | ☆<br>MPE | ☆<br>MPE | X        | X        |
| Demonstration with General Public (4.5.1)            | MPE †               | ---      | X        | X        | X        | X        |
| Laser Optical Fiber Systems (4.5.2)                  | MPE                 | MPE      | MPE      | MPE      | X        | X        |
| Laser Robotic Installations (4.5.3)                  | ---                 | ---      | ---      | ---      | X<br>NHZ | X<br>NHZ |
| Eye Protection (4.6.2)                               | ---                 | ---      | ---      | ---      | •<br>MPE | X<br>MPE |
| Protective Windows (4.6.3)                           | ---                 | ---      | ---      | ---      | X<br>NHZ | X<br>NHZ |
| Protective Barriers and Curtains (4.6.4)             | ---                 | ---      | ---      | ---      | •        | •        |
| Skin Protection (4.6.5)                              | ---                 | ---      | ---      | ---      | X<br>MPE | X<br>MPE |
| Other Protective Equipment (4.6.5)                   | Use may be required |          |          |          |          |          |
| Warning Signs and Labels (4.7) (Design Requirements) | ---                 | ---      | •        | •        | X<br>NHZ | X<br>NHZ |
| Service and Repairs (4.8)                            | LSO Determination   |          |          |          |          |          |
| Modification of Laser Systems (4.9)                  | LSO Determination   |          |          |          |          |          |

**Note 1. LEGEND**

- X: Shall
- : Should
- : No requirement
- ☆: Shall if enclosed Class 3b or Class 4
- MPE: Shall if MPE is exceeded
- NHZ: Nominal Hazard Zone analysis required
- †: Applicable only to UV and IR Lasers (4.5.1.2)

**2. LSO: Laser Safety Officer**

An individual shall be designated the Laser Safety Officer with the authority and responsibility to monitor and enforce the control of laser hazards, and to effect the knowledgeable evaluation and control of laser hazards.  
 For your reference, see ANSI Z136.1-1993, Section 1.3.

**Laser Product Classifications**

● EN

| Class    | Description   |
|----------|---|
| Class 1  | Lasers which are safe under reasonably foreseeable conditions of operation.   |
| Class 2  | Lasers emitting visible radiation in the wavelength range from 400 nm to 700 nm. Eye protection is normally afforded by aversion responses including the blink reflex.  |
| Class 3A | Lasers which are safe for viewing with the unaided eye. For laser emitting in the wavelength range from 400 nm to 700 nm, protection is afforded by aversion responses including the blink reflex. For other wavelengths the hazard to the unaided eye is no greater than for Class 1. Direct intrabeam viewing of Class 3A lasers with optical aides (e.g., binoculars, telescopes, microscopes) may be hazardous. |
| Class 3B | Direct intrabeam viewing of these lasers is always hazardous. Viewing diffuse reflections is normally safe (see note).  |
| Class 4  | Lasers which are also capable of producing hazardous diffuse reflections. They may cause skin injuries and could also constitute a fire hazard. Their use requires extreme caution.   |


**Note:** Conditions for safe viewing of diffuse reflections for Class 3B visible lasers are: minimum viewing distance of 13 cm between screen and cornea and a maximum viewing time of 10 s. Other viewing conditions require a comparison of the diffuse reflection exposure with the MPE.

## Comparison of Classifications between FDA and ANSI

| Class         | FDA definition   | ANSI description  |
|---------------|--|---|
| Class I/1     | Limits applicable to devices that have emissions in the ultraviolet, visible, and infrared spectra, and limits below which biological hazards have not been established.   | A Class 1 laser is considered to be incapable of producing damaging radiation levels during operation and maintenance and is, therefore, exempt from any control measures or other forms of surveillance.                                   |
| Class IIa/2a  | Limits applicable to products whose visible emission does not exceed Class I limits for emission durations of 1,000 seconds or less and are not intended for viewing.  | Class 2 lasers are divided into two subclasses, 2 and 2a. A Class 2 laser emits in the visible portion of the spectrum (0.4 to 0.7 μm) and eye protection is normally afforded by the aversion response including the blink reflex.         |
| Class II/2    | Limits applicable to products that have emissions in the visible spectrum (400 to 710 nm) for emission durations in excess of 0.25 second, providing that emissions for other durations and/or wavelengths do not exceed the Class I limits. Class II products are considered hazardous for direct long-term ocular exposure.                          |   |
| Class IIIa/3a | Limits to products that have emissions in the visible spectrum and that have beams where the total collectable radiant power does not exceed 5 milliwatts.   | Class 3 lasers are divided into two subclasses, 3a and 3b. A Class 3 laser may be hazardous under direct and specular reflection viewing conditions, but the diffuse reflection is usually not a hazard.                                    |
| Class IIIb/3b | Limits applicable to devices that emit in the ultraviolet, visible, and infrared spectra. Class IIIb products include laser systems ranging from 5 to 500 milliwatts in the visible spectrum. Class IIIb emission levels are ocular hazards for direct exposure throughout the range of the Class, and skin hazards at the higher levels of the Class. |   |
| Class IV/4    | Exceeding the limits of Class IIIb and are a hazard for scattered reflection as well as for direct exposure.   | A Class 4 laser is a hazard to the eye or skin from the direct beam and sometimes from a diffuse reflection and also can be a fire hazard. Class 4 lasers may also produce laser-generated air contaminants and hazardous plasma radiation. |


## Label Indications

### ● EN

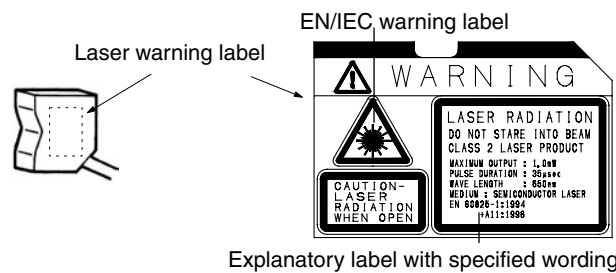


**Note:** Use of controls, adjustments, or procedures other than those specified herein may result in hazardous radiation exposure.

### ● FDA

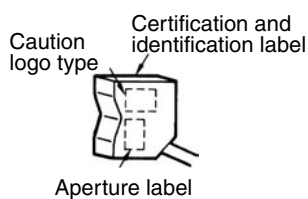

#### Aperture Label

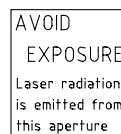

#### Class II Caution logo type



#### Certification and Identification Label




**Note:** Use of controls, adjustments, or procedures other than those specified herein may result in hazardous radiation exposure.

# Dimensions

(Unit: mm)


## ■ Sensor Heads (Diffuse Reflective)

- ZX-LD40
- ZX-LD100
- ZX-LD300
- ZX-LD40L
- ZX-LD100L
- ZX-LD300L

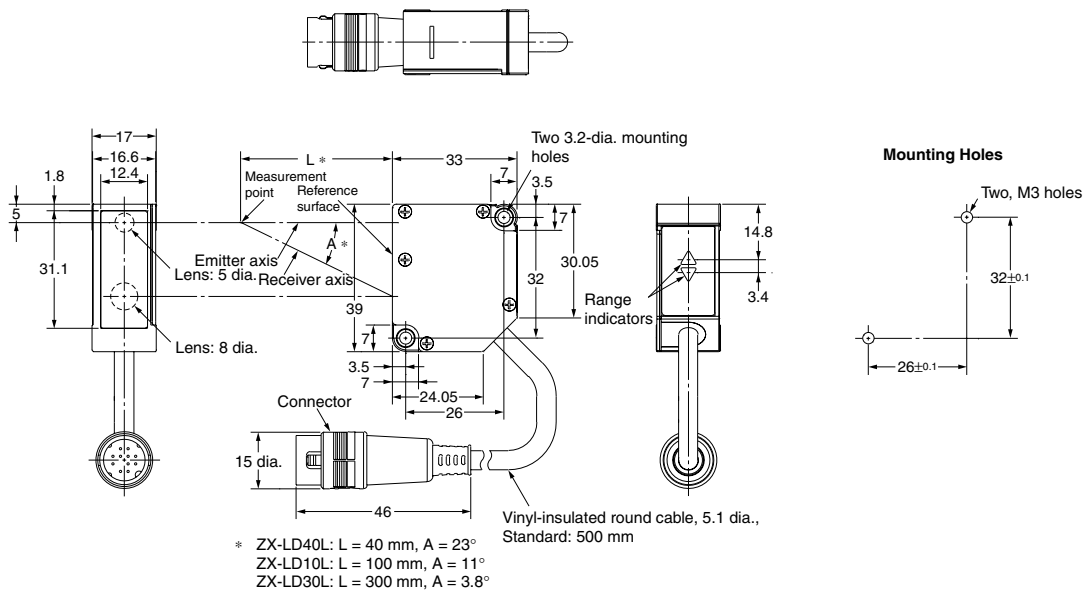



## ■ Sensor Heads (Regular Reflective)

- ZX-LD30V
- ZX-LD30VL

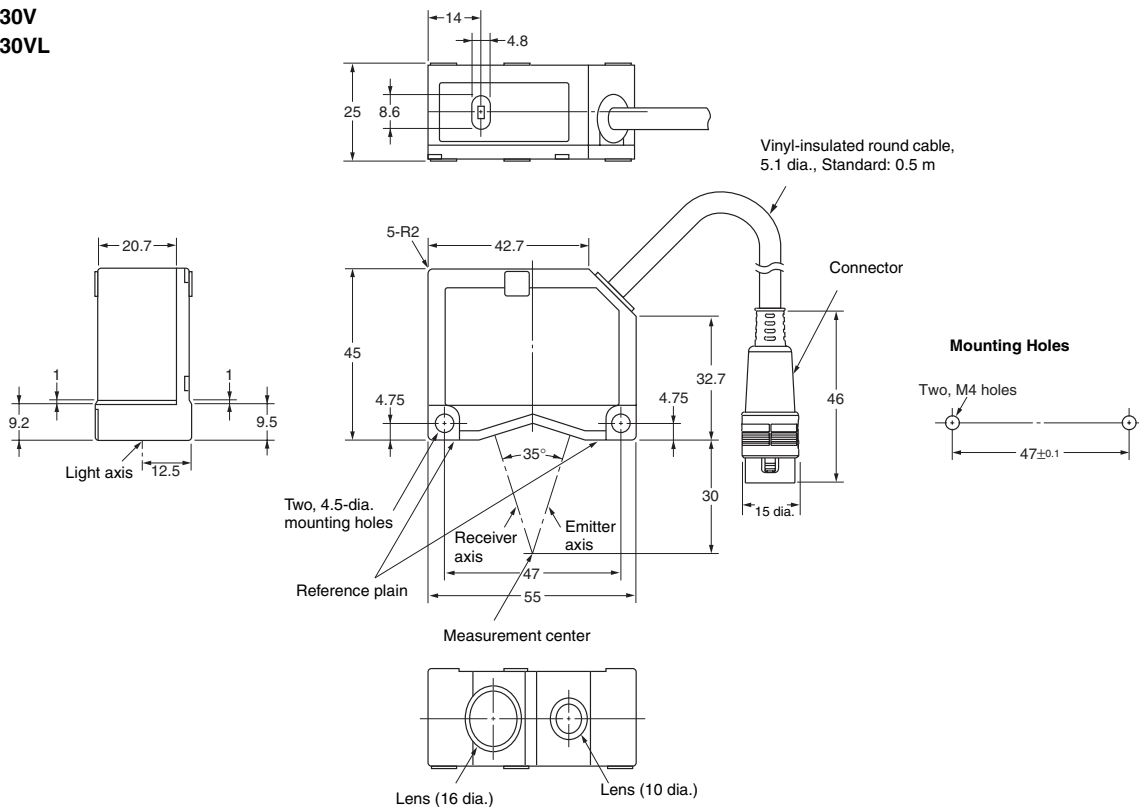


# ■ Sensor Heads (Through-beam)



ZX-LT001  
ZX-LT005

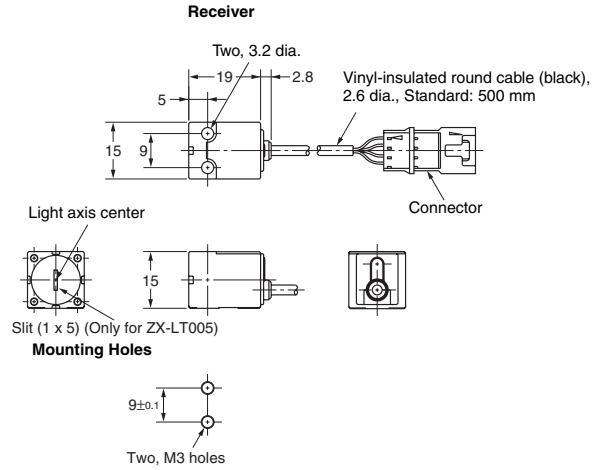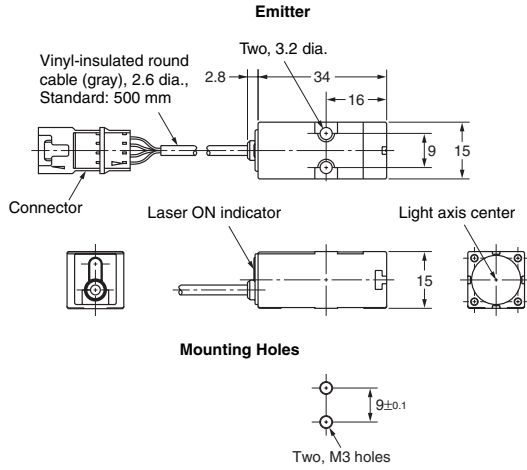


**Sensor Head-Amplifier Unit  
Connecting Cable (Provided)**

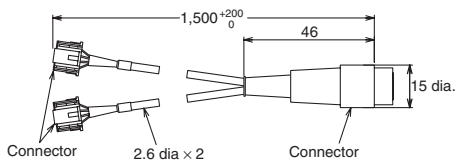

ZX-LT010

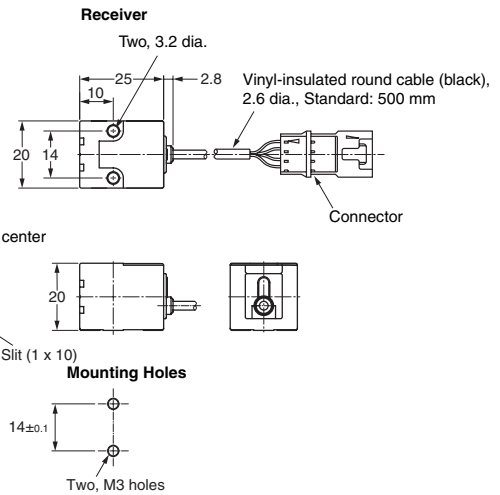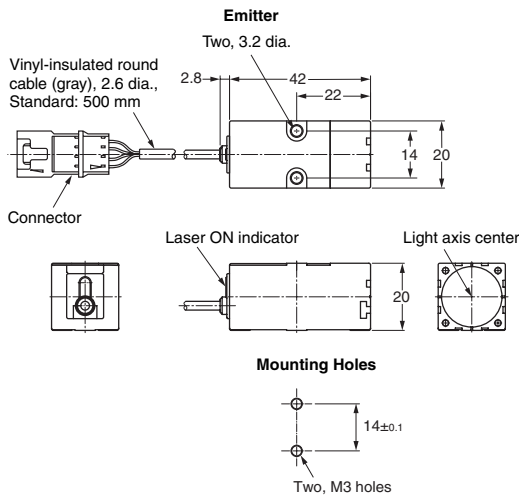


**Sensor Head-Amplifier Unit  
Connecting Cable (Provided)**

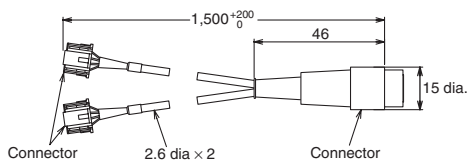




ZX-LT030

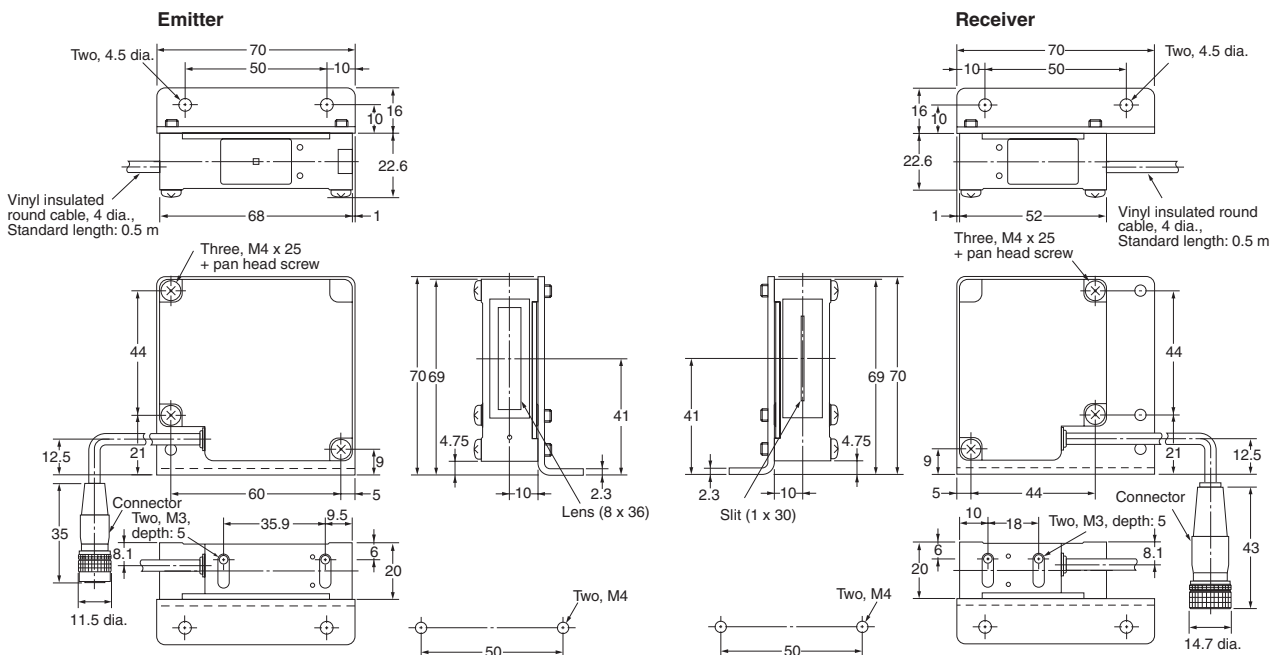


**Sensor Head - Amplifier Unit Connection Cable**

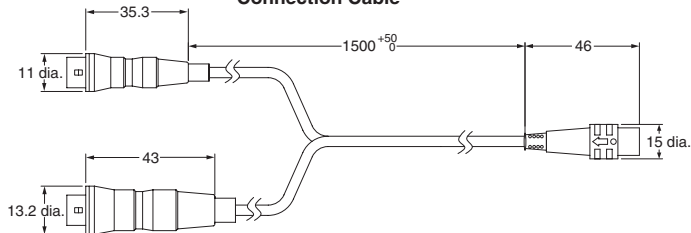


**Amplifier Units**

ZX-LDA11-N  
ZX-LDA41-N

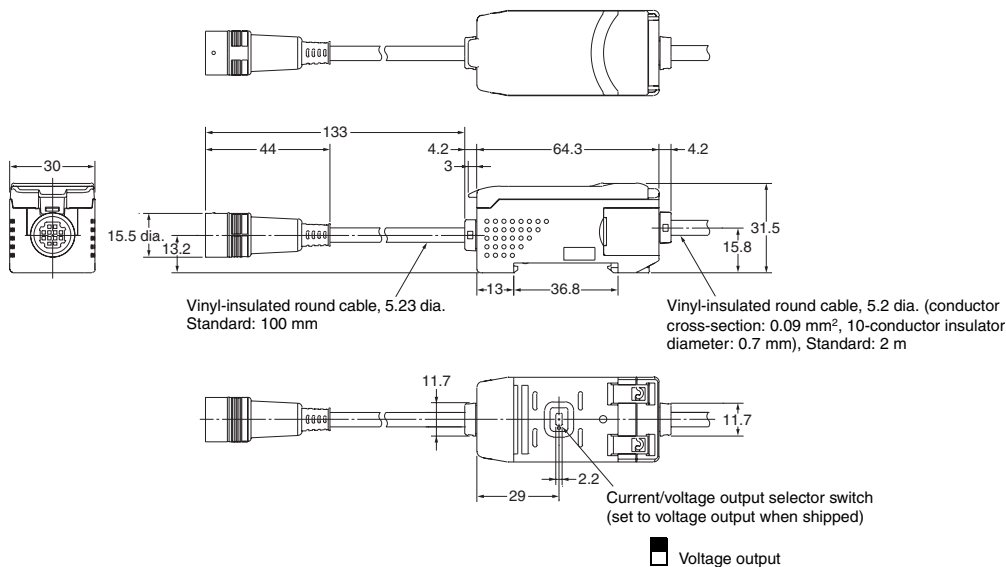


## ■ Accessories (Order Separately)


### Calculating Unit ZX-CAL2

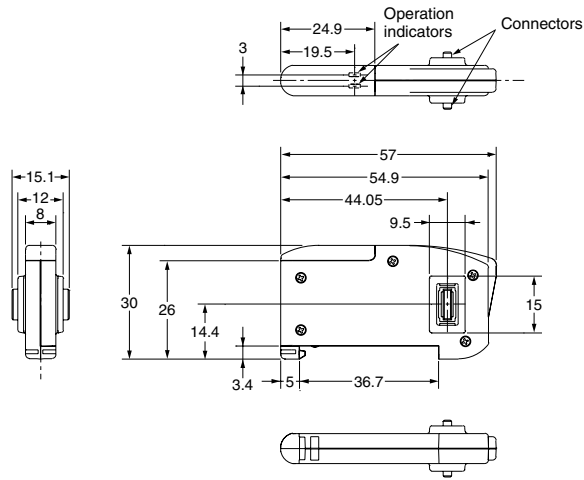


### Side-view Attachments ZX-XF12

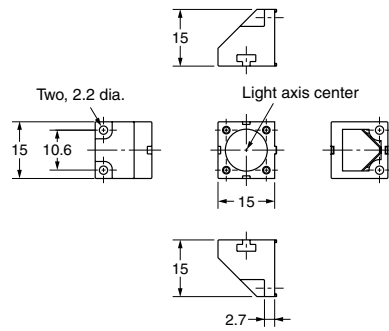

### ZX-XF22

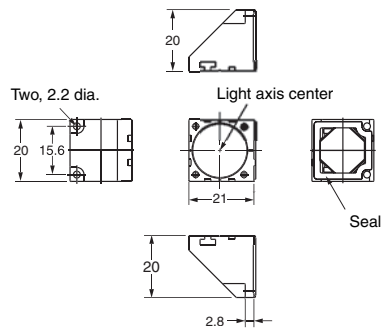


**ZX-series Communications Interface Unit**  
**ZX-SF11/ZX-SF21\***

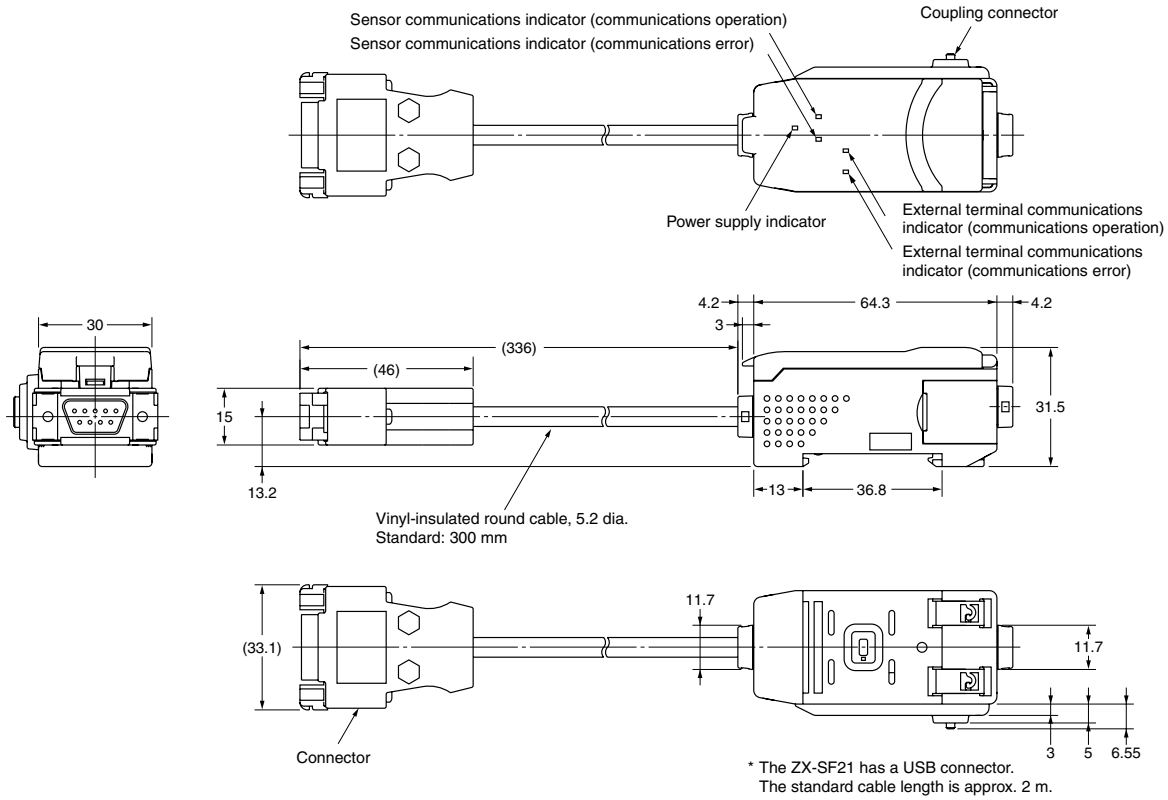

**Cables with Connectors on Both Ends (for Extension)**

- ZX-XC1A (1 m)**
- ZX-XC4A (4 m)**
- ZX-XC8A (8 m)**
- ZX-XC9A (9 m)**

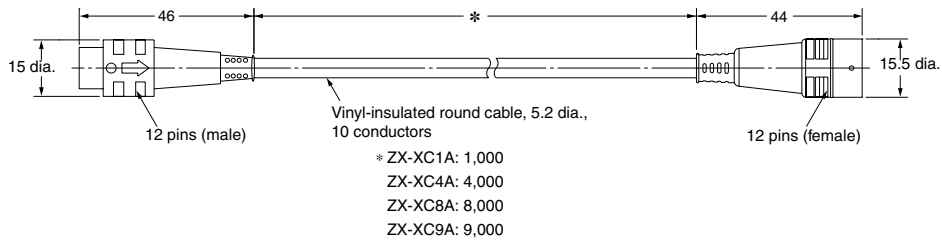

**ALL DIMENSIONS SHOWN ARE IN MILLIMETERS.**

To convert millimeters into inches, multiply by 0.03937. To convert grams into ounces, multiply by 0.03527.

This document provides information mainly for selecting suitable models. Please read the document Z197 carefully for information that the user must understand and accept before purchase, including information on warranty, limitations of liability, and precautions.

CSM\_1\_3\_0911

E349-E1

**In the interest of product improvement, specifications are subject to change without notice.**

## **OMRON Corporation**

**Industrial Automation Company**

**Sensing Devices Division H.Q.**

**Application Sensors Division**

Shiokoji Horikawa, Shimogyo-ku,

Kyoto, 600-8530 Japan

Tel: (81)75-344-7068/Fax: (81)75-344-7107